



Vehicle History Summary



Fleet #	CT16
Registration	YB80AE
Make	Graham Lusty
Model	Side Tipper
VIN / Chassis #	6V9GLT3TRDB012557
Build Date	2013

Date	Reading / Units	Type / Repairer Notes	Repairer
30/11/2025		Body, Mudguard, Planned Maintenance R-11397 Replaced guard with second hand one	Peter Harris
27/11/2025	614,039 kms	A - 12 Wks S-8020 Carried out A Service as per Service sheet	Aaron McCully
19/11/2025	609,289 kms	New T-1193 Fitted new pos 5,6,9,10,11,12	Mitch Grima
18/10/2025	586,123 kms	A - 12 Wks S-7634 Carried out A Service as per Service sheet	Josh Lewis
30/09/2025		Fire Extinguisher Inspection I-2654	Pyro Dynamics Pty Ltd
07/09/2025	562,633 kms	Breakdown, Hydraulics - IMPORTANT R-10308 Test Tipped, found front ram leaking Checked relief valves, found rubber in fitting and o-rings perished Changed out counter balance valves on lift cylinders and door cylinders Was still slow, Changed over equalizer blocks from Middle A trailer and Rear Trailer, worked correctly Removed blocks again and found Rubber wedges, removed and tested system Test Tipped Trailer after valve replacements Tested system multiple times, all operational	Aaron McCully, Daniel Farinha - Misso's
26/08/2025	556,973 kms	A - 12 Wks S-6980 Carried out A Service as per Service sheet In Addition Jacked all axles and inspected Wheel bearing adjustments Adjusted Pos 1 & 2 Wheel bearings	Aaron McCully, Daniel Farinha - Misso's, Mitch Grima
06/08/2025	543,663 kms	A - 12 Wks S-6741 Carried out A Service as per Service sheet	Mitch Grima
06/08/2025	543,663 kms	Body, Opportune Maintenance, Suspension - URGENT R-10575 Replaced Pos 5 Shock bolts Replaced 2x rear mudflaps	Mitch Grima
21/07/2025		Non-Destructive Testing Inspections - 12 Monthly I-2520 King Pin Mount - Cracking detected - Post repairs - No cracking detected	DTIS QLD PTY LTD
17/07/2025	531,378 kms	Breakdown, Tarp - IMPORTANT R-9720 Travel to railyard, Diagnose faulty Tarp Knuckle Replaced Knuckle, tested tarp Good to go	Peter Harris
15/07/2025	529,939 kms	Breakdown, Tarp - IMPORTANT R-9698 Replaced battery and repair damaged wiring, Inspected all connections All functions work ok	Matthew Twitchett
13/07/2025	529,337 kms	Body, Breakdown, Tarp - IMPORTANT R-9675 Removed old Bar, Repair one from Yard and fit into place Also fabricated centre brace bracket and fit	Greg Murratt
08/07/2025	526,929 kms	A - 12 Wks S-6383 Carry out A service as per service sheet	Daniel Farinha - Misso's, Mitch Grima

Date	Reading / Units	Type / Repairer Notes	Repairer
03/06/2025	513,112 kms	A - 12 Wks S-6083 Carried out A Service as per Service sheet attached	Matthew Twitchett
21/05/2025	504,846 kms	Compliance T-832 All tyres in Road condition, all pressures are good, Wheel nut indicators Fitted	Matthew Twitchett
20/05/2025		Brake Test 6 Months I-2156 Completed and passed 6 month Capcoal brake test	Hoppers Diesel and plant Hire
20/05/2025	504,487 kms	King Pin - IMPORTANT, Skid Plate R-9252 Inspected skid plate - Straight, no wear, no cracks Pins in correct position - in good condition	Matthew Twitchett, Peter Harris
12/05/2025		Lights - IMPORTANT R-9110 Disconnected reverse lights	jamie Geaney
12/05/2025	497,758 kms	A - 12 Wks S-5956 Carry out service as per service sheet R and R RH middle clearance light	Matthew Twitchett, Peter Harris
05/04/2025	473,882 kms	Brake Test 6 Months I-2036 Complete brake test for VD82 CT22 D19 CT15 CT16	Nick Fenton
01/04/2025	473,853 kms	A - 12 Wks S-5821 Carried out A Service as per Service paperwork attached	Harry Louis, Jye Storch
09/03/2025	463,016 kms	Tarp - IMPORTANT R-8413 Removed and replaced Tarp Cable Tensioner due to old cable being stretched	Liam Kitching - Misso
09/03/2025	463,059 kms	A - 12 Wks S-5739 Carried out A Service as per Service sheet	Daniel Farinha - Misso's
07/03/2025	461,892 kms	Lights - IMPORTANT R-8390 Travelled to Bp Peak downs Removed and replaced Trailer light socket Tested, all operational	Daniel Farinha - Misso's
03/03/2025	461,591 kms	Tarp - IMPORTANT R-8250 Removed existing tarp due to being ripped apart Installed second hand tarp in good condition, installed all components with new bolts and cables Tested operation, all ok	Harry Louis, Matthew Twitchett, Peter Harris
24/01/2025	451,538 kms	A - 12 Wks S-5556	Liam Kitching - Misso
14/12/2024		Brake Test 6 Months I-1784 Complete CONEQU and 6 monthly brake test - VD82 CT22 D19 CT15 CT16	Nick Fenton
04/11/2024	429,685 kms	Body R-7364 Grind, backing plate, weld.	Greg Murratt
02/11/2024	429,685 kms	Skid Plate R-7360 Cut & removed existing skid plate, found to be worn 4mm on 10mm plate Cut out & installed 16mm plate Installed new king pin & 50mm king pin assembly	Troy Francken
28/10/2024	429,582 kms	C - 12 Mnths S-5203 Replace brake shoes, drums, bearings. POS 6 brake booster bracket needs replacing. (1x mounting hose broken off)	Duane Hitch - Sourth East Mechanical
28/10/2024		Turntable - Ringfeeder and Kingpin Inspection I-1685	Duane Hitch - Sourth East Mechanical
28/10/2024	429,582 kms	Compliance, King Pin - IMPORTANT, Skid Plate R-7274 Carry out inspection on king pin and replace. Inspect skid plate.	Duane Hitch - Sourth East Mechanical
25/10/2024	429,281 kms	A - 12 Wks S-5192 POS 5 & 6 shocker u/s - Replaced POS 6 airbag u/s - Replaced Crack on bin RHS middle - Refer to R7364	Duane Hitch - Sourth East Mechanical
19/10/2024		Brake Test Annual I-1632	Damian Ryan

Date	Reading / Units	Type / Repairer Notes	Repairer
		Complete Vulcan compliance - VD82 CT22 D19 CT15 CT16	
26/09/2024	413,864 kms	A - 12 Wks S-4959 See attached jobcard	Duane Hitch - Sourth East Mechanical
25/08/2024		A - 12 Wks S-4779 See attached jobcard	Duane Hitch - Sourth East Mechanical
31/07/2024	381,189 kms	A - 12 Wks S-4540 See attached jobcard	Joseph Parker, Peter Harris
31/07/2024	381,189 kms	Retighten Wheels, Run Out T-260 See attached jobcard Travel, retorque wheels, travel back.	Genecy Dos Santos
24/06/2024		A - 12 Wks S-4378 See attached jobcard	Matthew Twitchett
24/06/2024	363,361 kms	New, Retighten Wheels T-212 See attached jobcard Retorque wheels.	Genecy Dos Santos
19/06/2024	361,243 kms	Hydraulics - IMPORTANT R-6080 See attached jobcard	Matthew Twitchett
15/06/2024		Conneq Pre Inspection I-1265 Complete CapCoal CONEQU pre inspection and brake test - PASS	Damian Ryan
15/06/2024		Conneq Pre Inspection I-1264 Complete CapCoal CONEQU pre inspection and brake test - PASS	Damian Ryan
15/06/2024		Brake Test 6 Months I-1331 Complete MBN 24W Brake Test - PASS VD82_CT22_D19_CT15_CT16	Gregory Fing
31/05/2024	346,427 kms	New, Retighten Wheels T-171 See attached jobcard Retorque wheels.	Genecy Dos Santos
30/05/2024	346,427 kms	A - 12 Wks S-4252 See attached jobcard	Duane Hitch - Sourth East Mechanical
15/05/2024	330,049 kms	A - 12 Wks S-4109 See attached jobcard Reflective tape fitted to door.	Peter Harris
17/04/2024	322,289 kms	A - 12 Wks S-4000 See attached jobcard	Duane Hitch - Sourth East Mechanical
28/03/2024	308,884 kms	New T-85 See attached jobcard Replaced with new tyres	Joseph Parker
27/03/2024		Turntable - Ringfeeder and Kingpin Inspection I-1049 See attached report	Sione Lousi
26/03/2024	308,884 kms	A - 12 Wks S-3735 See attached jobcard	Adam Wilson
21/03/2024		New T-76 See attached jobcard Replaced with run out Pos 6 inner	Jonathan Rafferty - Misso
05/03/2024	294,158 kms 5,882 hrs	Hydraulics - IMPORTANT, Leak - IMPORTANT R-4187 See attached jobcard Replaced relief valve on front left cyl.	Christopher Solmon
15/02/2024	284,085 kms 5,882 hrs	A - 12 Wks S-3619	Daniel Farinha - Misso's

Date	Reading / Units	Type / Repairer Notes	Repairer
		See attached jobcard	
09/02/2024	444,316 kms	Body R-4322	Daniel Breen - TMT
		See attached jobcard Carried out replacement of Pos 3 Wheel arch guard	
08/02/2024		New, Retighten Wheels, Run Out T-37	DBE Heavy Vehicle Repairs
		See attached jobcard Rotated Pos 5 Tyres from Inner to Outer Replaced Pos 3 with new tyres Replaced Pos 1 With Runouts Replaced pos 4 with runouts Carried out Re-torque	
05/02/2024		Other R-4204	Harry Louis
		See attached jobcard New number arranged to replace faded one, new registration is YB80AE. Sent to Dysart 02.02.2024 to place on trailer. Replaced number plate with new one	
04/02/2024		Leak - IMPORTANT R-2733	Internal Workshop
02/02/2024		Hydraulics - IMPORTANT, Leak - IMPORTANT R-3341	Internal Workshop
		See attached jobcard Can not fault leave	
26/01/2024		A - 12 Wks S-3490	Duane Hitch - Sourth East Mechanical
		See attached jobcard Number plate faded - Requires new number plate - Work order 4204	
26/01/2024		Turntable - Ringfeeder and Kingpin Inspection I-868	Duane Hitch - Sourth East Mechanical
		See attached inspection report	
03/01/2024		A - 12 Wks S-3362	Tim Brogden - JSF
		See attached jobcard Broken grease lines to rams - replace grease lines Registration plate faded - requires replacement - workorder	
05/12/2023		A - 12 Wks S-3251	Daniel Breen - TMT
		See attached jobcard Pos 5 slack adjuster sized - Removed and freed up slack adjuster - HL Pos 6 Slack adjuster - slack adjuster was freed up and adjusted - SL Pos 3 Airbag has hairline cracks around bottom, should replace next service - Next service Pos 6 Tyre worn uneven, requires replacing - replaced	
05/12/2023		Wheels/Tyres - URGENT R-3328	Sione Lousi
		See attached jobcard Slack adjuster was freed up and adjusted brakes Greased Monitor on next service	
01/12/2023		King Pin - IMPORTANT R-3466	Internal Workshop
		See attached jobcard 3466 Carry out inspection	
17/11/2023		A - 12 Wks S-3127	Internal Workshop
		See attached service jobcard 3127 Pos 2 slack adjuster siezed - managed to free up adjuster Pos 5 slack adjuster siezed could not free up - W/O created 3328	
23/10/2023	221,812 kms	Suspension - URGENT R-2855	Andrew Mollard
		See attached jobcard Greased and worked adjuster test ok	
23/10/2023		A - 12 Wks S-3029	Andrew Mollard
		See attached jobcard Crack in hinge on bin - weld crack	
23/10/2023	221,812 kms	Lights - IMPORTANT R-2854	Andrew Mollard
		See attached jobcard Blinker replaced	
05/10/2023		A - 12 Wks S-2921	Internal Workshop
		A Service carried out as per service record - CS	
05/10/2023		C - 12 Mnths S-2389	Internal Workshop
		C Service carried out as per service record - CS	
22/09/2023		Hydraulics - IMPORTANT R-2313	
		See attached repair job card 2313 Repair has been done already	
21/09/2023		A - 12 Wks S-2825	Internal Workshop

Date	Reading / Units	Type / Repairer Notes	Repairer
		See attached service job card 2825 Rear number plate worn	
14/09/2023		Lights - IMPORTANT R-2610 Attend to side indicator light not working, carry out test to locate cause of faulty light, remove and replace light and check ok	Internal Workshop
10/09/2023		Hydraulics - IMPORTANT R-2246 No fault found - Has been repaired	Internal Workshop
20/08/2023		A - 12 Wks S-2728 A Service carried out as per service record - DJ/TC	Internal Workshop
10/08/2023		Leak - IMPORTANT R-2314 Found diff lock was on and air leaking - repaired	Internal Workshop
25/07/2023		A - 12 Wks S-2519 A Service carried out as per service report	Lincoln Wild - LW Diesel & Contracting Services Pty Ltd
25/07/2023		A - 12 Wks S-2600 A Service carried out as per service report	Ryan Rosman - TMT Mechanical
15/07/2023		Leak - IMPORTANT R-1906 Replaced leaking hydraulic hook on front ram and sealed fittings	Randall Kruger - ADS
01/07/2023		Leak - IMPORTANT R-1928 Inspected for air leaks. Run up and tested brakes. Re-produced fault. Removed and replaced rear axle R12 relay valve due to exhausting constantly. Inspected for further leaks. Found airbag protection valve leaking. Returned to w/shop to source valve. Returned to trailer. Remove and Replace protection valve on 2nd last air tank. Run up and tested. All operational.	Ryan Rosman - TMT Mechanical
27/06/2023		Wheels/Tyres - URGENT R-1890 Change LHS 1st Axle tyres	Duane Hitch - Sourth East Mechanical
26/06/2023		Lights - IMPORTANT R-1800 Remove and replace new lamp	Hugh Middleton VDPH Maintenance Coordinator
15/06/2023		King Pin - IMPORTANT R-1765	Nick Fenton
10/06/2023		Hydraulics - IMPORTANT, Leak - IMPORTANT R-1708 Cleaned and re-sealed	Internal Workshop
09/06/2023		A - 12 Wks S-2351 A Service carried out as per service report LHS 1st Axle Airbag leaking - DH Height control valve not connected - Repaired DH Replaced bolt Crack in center of bin door - Welded LHS Rear mudflap torn - Replaced mudflap - DH Front door ram weeping - Replaced O-ring R.K	Duane Hitch - Sourth East Mechanical
05/06/2023		Other R-1717 Harry Louis - Remove and replace mudflap	Internal Workshop
18/05/2023		A - 12 Wks S-2246 A Service carried out as per service report Rear number plate not working - Repaired Weep from door ram on front of trailer - Monitor Cracks in body under door - Boilys HM RHS Rear indicator not working - Repair fitted new led indicator Cracks on LHS Front of chassis - Boilys HM	Duane Hitch - Sourth East Mechanical
16/05/2023		King Pin - IMPORTANT R-1531	Nick Fenton
29/04/2023		A - 12 Wks S-2140 A Service carried out as per service report Rear Right booster - Changed booster Rear axle Tri Bush's - Replaced bush's 29/04/23 HM	ATL Diesel Services - Jordan Hasenkam
12/04/2023		A - 12 Wks S-2027	Rob Brackowski - Callcorr

Date	Reading / Units	Type / Repairer Notes	Repairer
		A Service carried out as per service report Drum on air tank leaking - Ticked RB Pos 4 tyres u/s - Ticked RB	
26/03/2023		A - 12 Wks S-1929	Randall Kruger - ADS
		A Service carried out as per service report. Hydraulic ram pins not taking grease - Repaired Front door ram has an oil leak - Parts ordered S/ABLE HM	
10/03/2023		A - 12 Wks S-1844	Randall Kruger - ADS
		A Service carried out as per service report 1st axle RH brake booster needs replacing Air leak from air line fitting to booster 2nd axle RH	
21/02/2023		A - 12 Wks S-1752	ATL Diesel Services - Jordan Hasenkam
		As per service sheet	
08/02/2023		A - 12 Wks S-1676	Randall Kruger - ADS
		As per Service Report	
25/01/2023		A - 12 Wks S-1638	Luatasi Anesone Atileo
		As per Service Report	
11/01/2023		C - 12 Mnths S-1399	Hugh Middleton VDPH Maintenance Coordinator
		L/F Tyres worn - replaced	
11/01/2023		Fire Extinguisher Inspection I-460	Internal Workshop
15/12/2022		King Pin - IMPORTANT R-634	Nick Fenton
14/12/2022		Fire Extinguisher Inspection I-457	Internal Workshop
14/12/2022		A - 12 Wks S-1398	Randall Kruger - ADS
01/12/2022		A - 12 Wks S-1352	Rob Brackowski - Callcorr
		Serviced by Michael Beran Leak tilt ram front lower at fittings	
03/11/2022		C - 12 Mnths S-1209	Hugh Middleton VDPH Maintenance Coordinator
		R&R King Pin Replace LHM RHF Marker Lamps C Service Repack all hubs	
12/09/2022		A - 12 Wks S-1098	Hugh Middleton VDPH Maintenance Coordinator
30/08/2022		A - 12 Wks S-1040	Hugh Middleton VDPH Maintenance Coordinator
		NIL DEFECTS FOUND AT INSPECTION	
23/08/2022		A - 12 Wks S-1018	Hugh Middleton VDPH Maintenance Coordinator
		ALL BRAKES REQUIRED ADJUSTING	
05/08/2022		A - 12 Wks S-808	Hugh Middleton VDPH Maintenance Coordinator
		AXLE 3 LEFT BRAKE BUSTER LEAK - NEW BOOSTER	
05/08/2022		Fire Extinguisher Inspection I-262	Internal Workshop
		LAST SERVICE MAY 2022 - AS PER INSPECTION REPORT S-808 05/08/2022	
21/07/2022		Brake Test Annual I-358	Gregory Fing
		PASS- For MNM	
26/06/2022		A - 12 Wks S-855	ATL Diesel Services - Jordan Hasenkam
		Nil defects at inspection	
02/06/2022		Wheels/Tyres - URGENT R-302	Nick Fenton

Date	Reading / Units	Type / Repairer Notes	Repairer
31/05/2022		Fire Extinguisher Inspection I-202	Internal Workshop
12/05/2022		A - 12 Wks S-742 FL tyres u/s - replaced RL tyres u/s - replaced RR tyres u/s - replaced LH 1st axle slack adjuster - replaced	Hugh Middleton VDPH Maintenance Coordinator
21/04/2022		A - 12 Wks S-677 LHR lower shocker bolt - replaced	Hugh Middleton VDPH Maintenance Coordinator
23/03/2022		A - 12 Wks S-606 NIL defects at inspection	Hugh Middleton VDPH Maintenance Coordinator
07/02/2022		A - 12 Wks S-369 As per Service Report All Hub require end float adj - Replaced RhM Inner Tyres Flat Spotted - Replaced No reverse lights- Rewire Suzi	Internal Workshop
31/12/2021		Fire Extinguisher Inspection I-125 As per Service Report S369	Internal Workshop
14/12/2021		Brake Test MNM 3 Monthly I-80 Brake Test - PASS	Nick Fenton
09/12/2021		King Pin - IMPORTANT R-29 Replaced King Pin	Nick Fenton
16/09/2021		B - 12 Mnths S-48 B TRAILER SERVICE - Completed	Internal Workshop

Signed: _____

Name: _____

Date: _____