

Fleet #	CT22
Registration	YQ58XI
Make	Graham Lusty
Model	Side Tipper
VIN / Chassis #	6V9GLT3TRDB012561
Build Date	2013

Date	Reading / Units	Type / Repairer Notes	Repairer
27/11/2025	614,039 kms	A - 12 Wks S-8017 Carried out A Service as per Service sheet In addition to Service Replaced Pos 6 Slack Adjuster	Aaron McCully
20/11/2025	609,947 kms	Breakdown, Tarp - IMPORTANT R-11264 Replaced cable and spring. Tested All OK.	Peter Harris
18/10/2025	586,123 kms	A - 12 Wks S-7631 Carried out A Service as per Service sheet Repaired marker lights	Daniel Farinha - Misso's, Josh Lewis
18/10/2025	586,123 kms	Opportune Maintenance, Ring Feeder - IMPORTANT R-10526 Removed ring feder Rebuilt assembly Refitted with new bushes and cushion rubbers	Aaron McCully
30/09/2025		Fire Extinguisher Inspection I-2652	Pyro Dynamics Pty Ltd
01/09/2025	560,804 kms	Planned Maintenance, Tarp - IMPORTANT R-10173 Diagnosed battery not charging. Found to be faulty battery, fitted new battery. Tested ok.	Peter Harris
25/08/2025	556,473 kms	A - 12 Wks S-6977 Carried out A Service as per Service sheet In Addition Jacked all axles and inspected Wheel bearing adjustments	Aaron McCully, Daniel Farinha - Misso's, Mitch Grima
10/08/2025		Breakdown, Hydraulics - IMPORTANT R-10017 Travelled to Moranbah to inspect Hydraulic hose fault Found front Door ram hose fitting broken at Crimp Replaced hose and topped up oil level	Mitch Grima
06/08/2025	543,663 kms	New, Run Out T-1014 Replaced Pos 3 inner tyre with run out Replaced Pos 2 tyres with new	Mitch Grima
06/08/2025	543,663 kms	A - 12 Wks S-6738 Carried out A Service as per Service sheet	Mitch Grima
21/07/2025		Non-Destructive Testing Inspections - 12 Monthly I-2517 King Pin Mount - Cracking Detected - Post Repair - No cracking detected Ringfeeder - No cracking detected	DTIS QLD PTY LTD
14/07/2025	529,759 kms	Brakes - URGENT, Planned Maintenance R-9688 Replaced 2 port road train valve due to internally bypassing	Aaron McCully
08/07/2025	526,929 kms	A - 12 Wks S-6380 Carry out A service as per service sheet	Daniel Farinha - Misso's
04/07/2025		breakdown, Puncture T-877 Fitted R/O tyre to Pos 6	Matthew Twitchett
03/06/2025	513,112 kms	A - 12 Wks S-6080 Carried out A Service as per Service sheet attached	Joseph Parker, Matthew Twitchett

Date	Reading / Units	Type / Repairer Notes	Repairer
21/05/2025	504,846 kms	Compliance T-829 Tyres in road good condition, Some tyres not at wear limit yet, Pressures good, Indicators fitted	Peter Harris
20/05/2025		Brake Test 6 Months I-2154 Completed and passed 6 month Capcoal brake test	Hoppers Diesel and plant Hire
20/05/2025	504,487 kms	Compliance, King Pin - IMPORTANT, Ring Feeder - IMPORTANT, Skid Plate R-9249 Skid plate inspected - In good condition, straight, no cracks King pin in correct position and in good condition Ring feeder inspected, red wear plate replaced, in good condition	Matthew Twitchett, Peter Harris
17/05/2025	501,442 kms	Tarp - IMPORTANT R-9207 Replaced Tarp cable pre-tensioner with second hand unit Tested tarp, all operational	Daniel Farinha - Misso's
12/05/2025	497,758 kms	A - 12 Wks S-5953 Carry out service as per service sheet	Peter Harris
21/04/2025		Fault T-751 Tyres replaced at time of Report	Internal Workshop
07/04/2025		Brake Test 6 Months I-2033 Complete brake test for VD82 CT22 D19 CT15 CT16	Nick Fenton
01/04/2025	473,853 kms	A - 12 Wks S-5818 Carried out A Service as per Service paperwork attached	Harry Louis, Robert Brackowski
23/03/2025	473,846 kms	Body R-8153 Grind out crack weld up and fit fish plate	Troy Francken
09/03/2025	463,057 kms	A - 12 Wks S-5736 Carried out A Service as per Service sheet	Daniel Farinha - Misso's
05/03/2025	461,591 kms	Tarp - IMPORTANT R-8251 Load tested old battery, CCA's were too low Removed and replaced with new battery, tested, all operational	Daniel Farinha - Misso's, Harry Louis
24/01/2025	451,538 kms	A - 12 Wks S-5553	Internal Workshop
14/12/2024		Brake Test 6 Months I-1785 Complete CONEQU and 6 monthly brake test - VD82 CT22 D19 CT15 CT16	Nick Fenton
04/11/2024	429,685 kms	Body R-7362 Grind crack, back plated & weld.	Greg Murratt
28/10/2024	429,582 kms	Compliance, King Pin - IMPORTANT, Ring Feeder - IMPORTANT, Skid Plate R-7271 Carry out inspection on king pin boss. Rebuild ring feeder and fit new king pin. Inspect skid plate.	Duane Hitch - Sourth East Mechanical
28/10/2024		Turntable - Ringfeeder and Kingpin Inspection I-1686	Duane Hitch - Sourth East Mechanical
26/10/2024	429,582 kms	C - 12 Mnths S-5200 Replaced POS 1,2,3,4,5 & 6 brake shoes Replaced POS 1,2,3,4,5 & 6 brake drums Replaced POS 1,2,3,4,5 & 6 bearing sets Replaced POS 5 & 6 shockers Replaced POS 5 airbag Replaced POS 5 & 6 tri-functional bushes	Duane Hitch - Sourth East Mechanical, Matthew Twitchett
24/10/2024	429,581 kms	A - 12 Wks S-5189 Ring feeder loose bushes lose - Rebush ring feeder Crack on middle of bin - Refer to R7362	Duane Hitch - Sourth East Mechanical, Harry Louis, Matthew Twitchett
19/10/2024		Brake Test Annual I-1629 Complete Vulcan compliance - VD82 CT22 D19 CT15 CT16	Damian Ryan
11/10/2024	422,079 kms	Brakes - URGENT R-7100	Handriaan Bashoff, Peter Harris

Date	Reading / Units	Type / Repairer Notes	Repairer
		See attached jobcard POS 5&6 booster replaced.	
11/10/2024	422,079 kms	Lights - IMPORTANT R-6897	Peter Harris
		See attached jobcard No fix needed, light not in use.	
26/09/2024	413,864 kms	A - 12 Wks S-4956	Duane Hitch - Sourth East Mechanical
		See attached jobcard	
17/09/2024		New, Run Out T-347	Genecy Dos Santos
		See attached jobcard Change POS 5, 6 flat / 9, 10 hold. Replace with runout end new tyres. Travel, retorque wheels, travel back.	
30/08/2024	401,500 kms	New T-311	Genecy Dos Santos
		See attached jobcard Travel, retorque wheels Fit new	
25/08/2024		A - 12 Wks S-4776	Duane Hitch - Sourth East Mechanical
		See attached jobcard	
31/07/2024	381,189 kms	A - 12 Wks S-4537	Joseph Parker, Peter Harris
		See attached jobcard	
24/06/2024		A - 12 Wks S-4375	Matthew Twitchett
		See attached jobcard	
15/06/2024		Brake Test 6 Months I-1328	Gregory Fing
		Complete MBN 24W Brake Test - PASS VD82_CT22_D19_CT15_CT16	
15/06/2024		Conneq Pre Inspection I-1267	Damian Ryan
		Complete CapCoal CONEQU pre inspection and brake test - PASS	
09/06/2024	354,052 kms	Brakes - URGENT R-6005	Jonathan Rafferty - Misso
		See attached jobcard Found air bypassing through the booster. Removed old one, adjusted head of booster, put back on, adjusted brakes and everything worked fine.	
09/06/2024	355,733 kms	Suspension - URGENT R-6007	Jonathan Rafferty - Misso
		See attached jobcard Replaced ride height valve, worked fine.	
30/05/2024	346,427 kms	A - 12 Wks S-4249	Duane Hitch - Sourth East Mechanical
		See attached jobcard	
15/05/2024		Other R-5458	Duane Hitch - Sourth East Mechanical
		See attached jobcard Replaced o-ring in valve.	
15/05/2024	335,094 kms	A - 12 Wks S-4106	Peter Harris
		See attached jobcard POS 6 inner removed, replaced with s/h tyre. No plate light replaced, wiring repaired. POS 2 & 4 air bags replaced. POS 4 wheel bearing adjusted. Sums shocky bolts tightened. Door reflectors replaced.	
14/05/2024	335,094 kms	New, Retighten Wheels, Rotate T-156	Genecy Dos Santos
		See attached jobcard	
17/04/2024	322,289 kms	A - 12 Wks S-3997	Duane Hitch - Sourth East Mechanical
		See attached jobcard	
15/04/2024		Chassis R-5216	Daniel Farinha - Misso's
		See attached jobcard Removed legs from CT13 and fitted to CT22 Replaced all seized bolts	
27/03/2024	308,884 kms	New T-84	Joseph Parker
		See attached jobcard	
27/03/2024		Turntable - Ringfeeder and Kingpin Inspection I-1050	Joseph Parker
		See attached report	
26/03/2024	308,884 kms	A - 12 Wks S-3732	Adam Wilson

Date	Reading / Units	Type / Repairer Notes	Repairer
		See attached jobcard	
10/03/2024	298,718 kms	Tarp - IMPORTANT R-4722	Duane Hitch - Sourth East Mechanical
		See attached jobcard Replaced tarp cable and spring	
17/02/2024	283,819 kms	New T-48	Daniel Farinha - Misso's
		See attached jobcard	
15/02/2024	284,085 kms 5,882 hrs	Body R-4023	Daniel Farinha - Misso's
		See attached jobcard Check all cables in front all ok	
14/02/2024	284,085 kms 5,882 hrs	A - 12 Wks S-3616	Daniel Farinha - Misso's
		See attached jobcard	
26/01/2024		A - 12 Wks S-3487	Duane Hitch - Sourth East Mechanical
		See attached jobcard	
26/01/2024		Turntable - Ringfeeder and Kingpin Inspection I-869	Duane Hitch - Sourth East Mechanical
		See attached inspection report	
15/01/2024		Wheels/Tyres - URGENT R-4008	Daniel Farinha - Misso's
		See attached jobcard Change tyres	
03/01/2024		A - 12 Wks S-3359	Tim Brogden - JSF
		See attached jobcard Broken grease lines - replaced grease lines	
05/12/2023		A - 12 Wks S-3248	Daniel Breen - TMT
01/12/2023		King Pin - IMPORTANT, Ring Feeder - IMPORTANT R-3463	Internal Workshop
		See attached jobcard 3463 Replaced 90mm king pin	
17/11/2023		A - 12 Wks S-3124	Internal Workshop
		See attached service jobcard 3124 POS 2, 3, 4 CT22 bearings needs adjustments - take hub caps off and adjust to correct adjustment POS 5mud guard broken - replaced mud guards	
23/10/2023		A - 12 Wks S-3026	Andrew Mollard
		See attached jobcard	
05/10/2023		C - 12 Mnths S-2387	Internal Workshop
		C Service carried out as per service record - CS	
05/10/2023		A - 12 Wks S-2918	Internal Workshop
		A service carried out as per service record - CS Mud guard damage	
22/09/2023		Brakes - URGENT R-2604	Internal Workshop
		See attached repair job card 2604 Repaired air leak on dolly	
21/09/2023		Chassis, Tarp - IMPORTANT R-2652	Internal Workshop
		See attached repair job card 2652	
21/09/2023		A - 12 Wks S-2822	Internal Workshop
		See attached service job card 2822 POS 2 tyres low tread - Replaced with new tyres POS 3 Air bag leaking needs replacing - Done Height control valve leaking need replacing - done Tarp fault - repaired operation Bailing arm air ram leaking - Replaced	
20/08/2023		A - 12 Wks S-2725	Internal Workshop
		A Service carried out as per service record - DJ/TC Adjusted 6 x wheel bearings Remove and replace POS6 shocker U/S 90 angle Remove and replace air leak relay valve	

Date	Reading / Units	Type / Repairer Notes	Repairer
18/08/2023		Wheels/Tyres - URGENT R-2409 POS6 change tyre with new	Internal Workshop
31/07/2023		Tarp - IMPORTANT R-2286 REpaired blown fuze in tarp motor	Randall Kruger - ADS
27/07/2023		Wheels/Tyres - URGENT R-2280 Replace 2 x tyres on 2nd axle LHS Used runouts on third axle Tensioned wheel nuts	Randall Kruger - ADS
25/07/2023		A - 12 Wks S-2516 A Service carried out as per service report Air leak at front air tank - Tightened loose hose clamps - LW Rear signage perished - Removed and repaired directional signage and dot signage RR & LW	Lincoln Wild - LW Diesel & Contracting Services Pty Ltd, Ryan Rosman - TMT Mechanical
25/07/2023		A - 12 Wks S-2597 A Service carried out as per service report	Ryan Rosman - TMT Mechanical
19/07/2023		Wheels/Tyres - URGENT R-2141 Retorque wheel nuts 2nd axle LH	Randall Kruger - ADS
17/07/2023		Tarp - IMPORTANT R-2124 Roll up tarp unjam bailing arm and test	Duane Hitch - Sourth East Mechanical
09/07/2023		Other R-1970 Adjust door defect	DBE Heavy Vehicle Repairs, Hugh Middleton VDPH Maintenance Coordinator
26/06/2023		Lights - IMPORTANT R-1799 No Repair Required	Hugh Middleton VDPH Maintenance Coordinator
26/06/2023		Wheels/Tyres - URGENT R-1905 Replaced LHM tyre	Internal Workshop
21/06/2023		Leak - IMPORTANT R-1841 Inspected air leak from R12 Valve. Applied lubricant to valve. Removed and Relaced T-piece fitting. Run up and tested all ok	Ryan Rosman - TMT Mechanical
15/06/2023		King Pin - IMPORTANT R-1763	Nick Fenton
09/06/2023		A - 12 Wks S-2348 A Service carried out as per service report Ring Feeder worn - Replaced HM	Duane Hitch - Sourth East Mechanical
18/05/2023		A - 12 Wks S-2243 A Service carried out as per service report Front RHS Marker lights out - Repaired fitted new lights	Duane Hitch - Sourth East Mechanical
16/05/2023		King Pin - IMPORTANT R-1529	Nick Fenton
29/04/2023		Damage R-1455 Change out tarp pole wire. Repair Front right hand side light	Duane Hitch - Sourth East Mechanical
28/04/2023		A - 12 Wks S-2137 A Service carried out as per service report Drain dock leaking - fitted new one Front left air bag leaking - Fitted new one Two side lights out - New lamps	Internal Workshop
19/04/2023		Tarp - IMPORTANT R-1359 Tarp not working - Found charger for tarp battery not working and battery flat. Replaced battery with a charged one to run for the night until repairs can be made to the charger. Made some adjustments to the tension cable and checked operation - Ok to run Defer repairs	Randall Kruger - ADS
12/04/2023		A - 12 Wks S-2024	Rob Brackowski - Callcorr

Date	Reading / Units	Type / Repairer Notes	Repairer
		A Service carried out as per service report Susi coil plug wires touching corroded - Ticked RB Pos 4 tyres u/s - Ticked RB Rear door hydraulic block oil leak - Ticked RB	
26/03/2023		A - 12 Wks S-1926	Randall Kruger - ADS
		A Service carried out as per service report. R-1111/F-1201 - Fault repaired Lifting Ram pins not taking grease - Repaired	
23/03/2023		Suspension - URGENT R-1111	Hugh Middleton VDPH Maintenance Coordinator
		Remove and renew RHR Airbag	
10/03/2023		A - 12 Wks S-1841	Randall Kruger - ADS
		A Service carried out as per service report Air leaks at brake chamber hoses - Tightened	
21/02/2023		A - 12 Wks S-1749	ATL Diesel Services - Jordan Hasenkam
		As per service sheet	
08/02/2023		A - 12 Wks S-1673	Randall Kruger - ADS
		As per Service Report	
25/01/2023		A - 12 Wks S-1635	Luatasi Anesone Atileo
		As per Service Report	
11/01/2023		Fire Extinguisher Inspection I-463	Internal Workshop
11/01/2023		C - 12 Mnths S-1402	Hugh Middleton VDPH Maintenance Coordinator
		F/R tyres rip tread - replaced	
15/12/2022		King Pin - IMPORTANT R-632	Nick Fenton
14/12/2022		Fire Extinguisher Inspection I-458	Internal Workshop
14/12/2022		A - 12 Wks S-1395	Randall Kruger - ADS
01/12/2022		A - 12 Wks S-1350	Rob Brackowski - Callcorr
		Serviced by Michael Beran	
03/11/2022		C - 12 Mnths S-1210	Hugh Middleton VDPH Maintenance Coordinator
		R&R King pin C Service all hubs & repacked R&R RHR Booster & hoses	
12/09/2022		A - 12 Wks S-1095	ATL Diesel Services - Jordan Hasenkam
30/08/2022		A - 12 Wks S-1037	Hugh Middleton VDPH Maintenance Coordinator
		Nil defects at inspection	
23/08/2022		A - 12 Wks S-1014	Hugh Middleton VDPH Maintenance Coordinator
		NIL DEFECTS FOUND AT INSPECTION	
05/08/2022		Fire Extinguisher Inspection I-264	Internal Workshop
		LAST SERVICE MAY 2022- AS PER INSPECTION REPORT S -961 05/058/2022	
05/08/2022		A - 12 Wks S-961	Hugh Middleton VDPH Maintenance Coordinator
		AXLE 2 BRAKE BUSTER LEAK RIGHT - REPLACED	
21/07/2022		Brake Test Annual I-355	Gregory Fing
		PASS- For MNM	
09/06/2022		A - 12 Wks S-811	Nick Fenton

Date	Reading / Units	Type / Repairer Notes	Repairer
31/05/2022		Fire Extinguisher Inspection I-204	Internal Workshop
12/05/2022		A - 12 Wks S-739 LH front tyres low - replaced	Hugh Middleton VDPH Maintenance Coordinator
21/04/2022		A - 12 Wks S-674 front bin ram leaking - renew ram	Hugh Middleton VDPH Maintenance Coordinator
14/04/2022		Damage R-201	Hugh Middleton VDPH Maintenance Coordinator
23/03/2022		A - 12 Wks S-603 RH 3rd hub adjustment LHM hub adjustment requires ring feeder overhaul TBRB 8.4.22 all tyres nearing limit TBRB 8.4.22	Hugh Middleton VDPH Maintenance Coordinator
07/02/2022		A - 12 Wks S-444 As per Service Report Oil leak at rear hyd hose to tema - secured Rear tail gate grease uni split - Next Service Front rail gate grease line split - Next Service	Hugh Middleton VDPH Maintenance Coordinator
04/02/2022		Lights - IMPORTANT R-90	Hugh Middleton VDPH Maintenance Coordinator
31/12/2021		Fire Extinguisher Inspection I-123 As per Service Report S444	Internal Workshop
13/12/2021		Brake Test MNM 3 Monthly I-79 Brake Test - PASS	Nick Fenton
11/11/2021		A - 12 Wks S-6 A TRAILER SERVICE - Completed	Internal Workshop
11/11/2021		King Pin - IMPORTANT R-7 Replace King Pin for Cap Coal Compliance	Nick Fenton
02/09/2021		B - 12 Mnths S-314 C Service	Nick Fenton

Signed: _____

Name: _____

Date: _____