



Vehicle History Summary



Fleet #	VD60
Registration	XQ22TP
Make	Western Star
Model	4800 Series
VIN / Chassis #	5KKHBEDR0FPGC7426
Build Date	2015

Date	Reading / Units	Type / Repairer Notes	Repairer
		Leak - IMPORTANT, PTO R-12275	
		Fault, Flat Tyre T-1589	
		Air Conditioner R-12424	
		Fault, Leak - IMPORTANT R-12809	
		Cab, Seat R-12289	
02/06/2026	18,858 hrs	A - 250 S-8162 carried out service as per service sheet completed by Tristan 11/05/26	Tristan O'Neill
25/05/2026	18,880 hrs	tyre steer R-11953 removed both steer tyres and replaced with 11r tyres. once the original tyre is back from repair the original tyres need to go back on Correct tyres fitted	Pat McCoy
28/04/2026	18,823 hrs	Lights - IMPORTANT R-12425 Rectified Blue Flashing light on Unit 33	Pat McCoy
17/04/2026		Fire Extinguisher Inspection I-2808 Annual service completed on machines fire extinguishers.	Pyro Dynamics Pty Ltd
31/03/2026		Non-Destructive Testing Inspections - 12 Monthly I-2867	DTIS QLD PTY LTD
16/02/2026	773,873 kms 18,456 hrs	A - 250 S-8425 18456hr service changed eng oil and filter changed 4x fuel filters grease top up gearbox 12L sae50 check all other fluids	Timothy McFadzen Contracting
13/02/2026	18,459 hrs	Bonnet R-12065 checked over, fine to run	
12/02/2026	18,457 hrs	Leak - IMPORTANT, PTO R-12051 already a job open for this	
03/01/2026		Water Pump R-11648 replaced pull chord and fuel line on flex drive pump . run up all ok swapped vd56 for vd60 for better hyd flow - water pressure	Timothy McFadzen Contracting
15/10/2025	767,255 kms	Transmission/Clutch - URGENT R-10396	Penske Australia

Date	Reading / Units	Type / Repairer Notes	Repairer
		REPAIRED BY PENSKE Cause: XY shifter fault XY shifter memory fault Battery voltage issues due high resistance connections Correction: Connect service ranger 4 to vehicle. Inspect fault codes. Found active code 17 Start enable relay FMI14 and inactive. Code 71, unable to disengage gear. Test drive vehicle unable to fault shifting. Unable to replicate customers complaint of intermittent shifting issues and random neutralisation. Inspect XY shifter Found movement in x and Y shift motors. Diagnose XY as faulty - R&R Found XY shifter constantly moving when key is off. Unable to find suitable position. Contact Easton tech support. Found procedure for clearing position memory. Follow procedure. Clear programming and software and reprogram. Cycle key XY now finding correct position when powering off. Attempt to start vehicle and found neutral start relay. Switching off under start. Test voltage to vehicle under crank. Found high voltage drop reading in ground circuit. Found ground stud near batteries heating up under high load. Remove, clean up and reterminate. Found voltage drop better but still dropping to 8V to vehicle under crank. Found 3V drop through battery isolator. Clean up terminals on isolator. Test, voltage drop issue rectified. Starter motor now receiving full battery voltage. Set engine up in compression test mode to test start function fully without engine starting to confirm function of start enable relay . Found under extended crank all power to cab lost . Found PNDB on front wall cutting power to cab. Found physically tapping PNDB module power reapplied. Diagnose PNDB as faulty - R&R Test start sequence. Found vehicle can now crank for longer than 5Sec with full system voltage to give TECU correct signal while completing 'Enable Start Relay Self Test'. Completed test successfully and code 17 now inactive. Diagnose multiple high resistance connections and faulty PNDB not allowing TECU to complete start enable relay self Test also hindering starting intermittently.	
15/10/2025	767,355 kms	Air Conditioner R-10390 air con repaired new compressor and service completed run and test operation all ok.	Internal Workshop
07/10/2025	17,993 hrs	Fuel R-10397	Internal Workshop
14/09/2025		Fire Extinguisher Inspection I-2370	Pyro Dynamics Pty Ltd
08/09/2025	767,033 kms 17,970 hrs	D - 2000 S-6580	Internal Workshop
28/08/2025	767,000 kms	Steering - URGENT R-8579 replace all rear trailing arm bush's as required replace 1 x damaged wheel stud	internal work
25/08/2025	766,253 kms 17,924 hrs	Fuel Pump R-9988 Primed fuel system tightened loose fuel line back of head filled coolant with water - needs to be flush and refilled resealed temur couplings clear fault codes	
17/08/2025	17,968 hrs	Mudguard R-9898 Fitted new pos 5 mudguard	Internal Workshop
21/07/2025	765,619 kms 17,878 hrs	A - 250 S-6453 250 hr service completed repaired reverse alarm rewired beacon on trailer to run all the time repaired air leak at treddel valve needs rear trailing arm bushes (have ordered previously) air dryer rebuild kit o-ring kit for pto couplers	Internal Workshop
04/07/2025	17,770 hrs	Leak - IMPORTANT R-9628	Internal Workshop
21/06/2025	18,944 hrs	Fault R-9461	Internal Workshop
03/06/2025	17,612 hrs	Hydraulics - IMPORTANT R-9298	Internal Workshop
31/03/2025	761,461 kms 17,561 hrs	Asset Inspection Report - Initial I-1996 ONHIRE INPSECTION COMPLETE AFTER SERVICE AND REPAIRS COMPLETED	Huntter Cannell
19/03/2025		Other R-9534 Fit new stickers Remove road train signs Make and fit rock protection guard for rear windscreen Detail cab Check operation of hyd system on water cart Make new hyd hoses for trailer Fit new suzi coils to truck Fit new trailer plug lead to truck Fit mud guards to rear of trailer Check all lights diagnose and rectify flashing light issue	Brad Deguara
12/03/2025	761,461 kms 17,561 hrs	Air Conditioner R-8193 SERVICE A/C UNBLOCK EVEP DRAIN HOSE RUN AND TEST OPERATION ALL OK	Internal Workshop

Date	Reading / Units	Type / Repairer Notes	Repairer
10/03/2025	761,461 kms 17,561 hrs	HORN R-8265 repair as required fit new horns check operation all ok	Internal Workshop
10/03/2025		Fire Extinguisher Inspection I-1924 Pats used: 2 x ties 2 x UV bagsVD60 no longer has a fire suppression system installed. Only x2 extinguisher & asset is now a water cart, not a haul truck & only the water tank trailer no other trailers. Service time: 0.5hrs Travel from site: 0.5hrs Pats used: 2 x ties 2 x UV bags	Pyro Dynamics Pty Ltd
10/03/2025		First Aid Kit I-1925 First Aid Kit installed	
10/03/2025		Non-Destructive Testing Inspections - 12 Monthly I-2053 NDT inspection mine spec	DTIS QLD PTY LTD
10/03/2025	761,461 kms 17,561 hrs	Chassis R-8303 REPLACE POS1-2 KING PINS AND WHEEL BEARINGS	VDPH Sarina
28/02/2025	761,125 kms 17,554 hrs	Hydraulics - IMPORTANT R-8253 remove tank and repair J-Bracket as required, refit tank and fill with oil run and test operation	VDPH Sarina
27/02/2025		Windscreen/Mirrors - IMPORTANT R-7129 Booked in for replacement 13-17/01/25 @ Sarina workshop. windscreens replaced 17/01/25	Internal Workshop
20/02/2025	750,559 kms	Hydraulics - IMPORTANT R-7973	Internal Workshop
20/02/2025	750,559 kms	BULLBAR R-7966 remove broken mount, refit mount modifies and make Stroger. Refit bullbar test lights repair spotlights	Internal Workshop
20/02/2025	750,559 kms	Lights - IMPORTANT R-7971 found blown fuse, replaced with 30amp fuse and holder very hot checked wiring seems ok	Internal Workshop
07/01/2025	751,711 kms	HORN R-7470	Chris McAfee - Stegrah
16/12/2024	745,891 kms 17,161 hrs	Other R-7125 28/11/2024 - Label ordered	Internal Workshop
02/12/2024		Transmission/Clutch - URGENT R-5161 Sent to Penske for repair as needed	Penske
02/12/2024		Transmission/Clutch - URGENT R-6866 Sent to Penske for repair as needed	Penske
28/11/2024	17,443 hrs	Cab R-6336 Aircon control unit replaced	Lachlan McFadzen
28/11/2024	755,392 kms 17,433 hrs	First Aid Kit I-669 New first aid	Tina O'Hare
28/11/2024	17,433 hrs	Missing R-7473 Cap replaced	Lachlan McFadzen
28/11/2024	17,433 hrs	Exhaust R-7471 Repaired & set up correctly	Lachlan McFadzen
28/11/2024	17,433 hrs	Turntable - IMPORTANT R-7159 Turntable lock jaw adjusted	Lachlan McFadzen

Date	Reading / Units	Type / Repairer Notes	Repairer
28/11/2024	17,433 hrs	Fire Extinguisher R-6832 Replaced fire extinguisher	Lachlan McFadzen
28/11/2024	17,433 hrs	Brakes - URGENT R-6831 Brake adjustment done	Lachlan McFadzen
28/11/2024	755,392 kms 17,433 hrs	Lights - IMPORTANT R-6830 All lights checked & repaired	Chris Baker
28/11/2024	755,392 kms 17,433 hrs	B - 500 S-5423 CHECK DRIVE LINE OIL ONLY AND REPORT ON CONDITION	Frank Hale - All Crane & Heavy Vehicle Repairs
28/11/2024	17,433 hrs	Other R-2164 Kinpins LHS 0.35mm RHS 0.43mm All ok As per attached Repair Jobcard R2164 Removed & replaced top torque rod No movement found in King Pins Lower Suspension bushes have wear - monitor next service	Lachlan McFadzen
27/11/2024	755,392 kms 17,433 hrs	Cab R-7130 No fault found	Mark Matchett
20/11/2024		Steering - URGENT R-6867	Internal Workshop
20/11/2024		Electrical - IMPORTANT R-6833	Mark Matchett
21/10/2024		Lights - IMPORTANT R-7212 See attached jobcard Check over lights & electrical system. Repair marker lights. Check gearbox fault, advise to return truck to Penske. Check & repair reverse light & alarm fault.	ABC Automotive A/C & Electrical
10/09/2024		Chassis, Missing R-6059 See attached jobcard	Frank Hale - All Crane & Heavy Vehicle Repairs, Huntter Cannell
03/09/2024	743,000 kms 17,086 hrs	B - 35,000 S-3275 Front screen cracked, chipped Cross over fuel hose weeping	Frank Hale - All Crane & Heavy Vehicle Repairs
03/09/2024	743,000 kms 17,086 hrs	Driveline R-6060 See attached jobcard	Frank Hale - All Crane & Heavy Vehicle Repairs, Huntter Cannell
03/09/2024	743,000 kms 17,086 hrs	Steering - URGENT, Wheels/Tyres - URGENT R-6053 See attached jobcard	Frank Hale - All Crane & Heavy Vehicle Repairs, Huntter Cannell
19/06/2024		Non-Destructive Testing Inspections - 12 Monthly I-1343 See attached report	DTIS QLD PTY LTD
11/06/2024	738,032 kms 16,984 hrs	Lights - IMPORTANT R-5683 See attached jobcard	ABC Automotive A/C & Electrical
11/06/2024	738,062 kms 16,984 hrs	Chassis R-5156 See attached jobcard Removed all fire suppression components. Corey bypassed pressure switch for truck to be able to run.	Timothy McFadzen Contracting
11/06/2024	738,132 kms 16,984 hrs	Cab R-5310 See attached jobcard	ABC Automotive A/C & Electrical

Date	Reading / Units	Type / Repairer Notes	Repairer
11/06/2024	738,032 kms 16,984 hrs	Communication System - URGENT R-5160 See attached jobcard	Frank Hale - All Crane & Heavy Vehicle Repairs
11/06/2024	738,032 kms 16,984 hrs	Body R-5899 See attached jobcard	Frank Hale - All Crane & Heavy Vehicle Repairs
11/06/2024	738,032 kms 16,984 hrs	Chassis R-5154 See attached jobcard	Frank Hale - All Crane & Heavy Vehicle Repairs
11/06/2024	738,032 kms 16,984 hrs	Steering - URGENT R-5158 See attached jobcard	Frank Hale - All Crane & Heavy Vehicle Repairs
11/06/2024	738,032 kms 16,984 hrs	Cab R-5159 See attached jobcard Repaired grill, replaced bolts, washers.	Frank Hale - All Crane & Heavy Vehicle Repairs
11/06/2024	738,032 kms 16,984 hrs	Reverse Alarm - IMPORTANT R-5157 See attached jobcard	Frank Hale - All Crane & Heavy Vehicle Repairs
31/05/2024		Electrical - IMPORTANT R-6035 See attached jobcard Fit customer supplied battery lockout Repair Anderson lead to trailer, check charging on trailer.	ABC Automotive A/C & Electrical
09/05/2024		Electrical - IMPORTANT R-5151 See attached jobcard Fit & wire battery & start isolator & e stop	ABC Automotive A/C & Electrical
09/04/2024	730,783 kms	Cab R-5136	Internal Workshop
01/04/2024		Fire Extinguisher Inspection I-1072 See attached report	Pyro Dynamics Pty Ltd
03/03/2024	726,228 kms	Communication System - URGENT R-4102 See attached jobcard Checked radio operations, fault has been repaired already Tabled nit fitted to vehicle Need to order new UHF aerial	Lincoln Wild - LW Diesel & Contracting Services Pty Ltd
03/03/2024	72,809 kms 16,795 hrs	A - 2 Wks S-3776 See attached jobcard Rear diff pivot bushes worn Oil leak @ air compressor Oil leak @ LHS flywheel housing	Lincoln Wild - LW Diesel & Contracting Services Pty Ltd
13/02/2024		Battery - IMPORTANT R-4413 See attached jobcard Supply & fit new batteries Check isolator for possible fault	ABC Automotive A/C & Electrical
08/02/2024		Electrical - IMPORTANT R-4412 See attached jobcard Travel to job, make up anderson plug cable for charging	ABC Automotive A/C & Electrical
19/01/2024		Wheels/Tyres - URGENT R-3771 See attached jobcard Inspected and all ok	Mark Matchett
16/01/2024	16,758 hrs	Chassis R-3775 See attached jobcard Replaced all mudguards & mudflaps	Robert Brackowski
21/12/2023		Electrical - IMPORTANT R-4000 See attached jobcard Make up anderson plug lead	ABC Automotive A/C & Electrical
01/12/2023	716,697 kms	Lights - IMPORTANT R-2990 See attached jobcard Repaired by Corey all side lights on trailer repaired	Robert Brackowski
01/12/2023	716,697 kms	Cab R-3484	Robert Brackowski

Date	Reading / Units	Type / Repairer Notes	Repairer
		See attached jobcard Replaced complete rod with new one	
01/12/2023	716,697 kms	Battery - IMPORTANT R-2814	Robert Brackowski
		See attached jobcard Replaced isolator See attached jobcard Parts ordered 10.10.2023	
14/11/2023		Electrical - IMPORTANT R-3309	ABC Automotive A/C & Electrical
		See attached job form Check & repair super tilt remote operation Supply fit & wire dual usb socket for remote charging	
11/10/2023	711,944 kms 16,456 hrs	Cab, Engine R-3361	Mark McLauchlan
		See attached job form Replaced all filters & oils Replaced drivers seat Removed & replaced both side rear markers	
11/10/2023	711,944 kms 16,456 hrs	A - 8 Wks S-2999	Mark McLauchlan
		See attached jobcard All filters & oils replaced Both rear side markers replaced	
11/10/2023	711,944 kms 16,456 hrs	Leak - IMPORTANT R-2163	Timothy McFadzen Contracting
		See attached jobcard Resealed front end rear diff centre Checked sweating at top of diff - checked level in diff all ok - monitor for next service.	
09/10/2023		Damage R-2815	Timothy McFadzen Contracting
		See attached jobcard Repair has already been done	
05/10/2023		Flashing Light - URGENT, Lights - IMPORTANT R-2605	Internal Workshop
		See attached job repair card 2605 & 2759 Attend to complaint of vehicle indicator not working properly, carry out test, locate cause and open circuit on indicator left and right. Repair open circuit and check ok	
05/10/2023		Lights - IMPORTANT R-2759	Internal Workshop
		See attached job repair card 2605 & 2759 Attend to complaint of vehicle indicator not working properly, carry out test, locate cause and open circuit on indicator left and right. Repair open circuit and check ok	
15/09/2023	703,383 kms 16,271 hrs	Communication System - URGENT, Lights - IMPORTANT R-2510	Internal Workshop
		See attached repair card 2510 Attend to complaint of radio being faulty, R&R radio and check ok Attend to complaint of pedal POS sens faulty, R&R pedal position sensor Rewire back tail lights left and right Fit and wire number plate light Wire up reverse beeper Parts used: 1 x Junction box 4 x 20mm cable gland 1 x number plate light cables and sleeving 2 x 4 pin deutsch plug male and female	
12/09/2023	705,752 kms	Compliance R-2574	Internal Workshop
		Confirmation of speed limited vehicle - VD60 Speed limited to 87kmph	
12/09/2023	705,752 kms	Compliance R-2589	
		System audit confirms both are in working order	
07/09/2023	699,894 kms 16,207 hrs	Leak - IMPORTANT R-1947	Internal Workshop
		Removed hose cut of tip of hose, removed fitting & sealed new fitting Secured & attached air hose Built up air checked for leaks - no leaks found	
07/09/2023	699,894 kms 116,207 hrs	Leak - IMPORTANT R-1948	Internal Workshop
		Removed air line & removed fitting, used sealant & tightened secure, built up air & checked for air leaks - no leaks found	
07/09/2023	699,894 kms 16,207 hrs	Leak - IMPORTANT R-1949	Internal Workshop
		Removed & replaced 2nd & 3rd axle air bags	
05/09/2023		Transmission/Clutch - URGENT R-2545	Internal Workshop
		Diagnose fault - not selecting gears Replace blown fuses due to tail light falling off Reapir Test - Operational	
25/08/2023	699,894 kms 16,207 hrs	Leak - IMPORTANT R-2354	Internal Workshop

Date	Reading / Units	Type / Repairer Notes	Repairer
		See attached Repair Jobcard R2354 Removed engine cover, removed old worn seal, cleaned Fitted new seal, fitted new engine cover straps Refitted engine cover, fitted letter with new seal	
25/08/2023	699,894 kms 16,207 hrs	Leak - IMPORTANT R-1946	Internal Workshop
		As per attached Repair Jobcard R1946 Removed old valve, transferred fittings over and refitted new valve Tested no leaks	
24/08/2023	699,894 kms 16,207 hrs	B - 35,000 S-2739	Internal Workshop
		As per the Service Report S2739 attached Replaced washers blocked Replaced valve air leak Repaired brake valve at rear air leak Replaced 2nd axle N/S booster - leaking air Replaced 4 x Air bags Sump bolts loose, removed & helicoiled Sump bung striped, removed sump & replaced with new No coolant filter - fitted new filter All lights replaced with Corey Replaced front tyres & 2 x front shocks Replaced rear diff top torque rod ** Remove engine cover replace seal & straps & refitt	
14/08/2023	695,601 kms 16,139 hrs	A - 8 Wks S-2683	Internal Workshop
		A service carried out as per service record Notes POS4 wheel seal governor valve Air bag leaking PHS ABD valve leaking air Rear diff oil leak off Front diff leaking out of centre PTO hasket leak Airleak in cab Washer bottle cap missing Window washers not working	
14/08/2023	695,601 kms 16,139 hrs	A - 8 Wks S-2684	Internal Workshop
		A service carried out as per service record Notes POS4 wheel seal governor valve Air bag leaking PHS ABD valve leaking air Rear diff oil leak off Front diff leaking out of centre PTO hasket leak Airleak in cab Washer bottle cap missing Window washers not working	
14/08/2023	692,131 kms	Damage R-1992	Internal Workshop
		Replaced bonnet latch	
14/08/2023		Communication System - URGENT R-1908	Internal Workshop
		Completed on another repiar report R1650 Sent to be fixed	
14/08/2023	694,560 kms 16,105 hrs	Lights - IMPORTANT R-2054	Internal Workshop
		Replace bracket	
23/07/2023	695,461 kms 16,129 hrs	A - 8 Wks S-2592	Ryan Rosman - TMT Mechanical
		A Service carried out as per service report Hydraulic hose rubbing on exhaust - secure hose away from exhaust	
20/07/2023		Electrical - IMPORTANT R-2199	Duane Hitch - Sourth East Mechanical
		Cleared code, isolated and no codes returned, truck went back to full capacity of engine use	
19/07/2023	694,953 kms	Lights - IMPORTANT R-2187	Duane Hitch - Sourth East Mechanical
		Fit RHS Led head light back into truck	
18/07/2023	694,659 kms	Other R-2047	Lincoln Wild - LW Diesel & Contracting Services Pty Ltd
		Remove and replace faulty two-way radio	
18/07/2023	694,659 kms	Communication System - URGENT R-1650	Lincoln Wild - LW Diesel & Contracting Services Pty Ltd
		Remove and replace faulty two way radio	
05/07/2023		Damage R-1722	Internal Workshop, Randall Kruger - ADS
		Chris Solomon carried out repair - Removed and Replaced window regulator driver side	
02/07/2023	689,488 kms 16,006 hrs	A - 8 Wks S-2436	Ryan Rosman - TMT Mechanical

Date	Reading / Units	Type / Repairer Notes	Repairer
		A Service carried out as per service report Trailer air supply valve in dash leaking when pulled out - Part on order R.R Front and rear engine mounts have wear - Monitor for next service R.R Spring eye bushes beginning to peel out - Slight monitor at next inspection H.M Governor signal line fitting leaking - Front and rear diff centers weeping oil from sealing face - Slight monitor at next inspection level ok H.M Pos 3 booster yoke locking nut loose - Cleaned and tightened Rear drive axle brake valve fitting leaking - Rear drive axle airbags have pin hole leaks - Tank strap - Loosen straps and push rubber back under tighten bolts C.S	
18/06/2023	686,645 kms 15,932 hrs	A - 8 Wks S-2460	Hugh Middleton VDPH Maintenance Coordinator
		A Service carried out as per service report Rear axle tyre low tread - Remove and replace rear axle tyre LH and RH Driver window regulator inop - Parts ordered GI light on dash - Reset Gearbox grease reboot LH outline marker damaged - New lamp fitted	
12/06/2023		Wheels/Tyres - URGENT R-1731	Hugh Middleton VDPH Maintenance Coordinator
		Replaced drive tyres	
11/06/2023	686,842 kms 15,937 hrs	Wheels/Tyres - URGENT R-1758	Randall Kruger - ADS
		Removed tyres from rims, fitted new drive tyres and fitted to 3rd axle drive. Tensioned wheel nuts	
11/06/2023	686,842 kms	Other R-1711	Randall Kruger - ADS
		Replaced fridge	
08/06/2023	685,588 kms 15,913 hrs	Electrical - IMPORTANT R-1727	Internal Workshop
		Travelled to Vulcan. Inspected and found wiring at starter motor damaged, Repaired wiring and tested. PTO wasn't engaged, operator was confused about operation.	
04/06/2023	684,433 kms 15,891 hrs	B - 35000 S-2317	Duane Hitch - South East Mechanical, Ryan Rosman - TMT Mechanical
		B Service carried out as per service report RH tank strap rubber, trailer dash valve leaking - Repair valve secure Bonnet rose joints need replacing - S/able HM Both diff heads leaking - S/able HM washer bottle lid missing - New cap LHS rear light assembly loose - secured	
27/05/2023		Damage R-1622	Internal Workshop
		No Repair required	
26/05/2023		Damage R-1604	Hugh Middleton VDPH Maintenance Coordinator
		No repair required - Has repair to bonnet clip - Secure	
24/05/2023		Hydraulics - IMPORTANT R-1587	Duane Hitch - South East Mechanical
		Remove and replace PTO and Hydraulic pump	
22/05/2023		Brakes - URGENT R-1579	Hugh Middleton VDPH Maintenance Coordinator
		Inspect for slow to build air - Build air to safe work pressure in 3.5min to 5 bar - No Repair Required	
19/05/2023	674,451 kms	Leak - IMPORTANT R-1569	Lincoln Wild - LW Diesel & Contracting Services Pty Ltd
		Trailers won't build up air pressure. Found leaks in suzi lines - Repaired air leaks, Tested Ok	
17/05/2023		Leak - IMPORTANT R-1582	Pyro Dynamics Pty Ltd
		As per attached repair report. Charge system and leak test. 2 leak points found, One t piece under cabin of truck and slight leak on manifold block. Both leaks rectified and system recharged. System held pressure for 30 minutes under charge.	
15/05/2023	672,773 kms	A - 8 Wks S-2212	Duane Hitch - South East Mechanical, Lincoln Wild - LW Diesel & Contracting Services Pty Ltd
		A Service carried out as per service report RH High beam n/w - Repaired DH Indicators on bonnet damaged N/W - Repaired DH 1 cab roof light N/W - Repaired LW 1 cab side skirt light damaged RHS - New lamp HM Fire suppression system low on pressure Diff heads weeping - S/ABLE HM Wheel chocks missing - Fitted new ones LW	

Date	Reading / Units	Type / Repairer Notes	Repairer
15/05/2023	672,773 kms	Lights - IMPORTANT R-1518 Replaced Light	Randall Kruger - ADS
15/05/2023	672,773 kms	Other R-1501 Replaced fridge	Internal Workshop
15/05/2023	672,773 kms	Other R-1497 Replaced with new chocks	Randall Kruger - ADS
07/05/2023		Other R-1567 Fit new oil spinner	Internal Workshop
04/05/2023		Lights - IMPORTANT R-1418 Inspect and test RHS indicator fault. Found open circuit wiring at light, Repair wiring and retest - All Okay	Raw Auto Electrical
04/05/2023		Lights - IMPORTANT R-1418 Inspect and test light bar fault, Found poor high beam trigger connection. Repair connection and retest - All okay	Raw Auto Electrical
03/05/2023		Damage R-1172 Fitted new strap	Internal Workshop
23/04/2023	666,781 kms 15,556 hrs	A - 8 Wks S-2096 A Service carried out as per service report Indicators and spotlights not working - Repaired Diff heads weeping diff oil - Wash off and inspect OK HM	Internal Workshop
22/04/2023	666,781 kms	Damage R-1177 Temp repair until part comes into stock HM	Hugh Middleton VDPH Maintenance Coordinator
22/04/2023	666,781 kms	Lights - IMPORTANT R-1258 Repaired broken wire LH bonnet Indicator	Hugh Middleton VDPH Maintenance Coordinator
20/04/2023		Leak - IMPORTANT R-1285 Repaired by Hydro fire	Internal Workshop
20/04/2023		Leak - IMPORTANT R-1391 As per attached Service Report - Called to a low pressure alarm and low pressure in the bottle. A very small slow leak was found in the back of a 45 degree fitting. This was changed out with a new 90 degree. I changed the configuration of the hose to take the pressure off the fitting. Also changed a T piece that was swinging in the brewze and no support. P clamped the t up and now it's secure.	Pyro Dynamics Pty Ltd
12/04/2023	663,521 kms 18,451 hrs	Engine R-1195 Replaced EGR cooler. Pressure test cooling system, No leaks found. Washed and road test - no leaks found	Randall Kruger - ADS
05/04/2023	663,470 kms 15,467 hrs	A - 8 Wks S-1988 A Service carried out as per service report. 3rd Axle diff head is leaking (Monitor) EGR Fault / Coolant (Parts Ordered) (Turned into a repair to be booked back in for repair - KMH)	Internal Workshop
04/04/2023		Other R-1178 Replaced with new ones.	Nick Fenton
24/03/2023	658,508 kms 15,347 hrs	A - 8 Wks S-1894 A Service carried out as per service report Spotlights - not working on high beam - Rebooked for Raw Electrical	Randall Kruger - ADS
21/03/2023	656,253 kms	Communication System - URGENT R-1087 Inspect and test UHF and Cig lighter socket. Found no power to both. Trace and diagnose blown fuse. Found fuse has been Modified to keep working dodgily. Replace and Re-test. Ok	Raw Auto Electrical

Date	Reading / Units	Type / Repairer Notes	Repairer
20/03/2023		Lights - IMPORTANT R-1028 Inspect and test lights on mirrors - not working. Diagnose fuse missing in fusebox and both lights blown. Fit 2 new led lights and connect and test. All ok	Raw Auto Electrical
13/03/2023		Engine R-1322 Removed sump and inspected damage, found main bearing failure causing engine lock up. Refit sump and advised customer of findings.	RGM Maintenance Pty Ltd
04/03/2023	647,457 kms	C - Annual S-1758 C service carried out as per service report R-985/F-1112 Repaired with Service 1st drive spring bushes worn - S/ABLE HM washers N/W - replaced air leak near engine - repaired A/c not working - repaired wires	Rob Brackowski - Callcorr
04/03/2023	647,457 kms	WINDSCREEN WASHER / WIPER - IMPORTANT R-985 Repaired with Service S1758 Replaced broken LH wiper arm and blade	Hugh Middleton VDPH Maintenance Coordinator
17/02/2023	641,543 kms 15,030 hrs	A - 8 Wks S-1657 As per service sheet	Hugh Middleton VDPH Maintenance Coordinator
15/02/2023		Communication System - URGENT R-909 replace plug and fuse holder	Hugh Middleton VDPH Maintenance Coordinator
14/02/2023		Lights - IMPORTANT R-890 Slight damage - Noted and No repair required	Hugh Middleton VDPH Maintenance Coordinator
03/02/2023	631,282 kms 14,831 hrs	B - 35000 S-1538 As per Service Report	Hugh Middleton VDPH Maintenance Coordinator
28/01/2023		Cab R-851 replaced terminal	Hugh Middleton VDPH Maintenance Coordinator
22/12/2022	627,615 kms 14,748 hrs	A - 8 Wks S-1435 Oil sweat No 5 injector line - stable Clutch actuator fault - renew & calibrate Decal strip missing from dash - part ordered	Hugh Middleton VDPH Maintenance Coordinator
14/12/2022		Windscreen/Mirrors - IMPORTANT R-741 replace switch	Hugh Middleton VDPH Maintenance Coordinator
10/12/2022	622,367 kms	A - 8 Wks S-1277 Front drive tyres - s/able until next inspection Oil leak 5th injector line - retorqued Diff oil needs to be changed - Replaced Needs new dash panel - part ordered Needs rear cab shocks - S/able parts ordered Coolant leak	ATL Diesel Services - Jordan Hasenkam
30/11/2022	617,181 kms 14,535 hrs	Cab R-698 refitted and secured	Hugh Middleton VDPH Maintenance Coordinator
10/09/2022	601,936 kms	Lights - IMPORTANT R-501 replaced lamps	Hugh Middleton VDPH Maintenance Coordinator
31/08/2022	599,391 kms 14,185 hrs	A - 8 Wks S-1061 air leak at LH top air tank replace coupling screen wash inoperable - clear hoses wiper blade torn- replaced blade steer tyres low tread - replaced	Hugh Middleton VDPH Maintenance Coordinator
16/08/2022	589,850 kms 14,009 hrs	Lights - IMPORTANT R-449	Hugh Middleton VDPH Maintenance Coordinator

Date	Reading / Units	Type / Repairer Notes	Repairer
		repaired at service on 16/8/22	
16/08/2022	589,850 kms 14,009 hrs	Lights - IMPORTANT R-448	Hugh Middleton VDPH Maintenance Coordinator
		all lights replaced and wiring repaired on service on the 16/8/22 c serv sheets	
16/08/2022	589,850 kms 14,009 hrs	B - 35000 S-976	Hugh Middleton VDPH Maintenance Coordinator
		FRONT GRILL INSECURE - REBOLTED RH WASHER JET IN OP - CLEAR JET ELECTRICAL HORN IN OP - REPAIR EARTH WIRE SEAT SUSPENSION VALVE FAULTING - REPLACE CONTROL SWITCH BRAKE LIGHTS IN OP - REPAIR WIRING HEATER CONTROL VALVE MISSING - NEW CONTROL FITTED INTER AXLE DIFF LOCK SIWTCN AIR LOSS - REPLACE SWITCH BONNET CABLE RH BROKEN - NEW CABLE WIPER BLADES TORN - NEW BLADES	
31/07/2022		Fire Extinguisher Inspection I-489	Internal Workshop
25/07/2022	571,703 kms 13,659 hrs	A - 8 Wks S-914	Hugh Middleton VDPH Maintenance Coordinator
		EXHAUST HEAT SHIELD BRACKET BROKEN RH STACK - REPAIRED RHR AUTO ADJUSTER PIN MISSING - REPLACED & ADJUSTED RHF SPRING SHACKLE NOT TAKING GREASE - HEAT TO GET GREASED RHF HEADLAMP INSECURE - SCREWED & BEAMSET LH & RH OUTLER ROOF MARKERS IN -OP - WIRING REPAIR RH MIRROR LOAD LAMP IN-OP - HORN IN-OP - AIR HORN OPERATIONSALN SCREEN WASH IN-OP - FILL RESIVOIR.	
22/07/2022		Brake Test Annual I-325	Nick Fenton
		PASS - For CapCoal	
21/07/2022		Other R-386	Hydrafire Supplies & Services
		Installed FSS	
21/07/2022		Fire Suppression Inspection I-251	Hydrafire Supplies & Services
04/07/2022	565,699 kms 13,539 hrs	Cab R-285	Hugh Middleton VDPH Maintenance Coordinator
		Repaired on Service S865 04.07.22 - As per service sheet	
04/07/2022	565,699 kms 13,539 hrs	A - 8 Wks S-865	Hugh Middleton VDPH Maintenance Coordinator
		RH & LH tail lights inop acc damage - Replace lamps Seat RH level control faulty - replace control Washer bottle cap missing - new cap fitted All brakes manually adjusted Abnormal wear steer tyres - s/able NOTES: Monitor steer tyre at next service 18/07/22	
04/07/2022	565,699 kms 13,539 hrs	Fire Extinguisher Inspection I-238	Internal Workshop
		As per Service Sheet - S865	
04/07/2022	565,699 kms 13,539 hrs	WINDSCREEN WASHER / WIPER - IMPORTANT R-281	Nick Fenton
		Repaired on Service S865 04/07/22 - As per service sheet	
01/07/2022		Lights - IMPORTANT R-354	Hugh Middleton VDPH Maintenance Coordinator
29/06/2022		Lights - IMPORTANT R-346	Hugh Middleton VDPH Maintenance Coordinator
22/06/2022	560,270 kms 13,411 hrs	Lights - IMPORTANT R-340	Hugh Middleton VDPH Maintenance Coordinator
10/06/2022	558,074 kms	Cab R-276	Nick Fenton
10/06/2022	556,526 kms 13,327 hrs	B - 35000 S-843	Rob Brackowski - Callcorr

Date	Reading / Units	Type / Repairer Notes	Repairer
		Disassemble to remove fly wheel send for machining Machine out new bearing retainer for front of tans Fit new input shaft and accessories Refit new gasket and bell housing Fit new bushes for clutch fork shaft Remove 2 rear J brackets from fuel tank to be repaired - cracked severely and then refit after repairs Fitted new driver door window and ride guide channels Refitted door cards and plastic Refitted fly wheel and torque hardware to spec Refitted clutch assembly Refitted transmission, engine mounts and all accessories PTO, slave, fuel lines and wiring loom Refitted shaft, x braces and DPF System and connecting pipes Scanned does and cleared Changed Diff filter, 1st Drive Changed engine oil and filter (filter was supplied Tided up wiring and hoses Brakes were all close to 60% Callcor defects found - turn table bushes worn - wiper jets missing / just the little tube spraying water - Air leaking from trailer supply bottom - air system builds up air past required amount - Suspension legs all cracked at top arm - Right side reverse light not working - right side parker and brake lights not working	
06/06/2022		Lights - IMPORTANT R-319	Nick Fenton
01/06/2022		Lights - IMPORTANT R-294	Nick Fenton
01/06/2022		Cab R-296	Nick Fenton
25/05/2022		Lights - IMPORTANT R-277	Nick Fenton
24/05/2022	545,815 kms 13,090 hrs	A - 8 Wks S-772	ATL Diesel Services - Jordan Hasenkam
03/05/2022		Lights - IMPORTANT R-247	Hugh Middleton VDPH Maintenance Coordinator
02/05/2022	538,682 kms	B - 35000 S-648	Hugh Middleton VDPH Maintenance Coordinator
		PTO pump failed - replaced pump screen wash inoperable - clear jets slow to build air - replace 5/8 union on airtake and refit dryer	
30/04/2022		Lights - IMPORTANT R-237	Hugh Middleton VDPH Maintenance Coordinator
26/04/2022		Brake Test MNM 3 Monthly I-181	Gregory Fing
12/04/2022	530,986 kms 12,721 hrs	A - 8 Wks S-627	Hugh Middleton VDPH Maintenance Coordinator
		RHF Clevis Lock Device Missing - replaced split pin RHR Indicator lamp Acc Damaged - Replaced Slow to build air - replace counter valve throttle pedal intermittent fault - repin petedmeter rear cab shocks leaking - replace	
24/03/2022	522,112 kms 12,540 hrs	A - 8 Wks S-507	Hugh Middleton VDPH Maintenance Coordinator
		change air filter front steers replace - 24.03.22 front steer tyre on limit - new tyres rear diff XS backlash - new diff fitted screen wash bottle cap missing POO - 9.4.22 PTS control insecure - secured front grill insecure - secured back light RH Rop - new bulb RHR indicator inop - new bulb exhaust flexi RH split - replaced	
15/03/2022		Lights - IMPORTANT R-162	Hugh Middleton VDPH Maintenance Coordinator
13/03/2022	518,645 kms	Damage R-156	Hugh Middleton VDPH Maintenance Coordinator
25/02/2022	509,429 kms	Lights - IMPORTANT R-127	Hugh Middleton VDPH Maintenance Coordinator
		Replaced bulb	
20/02/2022	507,468 kms	Lights - IMPORTANT R-114	Hugh Middleton VDPH Maintenance Coordinator
		Replaced bulbs	
15/02/2022	504,949 kms	Lights - IMPORTANT R-104	Hugh Middleton VDPH Maintenance Coordinator
		Rewire lights	

Date	Reading / Units	Type / Repairer Notes	Repairer
08/02/2022	503,604 kms	Other R-103 Check booster NFF Repair splitter valve at gearbox air leak. NFF with PTO	Hugh Middleton VDPH Maintenance Coordinator
20/01/2022		Brake Test MNM 3 Monthly I-105 PASS	Nick Fenton
17/01/2022	500,921 kms 12,030 hrs	C - 100000 S-261 Replaced turn table bolts Brake rubber back on Jet working again	ATLS Diesel Services - Aaron Lansdown, Hugh Middleton VDPH Maintenance Coordinator
05/01/2022	499,068 kms	Lights - IMPORTANT R-102 Secure light	Hugh Middleton VDPH Maintenance Coordinator
01/01/2022	496,960 kms	Lights - IMPORTANT R-49	Hugh Middleton VDPH Maintenance Coordinator
31/12/2021		Fire Extinguisher Inspection I-92 Fire Extinguisher date as per service report	Internal Workshop
09/12/2021		A - 8 Wks S-322 LH Tail Light inop - wiring repaired RH main beam inop - replaced bulbs	Hugh Middleton VDPH Maintenance Coordinator
13/10/2021	473,911 kms 11,178 hrs	B - 25000 S-38 B TRUCK SERVICE - Completed	Internal Workshop
13/10/2021		Fire Extinguisher Inspection I-8 FIRE EXTINGUISHER SERVICE- Completed	
17/06/2021	9,626 hrs	Brake Test Annual I-14 BRAKE TEST- Completed	
16/06/2021	429,012 kms	A - 8 Wks S-147 A TRUCK SERVICE - Completed	Internal Workshop

Signed: _____

Name: _____

Date: _____