



Vehicle History Summary



Fleet #	VD62
Registration	XQ99VA
Make	Western Star
Model	6964FXC
VIN / Chassis #	5KKJABBG5NPNA3166
Build Date	2021

Date	Reading / Units	Type / Repairer Notes	Repairer
		Planned Maintenance, Turntable - IMPORTANT R-12899	Internal Workshop
14/05/2026		Brake Test 6 Months I-2900	KBX Mechanical
14/05/2026	19,813 hrs	Hydraulics - IMPORTANT, Lights - IMPORTANT, Planned Maintenance R-12919 Fit secondhand tip lines and secured up Test tipped combination - ok Investigated trailer park lights N/W found faulty light solenoid	Mitch Grima
13/05/2026		Fire Extinguisher / Suppression Inspection I-2889 Description of Works Completed: Annual service completed on machine, discharge test completed, clean clear passage performed, actuators and cylinder head cleaned and rebuilt, detection tube replaced, system refilled and recharged, alarm panel reset, leak test completed on system with no signs of leaks or pressure loss.	Pyro Dynamics Pty Ltd
24/03/2026	869,688 kms	Breakdown, Cooling System, Fuel R-11651 Correction: Plug in & obtain ECM download. Confirm coolant in fuel tank. - Wash engine prior to commencing work. - Remove rocker cover. - Remove all 6 injectors. - Install injector sleeve retaining rings. - Refit injectors with new seals & o-rings. - Refit rocker cover. - Change truck batteries (Old units showing low voltage) - Run engine, confirm no fault codes. - Wash engine thoroughly. - Run engine until normal operating temperature & confirm no leaks. - Return vehicle to service.	Cummins Mackay
19/12/2025	871,865 kms	Breakdown, Fault R-11574 Engine light on water in fuel. Pulled all fuel lines to inspect, pressure test cooling system and coolant leaking from injector return line from head. Need to pull injectors and inspect sleeves. Parked up.	Matthew Twitchett
13/12/2025	719 hrs	Air Conditioner, Planned Maintenance R-11421 Removed panel and removed fan, installed new component and tested Unbolted all mounts to shift motor for service Carried out Service Replaced Drive belts Run up unit and inspected all components	Aaron McCully
11/12/2025	870,819 kms	Air Dryer, Breakdown R-11509 Drove to unit on Red hill road Inspected for air leaks Found both Air dryer gaskets to be blown out and loose bolts on housing Replaced Housing gaskets Tested, all operational	Daniel Farinha - Misso's
09/12/2025	870,350 kms	D - 112000 S-8078 Carried out D service as per service sheet. Carried out engine tune up. R&R drive shaft center bearing. Was seized on.	Matthew Twitchett, Peter Harris
05/12/2025	873,000 kms	Breakdown, Fuel R-11457 Drained approx 2 lts of a red liquid out of RH front tank and water trap filter. Cleaned out RH front tank, then refilled.	Matthew Twitchett, Peter Harris
29/11/2025	867,430 kms	Cab, Planned Maintenance R-10099 Removed and replaced Front Cab Mounts	Aaron McCully
29/11/2025	867,537 kms	New T-1212 Fitted all new drive tyres	Aaron McCully
29/11/2025	867,430 kms	Air Conditioner, Opportune Maintenance R-11396	Aaron McCully

Date	Reading / Units	Type / Repairer Notes	Repairer
		Inspected ice Pak not starting Tested power at fuel pump, no power, connected external power to pump, pump U/S Sourced replacement and fitted, chased back wiring and found corrosion at relay, Cut back wiring, installed new terminals and relay Tested, started and all operational, Extraction fan seized Run up and tested A/C, all operational New extraction fan sourced on Separate Repair	
28/11/2025	867,430 kms	Communication System - URGENT, Planned Maintenance R-11378 Removed UHF, found loose bolt, tightened and Refitted UHF	Aaron McCully
28/11/2025	867,430 kms	Planned Maintenance, Seat R-11377 Sprayed all moving parts in seat base with Silicone spray All ok	Aaron McCully
28/11/2025	867,430 kms	Engine, Fault, Planned Maintenance R-11283 Removed intake piping, Alternator, A/C compressor and wiring Removed Accessory bracket Removed Oil Thermostat Inspected Thermostat housing, inspected insert, all ok Installed new Thermostat, Refitted all components that were removed Replaced Oil filter pressure relief Cleaned down work area	Aaron McCully
28/11/2025	867,430 kms	Cab, Planned Maintenance R-11379 Water leaking in from Beacon wiring, applied silicone to joins Adjusted Drivers door, Tested and all ok To be monitored	Aaron McCully
28/11/2025	867,430 kms	Lights - IMPORTANT, Planned Maintenance R-11179 Removed and replaced both bullbar light assemblies Tested, all operational	Aaron McCully
26/11/2025		Vulcan 12 Month Site Intro I-2612	Ryan Rosman
16/11/2025	859,587 kms	Opportune Maintenance, Suspension - URGENT R-11204 Found Shackle plates badly worn Removed plates and pins and cleaned area Fitted new Pins and plates and aligned Tensioned all bolts Test drove and Re-checked all bolts All operational	Mitch Grima
16/11/2025	859,468 kms	Electrical - IMPORTANT, Planned Maintenance R-11203 Changed out LH front wheel speed sensor Inspected and repaired break in harness in chassis rail Cut damaged wiring and fitted Deutsch connector, secured wiring Tested operation of sensor, Test drove, fault cleared All operational	Mitch Grima
14/11/2025	859,507 kms	Breakdown, Engine, Fuel Pump R-11181 Inspected Surging fault Inspected Fault codes, found Fuel Differential fault Inspected Fuel System, Removed Fuel Pump head and inspected Plungers Found Rear plunger to have a cracked seat Sourced replacement parts Fitted new Fuel Pump Head and Actuator Tested and inspected for leaks All operational	Mitch Grima
14/11/2025	859,468 kms	Electrical - IMPORTANT, Engine R-11180 Investigated Engine light fault Oil Temp Fault showing Checked wiring to sensor, all ok Removed and replaced Sensor Tested, all operational	Mitch Grima
04/11/2025	852,581 kms	Lights - IMPORTANT, Planned Maintenance R-11022 Corrosion in relay holder, removed holder and crimped new terminals on wiring Tested, all operational Replaced Faulty clearance light on RH rear Tested, all operational	Mitch Grima
04/11/2025	852,581 kms	Cab, Planned Maintenance R-10955 Rivot Nuts pulled through dash panel Removed Riv nuts and fitted longer bolts with washers and nuts Secured panel, all operational	Mitch Grima
04/11/2025	852,581 kms	Air Conditioner, Breakdown R-11020 Found leaking Horton supply line to hub, Removed and replaced nylon hose and replaced fitting into Hub Tested, all operational, no further leaks Tested Aircon, pressures all ok Replaced cabin Filters - blocked Aircon blowing good and cold	Mitch Grima
26/10/2025	847,010 kms	Air Conditioner, Breakdown R-10964 Travel to gravel pad diagnose a/c water leak on floor. Repaired drain hose. All OK	Peter Harris
22/10/2025	843,726 kms	Cooling System, Engine, Planned Maintenance R-10757 Connected laptop, found high oil temp, reached 126 degrees, very high Checked out wiring, all was ok, wiring not the issue Removed radiator cap, no oil residue, all good Truck will potentially require oil thermostat replaced and relief valve on Filter housing Monitor issue	Aaron McCully
19/10/2025	841,594 kms	Cab, Planned Maintenance R-10689	Mitch Grima

Date	Reading / Units	Type / Repairer Notes	Repairer
		Tightened both Mirror assemblies	
19/10/2025	841,594 kms	Electrical - IMPORTANT, Planned Maintenance R-10688	Aaron McCully
		Removed Kick panel Removed and replaced park brake pressure Switch Tested, all operational	
19/10/2025	841,594 kms	Lights - IMPORTANT, Planned Maintenance R-10670	Aaron McCully
		Found both relays pulling out of sockets Cable tied into place - monitor	
19/10/2025	841,594 kms	B - 28000 S-7596	Aaron McCully
		Carried out B Service as per Service sheet In Addition Rotated Steer tyres - carried out Re-torque Repaired Spot light relays	
19/10/2025	841,593 kms	Hydraulics - IMPORTANT, Planned Maintenance R-10861	Daniel Farinha - Misso's, Mitch Grima
		Adjusted flow control on lids and tested Monitor	
19/10/2025	841,594 kms	Opportune Maintenance, WINDSCREEN WASHER / WIPER - IMPORTANT R-10641	Aaron McCully
		Filled Washer bottle, Tested, all operational	
09/10/2025	833,918 kms	Air Conditioner, Opportune Maintenance R-10642	Matthew Twitchett
		Replaced cab filters and swapped good vents to drivers side	
30/09/2025		Fire Suppression Inspection I-2447	Pyro Dynamics Pty Ltd
30/09/2025		Fire Extinguisher Inspection I-2448	Pyro Dynamics Pty Ltd
29/09/2025	826,035 kms	Electrical - IMPORTANT, Engine, Planned Maintenance R-10535	Liam Kitching - Misso
		Connect laptop, checked codes, no active codes Pull Adblue injector and carried out dosing test as Driver stated hadn't used any adblue in 3days Tested, all operational, Injector not blocked Checked gauges on dash, all working at time of inspection	
26/09/2025		Brake Test 6 Months I-2613	Ryan Rosman
26/09/2025		Vulcan 12 Month Site Intro I-2715	Ryan Rosman
26/09/2025	823,797 kms	Compliance, Electrical - IMPORTANT, Opportune Maintenance R-10513	Matthew Twitchett
		Inspected Park Brake Door Alarm and found faulty Pressure switch and damaged wiring Repaired wiring and replaced pressure switch Tested, all operational	
26/09/2025	823,797 kms	Engine, Planned Maintenance R-10445	Aaron McCully, Matthew Twitchett, Peter Harris
		Removed intake to turbo, checked end float, slight play Turbo appears to have been dusted from Intake boot being ripped previously Inspected further, found leaking exhaust manifold on #3 Found wastegate actuator to be leaking Sourced replacement turbo assembly and hardware Replaced manifold gaskets and Turbo with full install kit Inspected Wastegate adjustment before fitment, all operational Run up and tested, no leaks All operational	
24/09/2025		Brake Test 6 Months I-2716	Ryan Rosman
23/09/2025	823,794 kms	Body, Planned Maintenance R-10452	Peter Harris
		Carried out repairs to Deck plate	
22/09/2025	823,797 kms	Cooling System, Planned Maintenance R-10459	Aaron McCully
		Inspected coolant, 60% glycol Lots of dust in core, cleaned out core Tested Horton, engaging correctly Blew out radiator due to being clogged temp fault related to Wastegate bypassing causing high Pyro's	
22/09/2025	793,814 kms	Exhaust, Planned Maintenance R-9862	Aaron McCully, Peter Harris
		Flexi joint repaired previously	
22/09/2025	793,814 kms	Cab, Lights - IMPORTANT, Planned Maintenance R-10446	Aaron McCully
		Installed new globes Glued in Beacon Switch	

Date	Reading / Units	Type / Repairer Notes	Repairer
22/09/2025	823,794 kms	A - 14000 S-7316 Carried out A Service as per Service In Addition Wiper blades replaced Repaired Deck Plate Tidied up Headlight wiring Rotated Steer tyres	Aaron McCully, Matthew Twitchett, Peter Harris
22/09/2025	793,894 kms	Planned Maintenance, Suspension - URGENT R-9908 J beam bushes have wear. Will check at next service. OK to use.	Aaron McCully
22/09/2025	823,746 kms	Cab, Electrical - IMPORTANT, Planned Maintenance R-10448 Will need new park brake switch on treadle valve. OK to use fix next service.	Aaron McCully
16/09/2025	818,804 kms	Exhaust, Planned Maintenance R-10465 Travel to BP Peak Downs Replaced Add blue hose Cleared engine faults with Jaltest Good to go	Peter Harris
12/09/2025	816,249 kms	Leak - IMPORTANT, Planned Maintenance R-10079 Removed Injector Carried out Dosing test Cleaned and refit Tested, all operational	Matthew Twitchett, Mitch Grima
11/09/2025	815,465 kms	Air Conditioner, Planned Maintenance R-10357 Found broken wires on Low pressure switch plug, replaced plug All operational	Matthew Twitchett
04/09/2025	810,373 kms	C - 56000 S-7070 Carried out C Service as per Service sheet Replaced Engine oil and filters Replaced Air filters Replaced Fuel Filters Replaced Air/oil filter for Ad blue pump Replaced Gearbox oil and filter Replaced Diff oils Replaced Steer hub oils Replaced Air dryer Filter kits x2 Replaced Hydraulic filter Split combination and inspected Turntables/King pins and skid plates Rotated Steer Tyres - Carried out Re-torques	Aaron McCully, Mitch Grima
01/09/2025		48W Moranbah North Inspection (11 Months) I-2586	PIMS Group Pty Ltd
20/08/2025	802,005 kms	A - 14000 S-6890 Carried out A service as per service sheet. Tightened turbo clamp to flex. Replaced faulty engine oil pressure sender.	Peter Harris
20/08/2025	802,005 kms	Broken, Planned Maintenance R-10050 Found supports to be loose Tightened, no more movement	Aaron McCully
20/08/2025	802,005 kms	Lights - IMPORTANT, Planned Maintenance R-9876 Engine light on due to no oil pressure/ sensor leaking oil through plug Changed out, tested, all operational	Aaron McCully
20/08/2025	802,005 kms	Planned Maintenance, RADIO R-10059 Working at time of inspection	Peter Harris
20/08/2025	802,005 kms	HORN, Planned Maintenance R-10051 Replaced terminal on wire. Tested OK.	Peter Harris
11/08/2025	795,569 kms	Breakdown, Hydraulics - IMPORTANT R-10027 Inspected Hydraulics Found Hydraulic pump to be U/S Fitted new Pump, tested, all operational	Daniel Farinha - Misso's
24/07/2025	784,172 kms	New T-1199 Fitted all new drives	Matthew Twitchett
22/07/2025	783,603 kms	B - 28000 S-6552 Carried out B service as per service schedule.	Matthew Twitchett, Mitch Grima
21/07/2025		Non-Destructive Testing Inspections - 12 Monthly I-2512 Turntable and Mount - No cracking detected	DTIS QLD PTY LTD
20/07/2025	782,429 kms	Lights - IMPORTANT, Planned Maintenance R-9731 Found Rh spot light inoperative, tested voltage, 4 volts Chased wiring back, tested voltage at relay, 12 volts, activated relay and dropped to 4 volts Replaced relay, tested, all operational	Aaron McCully
16/07/2025	779,183 kms	Suspension - URGENT R-9702 Removed and Replaced Front Shock absorbers	Peter Harris, Troy Francken

Date	Reading / Units	Type / Repairer Notes	Repairer
15/07/2025	779,182 kms	Brakes - URGENT, Leak - IMPORTANT, Planned Maintenance R-9664 No Fault found Tried numerous scenarios to make leak Could not find leaks	Peter Harris
15/07/2025	778,692 kms	Air Conditioner, Planned Maintenance R-9681 Strip dash, fit hose and reassemble	Daniel Farinha - Misso's
15/07/2025	779,182 kms	Intercooler, Planned Maintenance R-9692 Removed old Intercooler, Fit new Intercooler Replaced R/H Intercooler hose Replaced R/H Rubber mount Good to go	Peter Harris
15/07/2025	779,182 kms	Air Dryer, Planned Maintenance R-9693 Working ok at time of inspection Tested and can't fault Good to go	Peter Harris
15/07/2025	779,182 kms	Lights - IMPORTANT, Planned Maintenance R-9694 Inspected Lights, No Blown Fuses or relays Everything is in good order	Peter Harris
15/07/2025	779,182 kms	Electrical - IMPORTANT, Engine, Planned Maintenance R-9696 No Engine light on dash at time of inspection no Recent Ad blue leak Good to go	Peter Harris
27/06/2025	769,865 kms	Broken, Planned Maintenance R-9492 Removed broken rose joint off intake pipe and replace with new joint	Mitch Grima
27/06/2025	770,177 kms	New T-881 Replace with new	Mitch Grima
27/06/2025	769,845 kms	A - 14000 S-6264 Carried out A Service as per service sheet attached	Aaron McCully, Mitch Grima
23/06/2025	766,894 kms	Planned Maintenance, Windscreen/Mirrors - IMPORTANT R-9477 Only tiny ok to use	jamie Geaney
22/06/2025	765,616 kms	Electrical - IMPORTANT, Planned Maintenance R-9469 Removed and replaced blinker stalk. Tested OK.	jamie Geaney
17/06/2025	761,704 kms	Electrical - IMPORTANT, Engine, Planned Maintenance R-9398 Park brake light Found loose wire on pressure switch, tightened. Tested OK. Engine light Adblue interruption/ blockage. Purged lines, soaked injector, performed dosage test. Tested OK.	Matthew Twitchett
13/06/2025	761,704 kms	Electrical - IMPORTANT, Lights - IMPORTANT, Planned Maintenance R-9399 Inspected Hi/Lo circuit all ok. Tested switch and seems to have sticky contacts or worn spring. Clean out. Tested OK. Will order new one.	Matthew Twitchett
09/06/2025	755,634 kms	D - 112000 S-6097 Carried out D Service as per Service sheet Attached	Joseph Parker, Matthew Twitchett, Peter Harris
22/05/2025	741,413 kms	Engine, Exhaust R-9212 Replaced both engine brake solenoids Replaced engine brake harness Replaced rocker cover gasket Carried out valve and engine brake set	Daniel Farinha - Misso's, Matthew Twitchett
19/05/2025	741,413 kms	Compliance T-819 Inspected Tyres, Adjusted Pressures to 95 PSI Wheels Tensioned @ 450 Ft/LB, Wheel nut indicators fitted	Daniel Farinha - Misso's
19/05/2025		Brake Test 6 Months I-2141 Completed and passed 6 month Capcoal brake test	Hoppers Diesel and plant Hire
19/05/2025	741,413 kms	Compliance, Turntable - IMPORTANT R-9232 Inspected turntable mounting Inspected Turntable Jaw kit	Daniel Farinha - Misso's
18/05/2025	741,413 kms	Electrical - IMPORTANT R-9038	Mitch Grima

Date	Reading / Units	Type / Repairer Notes	Repairer
		Inspected starting issue, Removed starter motor and found Solenoid wires worn and shorting out Replaced with new starter motor tested, all operational	
18/05/2025	741,413 kms	A - 14000 S-6013	Mitch Grima
		Carried out A Service as per Service sheet attached	
17/05/2025	741,413 kms	Cab, Lights - IMPORTANT R-9213	Daniel Farinha - Misso's
		Light worked OK at time of inspection.	
15/05/2025	739,312 kms	Leak - IMPORTANT R-9128	Daniel Farinha - Misso's
		Tightened Steering hose Topped up oil level, all operational	
28/04/2025	725,382 kms	B - 28000 S-5876	Matthew Twitchett
		Carried out B Service as per service sheet attached	
28/04/2025	725,382 kms	Engine, Leak - IMPORTANT R-8598	Matthew Twitchett
		Removed and replaced o-ring	
28/04/2025	725,838 kms	Leak - IMPORTANT R-8976	Matthew Twitchett, Peter Harris
		Diagnose and inspect Thermal fan Not working, replaced both fuses Test run, good to go Replaced o-ring on filler tube Residual oil from previous works on RH steering box, to be monitored	
28/04/2025	725,838 kms	Flashing Light - URGENT R-8975	Peter Harris
		Inspect Beacon not working Found broken wire Repaired with new plug Tested, all operational	
26/04/2025		Fire Suppression Inspection I-2098	Pyro Dynamics Pty Ltd
		Yearly service carried out on fire suppression • flushed out hosing with water & nitro gen (clear passage) • inspection of system complete with no faults found • Recharge system to OEM specifications w • leak tested system with no leaks present • serviced all fire extinguishers & stamped all tags/new secure ties on actuators • refit discharge hose to cylinder head & completed paperwork Serviced fire extinguishers in accordance with AS1851 standards at same time of fire suppression service.	
26/04/2025		Fire Extinguisher Inspection I-2099	Pyro Dynamics Pty Ltd
		• serviced all fire extinguishers & stamped all tags/new secure ties on actuators • refit discharge hose to cylinder head & completed paperwork Serviced fire extinguishers in accordance with AS1851 standards at same time of fire suppression service.	
22/04/2025	721,398 kms	Electrical - IMPORTANT R-8611	Mitch Grima
		Inspected Faulty Aircon, Found A/C Relay dodgy/ flickering Change out with spare relay Found plug & harness to pressure switch faulty Repaired harness & changed out deutsch plug Tested, all operational	
22/04/2025	721,398 kms	Lights - IMPORTANT R-8923	Mitch Grima
		Inspect Spotlight not working. Found relay to have no power Repaired relay power supply harness	
22/04/2025	721,398 kms	WINDSCREEN WASHER / WIPER - IMPORTANT R-8924	Mitch Grima
		Changed out damaged 6mm wiper blades	
17/04/2025	719,124 kms	Cooling System R-8903	Daniel Farinha - Misso's
		Inspected fault Found Level sensor to be U/S Removed and replaced, tested and all operational	
16/04/2025	718,730 kms	Cab R-8435	Daniel Farinha - Misso's
		Inspected at time of report Found to be working at time of inspection, no issue found	
16/04/2025	718,730 kms	Cooling System, Leak - IMPORTANT R-8786	Daniel Farinha - Misso's, Isaac Colledge
		Remove radiator and send off for cleaning and repair, carried out handover with Matty T Replaced radiator and reconnected all lines, refilled cooling system Topper up power steering oil level Replaced radiator mounts, stay bar mounts and bonnet mounts	
07/04/2025	717,714 kms	Communication System - URGENT R-8787	Troy Francken
		Fabricated and fitted new Vitrinite Mine radio bracket	
05/04/2025	717,245 kms	Cooling System R-8752	Daniel Farinha - Misso's
		Rolled bonnet, inspected for leaks, no leaks present Monitor	

Date	Reading / Units	Type / Repairer Notes	Repairer
29/03/2025		Brake Test 6 Months I-2015 Complete MNM Work Order & Brake Test - VD62 ST32 D17 ST33 ST34	Greg Fing
22/03/2025	712,709 kms	Battery - IMPORTANT R-8600 Travelled to rail yard at Saraji Inspected and found batteries had boile, 1x battery to be U/S Changed out Batteries and Alternator Inspected charge rate, all operational	Daniel Farinha - Misso's, Joseph Parker
22/03/2025	712,709 kms	Air Conditioner, Lights - IMPORTANT R-8502 Inspected Fault, found loose wires in Pressure switch Removed and replaced pressure switch & Patch harness, secured wiring Run up and tested, all operational	Daniel Farinha - Misso's
19/03/2025	711,426 kms	Exhaust R-8550 Slip joint on Exhaust, No repair required	Daniel Farinha - Misso's
11/03/2025	701,618 kms	Engine R-4278 See attached jobcard Repairs carried out at previous service	Internal Workshop
07/03/2025	705,966 kms	Air Conditioner R-5745 Refer to R-8380	Internal Workshop
07/03/2025	705,966 kms	Air Conditioner R-8380 Connected guages, compressor not pumping, compressor cut in after light tap on clutch, worn clutch Removed and replaced A/C compressor and receiver Vac down for 30 minutes Gas and test system, all operational	Rylee Jakupovic
06/03/2025	706,765 kms	CODES, Engine R-8295 Replaced NOX Sensor as requested, fault still present Carry out High NOX level Reset, Road tested, check engine light not present, engine performance at full level Note: Jaltest not working correctly, carried out Update to laptop	Liam Kitching - Misso, Peter Harris
06/03/2025	706,765 kms	Engine R-8315 Refer to R-8295	Liam Kitching - Misso, Peter Harris
05/03/2025	705,966 kms	A - 14000 S-5708 Carried out A Service as per Service sheet attached	Harry Louis, Liam Kitching - Misso
28/02/2025	702,737 kms	Exhaust R-8271 Heat shroud/ lagging fine Springs are a slightly loose but in working order Ok to operate, no repair required	Peter Harris
27/02/2025	701,996 kms	Electrical - IMPORTANT R-8270 Travel to Railyard, Diagnose Bad connection at lead trailer plug, pull plug apart and tightened wiring, all operational	Peter Harris
25/02/2025	701,618 kms	Engine R-8168 Remove Adblue Injector & Cleaned, Purged system, Install and test, all ok Replaced All hoses from tank to Adblue pump, tested and no leaks found	Matthew Twitchett, Peter Harris
24/02/2025	701,618 kms	Electrical - IMPORTANT, Lights - IMPORTANT R-8167 Breakdown- Rail pad Saraji Inspected indicator fault, found flasher relay to be U/S Sourced new relay Removed and replaced Relay Tested lights, all operational	Daniel Farinha - Misso's
13/02/2025	700,505 kms	Air Dryer R-7853	Internal Workshop
13/02/2025	700,505 kms	Steering - URGENT, Suspension - URGENT R-7943 remove and replace both torque rod bush remove and replace link due to wear in the back joints	Internal Workshop
13/02/2025	700,505 kms	Damage R-7534 Change both boots on gearstick	Internal Workshop
13/02/2025	700,505 kms	Lights - IMPORTANT R-7854	Internal Workshop
10/01/2025		Fault T-546	Internal Workshop
09/01/2025	692,994 kms	Electrical - IMPORTANT R-7776	Internal Workshop

Date	Reading / Units	Type / Repairer Notes	Repairer
06/01/2025	691,481 kms	C - 56000 S-5509	Internal Workshop
05/01/2025	691,481 kms	Engine R-7659	Internal Workshop
05/01/2025	697,481 kms	Engine R-7731	Internal Workshop
17/12/2024	678,650 kms 4,166,733 hrs	New T-525 Change POS 1/2, replace with new tyres	Genecy Dos Santos
10/12/2024	681,625 kms	Missing R-7533	Internal Workshop
09/12/2024	684,693 kms	Lights - IMPORTANT R-7671	Internal Workshop
05/12/2024	682,460 kms	Electrical - IMPORTANT, Gearbox R-7601	Internal Workshop
04/12/2024	682,460 kms	Windscreen/Mirrors - IMPORTANT R-5146 new LH windscreen fitted by ardic glass	Internal Workshop
29/11/2024	677,219 kms	Intercooler R-7547 Removed damaged nut & replaced with new bolt, isolating rubber + nycoc nut Required new radiator mount bushes)	Internal Workshop
28/11/2024	678,630 kms	Engine R-7600 Replace and clean injector, preform Ocser pump test, operational and no check engine light.	Internal Workshop
26/11/2024		Turntable - Ringfeeder and Kingpin Inspection I-1765	Liam Kitching - Misso
26/11/2024		Compliance, Turntable - IMPORTANT R-7562 Carried out hitching inspection Inspected turntable mounting Inspected turntable jaw kit All operational	Liam Kitching - Misso
24/11/2024	677,233 kms	Brake Test 6 Months I-1745 Complete CapCoal CONEQU and Brake Test - VD62 ST32 D17 ST33 ST34	Nick Fenton
18/11/2024	674,677 kms	Air Dryer R-7496 No Repair Required Drain air tank checked air dryer seem to be working	Internal Workshop
17/11/2024		Brake Test 6 Months I-1727 Complete Work Order and Brake Test for VD62 ST32 D17 ST33 ST34	Greg Fing
17/11/2024	673,801 hrs	BULLBAR R-7487 Removed bullbar and backing plate, removed broken bolt and re-assembled	Internal Workshop
14/10/2024		Fire Extinguisher Inspection I-1599 See attached inspection	Pyro Dynamics Pty Ltd
14/10/2024		Fire Suppression Inspection I-1600 See attached inspection	Pyro Dynamics Pty Ltd
12/10/2024	671,647 kms 14,559 hrs	BULLBAR R-5720 See attached jobcard Has 11 bull bar bolts.	Jonathan Rafferty - Misso
12/10/2024	671,647 kms 14,559 hrs	A - 14000 S-5129 No reverse lights & buzzer - Repair plug on reverse switch Leaking airbag on POS 4 - Replaced cracked airbag One spot light not working - Fuses replaced Crack on LH side windscreen - Monitor Fire extinguisher OOD Side clearance LH side u/s - Replaced Intake snorkel twisted - Repaired Bonnet supports worn (upper supports)	Jonathan Rafferty - Misso, Peter Harris
12/10/2024	671,646 kms	Chassis R-6449 See attached jobcard Rose joints replaced.	Peter Harris

Date	Reading / Units	Type / Repairer Notes	Repairer
29/09/2024	665,580 kms	Electrical - IMPORTANT R-6961 See attached jobcard Checked power supply has power, seems to be working. Tested with other hand set, all working correctly.	Duane Hitch - Sourth East Mechanical
22/09/2024	662,067 kms	B - 28000 S-4940 See attached jobcard	Daniel Farinha - Misso's
04/09/2024		Breakdown R-6767 See attached jobcard Travelled from MVP MIA south to Beef Road parking bay. Metal roof sheeting torn from loading too high or rocks falling from bucket. Run as many self tippers to secure (only temporary).	Robert Brackowski
28/08/2024		Other R-7252 Repair all lights Remove concrete chunks out of duals	Timothy McFadzen Contracting
16/08/2024	646,655 kms	A - 14000 S-4516 See attached jobcard	Duane Hitch - Sourth East Mechanical
09/08/2024		Brake Test 6 Months I-1485 See attached jobcard	Damian Ryan
08/08/2024	646,643 kms	Retighten Wheels, Rotate T-273 See attached jobcard Travel, retorque wheels, travel back.	Genecy Dos Santos
07/08/2024	646,649 kms	Brake Test 6 Months I-1484 See attached jobcard	Damian Ryan
01/08/2024	644,526 kms	Battery - IMPORTANT R-6474 Replaced 4 x batteries	Matthew Twitchett
10/07/2024	632,641 kms	Lights - IMPORTANT R-6253 See attached jobcard Repaired wiring for park lights.	Matthew Twitchett
07/07/2024	630,105 kms	E - 336000 S-4364 See attached jobcard Remove steer and POS 3 steer need nee to retorque.	Matthew Twitchett
05/07/2024	630,105 kms	Transmission/Clutch - URGENT R-6191 See attached jobcard	Matthew Twitchett
03/07/2024	630,105 kms	Fuel R-6190 See attached jobcard Made bracket and fit new filter on. Took sock off pickup.	Harry Louis
03/07/2024	630,105 kms	Suspension - URGENT R-6189 See attached jobcard Replaced all shock absorbers.	Harry Louis
03/07/2024	630,105 kms	Diff R-5886 See attached jobcard	Matthew Twitchett
02/07/2024	630,105 kms	Cab R-5993 See attached jobcard Replaced cab filters.	Harry Louis
28/06/2024	623,517 kms	Brake Test 6 Months I-1312 Complete MBN 24W Brake Test - PASS	Gregory Fing
25/06/2024	630,105 kms	Lights - IMPORTANT R-6027 See attached jobcard All lights work.	Joseph Parker
25/06/2024	630,105 kms	Damage R-5610 See attached jobcard No paint on both mirrors can visually see everything.	Joseph Parker
24/06/2024	630,105 kms	Engine R-5926 See attached jobcard Front area rear replaced.	Joseph Parker

Date	Reading / Units	Type / Repairer Notes	Repairer
08/06/2024		King Pin - IMPORTANT, Turntable - IMPORTANT R-5999 Carried out Compliance inspection at time of report	Internal Workshop
03/06/2024	613,500 kms	Conneq Pre Inspection I-1239 Complete CapCoal CONEQU Brake Test - PASS	Damian Ryan
29/05/2024	610,816 kms	A - 14000 S-4233 See attached jobcard	Daniel Farinha - Misso's
24/05/2024	8,024 kms	Brake Test 3 Months I-1223 Complete IP 12W brake test - PASS	Damian Ryan
18/05/2024		Fire Suppression Inspection I-1230 See attached Statement of Works	Pyro Dynamics Pty Ltd
14/05/2024	600,371 kms	Broken R-5565 See attached jobcard Removed, welded up, re-attached with rubber.	Peter Harris
13/05/2024	599,961 kms	Broken R-5551 See attached jobcard Unbolt fire suppression bracket weld crack and brake pick up more holes on rops and bolt back on.	Corey Clark
12/05/2024	599,413 kms	B - 28000 S-4118 See attached jobcard	Daniel Farinha - Misso's
02/05/2024	593,690 kms	Electrical - IMPORTANT R-5448 See attached jobcard RAW Electrical Attended repair and Properly fixed Aircon System	Jonathan Rafferty - Misso
30/04/2024	592,485 kms 12,637 hrs	Air Conditioner R-5406 See attached jobcard Replaced leaking hose due to condenser fan not working. Vac down & regas, found condenser fans not working. Diagnose fault & had to rewire due to short in loom. Run up & test operation.	Christopher Solmon
24/04/2024	591,567 kms	Engine R-5210 See attached jobcard Pulled off guards. Removed intercooler, matched with new intercooler. Put new intercooler in. Bolted up, put guards and pipes on. Parked truck up.	Jonathan Rafferty - Misso
24/04/2024	591,557 kms	Engine, Exhaust R-5330 See attached jobcard Pulled off old ad-blu pump. Replaced with new. Clean out supply line which was full of water. Connected all pipe work. Did a dosage test. Got around 100ml of, ad-blu in 6 minutes which is good. Pat everything.	Jonathan Rafferty - Misso
21/04/2024	591,222 kms	Brake Test Annual I-1102 Vulcan Yearly Compliance Brake Test - PASS	Damian Ryan
20/04/2024	591,121 kms	Cab R-5063 See attached jobcard Removed door cards, Removed panel on ignition barrel, removed key barrels and replaced with new Tested, all operational	Daniel Breen - TMT
10/04/2024	586,033 kms 12,501 hrs	Engine, Turbo R-5130 See attached jobcard Got operator to start engine, heard the squeal for a split second Believe the Tensioner pulleys are starting to show signs of wear Monitor and replace Next B service	Jonathan Rafferty - Misso
08/04/2024	584,415 kms	Engine R-5070 See attached jobcard Removed and Replaced 2 Speed Horton Fan Assembly Run up and tested operation, inspected for leaks, all operational	Jonathan Rafferty - Misso
08/04/2024	584,415 kms	A - 15,000 S-3933 See attached jobcard Monitor cab mount. Order in new air drier fit for oil change please.	Jonathan Rafferty - Misso
08/04/2024	584,415 kms	Suspension - URGENT R-5081 See attached jobcard Replaced & Welded in Steer Axle Spring Eye and Shackle Pins & Bushes Shackle plates utilized from VD50 parts- To be replaced	Jonathan Rafferty - Misso

Date	Reading / Units	Type / Repairer Notes	Repairer
06/04/2024		Guardian R-5114 See attached jobcard Update guardian firmware. Load gearbox to tablet talk to MT Data support to get open IP tables, send out new talon config. Test app works through talon.	Damian Ryan
05/04/2024	584,415 kms	Engine R-4894 See attached jobcard Engine code relating to water in fuel, Drained water and code went inactive	Jonathan Rafferty - Misso
22/03/2024	572,719 kms 12,228 hrs	New, Retighten Wheels T-78 See attached jobcard Replaced Steer tyres with new Carried out Re-torque	Joseph Parker
18/03/2024	781,620 kms	Cab R-4237 See attached jobcard Replaced adblue injector and patch lead. Tested and fine.	Adam Wilson
16/03/2024	568,814 kms 12,145 hrs	Cab R-4716 See attached jobcard Light no longer on.	Adam Wilson
16/03/2024	12,145 hrs	Turntable - Ringfeeder and Kingpin Inspection I-1021 See attached inspection report	Adam Wilson
15/03/2024	568,814 kms 12,145 hrs	A - 2 Wks S-3751 See attached jobcard All work carried out as per B-Service sheet.	Adam Wilson
15/03/2024	568,814 kms 12,145 hrs	New T-73 See attached jobcard replaced all drive tyres	Christopher Solmon
15/03/2024	568,664 kms	Battery - IMPORTANT R-4658 See attached jobcard Replaced all 4x batteries and configured to 12	Adam Wilson
15/03/2024	568,814 kms 12,145 hrs	B - 30,000 S-3824 See attached jobcard	Adam Wilson
15/03/2024	568,814 kms	Body R-4450 See attached jobcard Replace left bonnet latch	Adam Wilson
15/03/2024	352,420 kms 56,884 hrs	Windscreen/Mirrors - IMPORTANT R-4712 See attached jobcard Reconnected hose	Adam Wilson
15/03/2024	568,814 kms	Lights - IMPORTANT R-4655 See attached jobcard Work was carried out	Adam Wilson
12/03/2024	567,065 kms	Transmission/Clutch - URGENT R-4711 Duane Hitch - Sourth East Mechanical	
04/03/2024		Guardian R-4617 Guardian replaced ffc as the original one wasn't powering up at all. With shielding tape Fitted new camera carried out manual recording to make sure it was streaming with both feeds.	Global Installs
04/03/2024		MT Data R-4616 Mtdata carried out system check with support all ok.	Global Installs
26/02/2024	555,700 kms 11,837 hrs	B - 30,000 S-3644 See attached jobcard Replaced aircon belt - P/N 0134692 15613031G Radiator tank leak	Daniel Farinha - Misso's
26/02/2024		Turntable - Ringfeeder and Kingpin Inspection I-963 See attached inspection report	Daniel Farinha - Misso's

Date	Reading / Units	Type / Repairer Notes	Repairer
26/02/2024	555,700 kms 11,837 hrs	Engine R-4279 See attached jobcard Previously repaired on Intercooler replacement Duplicate Job card	Ryan Rosman - TMT Mechanical
26/02/2024	555,700 kms 11,837 hrs	Lights - IMPORTANT R-4502 See attached jobcard Replaced wiring Tested, all operational	Daniel Farinha - Misso's
19/02/2024	552,104 kms	Intercooler R-4462 See attached jobcard Repaired lower intercooler mount due to elongated hole	Tony Thompson
08/02/2024	546,892 kms	Fire Suppression - IMPORTANT R-4302 See attached jobcard Removed broken studs out of ROPS and fit new bolts to Fire Suppression Mount	DBE Heavy Vehicle Repairs
05/02/2024		Leak - IMPORTANT R-3967 See attached jobcard Could not find air leak	Daniel Farinha - Misso's
05/02/2024	544,948 kms	A - 2 Wks S-3544 See attached jobcard	Daniel Farinha - Misso's
02/02/2024		Fire Suppression - IMPORTANT R-4211 See attached jobcard Pyro dynamic repaired @ BP peak downs 1-2-24 Suppression bottle had hole	Internal Workshop
01/02/2024		Fire Suppression - IMPORTANT R-4399 See attached jobcard Removed discharge hose and capped bottle Recharge systm to correct pressure to conduct leak test Found fire suppression bottle had a leak due to rub through from rubbing on bracket bolt	Pyro Dynamics Pty Ltd
30/01/2024	542,696 kms	Brake Test MNM 3 Monthly I-839 Complete 12W Brake test - PASS	Nick Fenton
30/01/2024	542,696 kms	Brake Test Annual I-838 Complete Moranbah North 48W Site Intro and brake test - PASS	Nick Fenton
28/01/2024		Body, WINDSCREEN WASHER / WIPER - IMPORTANT R-4129 See attached jobcard Replaced windscreen wipers 28.1.24	Duane Hitch - Sourth East Mechanical
22/01/2024		Engine R-4071 See attached jobcard Replaced heater hose and hose clamp Top up with coolant	Duane Hitch - Sourth East Mechanical
19/01/2024		Electrical - IMPORTANT, Lights - IMPORTANT R-3756 See attached jobcard Chassis wiring to led lights had broken wired and had shorted back led lights Repair wiring and replace tail lights	Daniel Breen - TMT
19/01/2024		Cab R-3604 See attached jobcard Seat has been replaced	Duane Hitch - Sourth East Mechanical
19/01/2024	534,135 kms	A - 8 Wks S-3449 See attached jobcard Tail, Brake, Blinkers don't work - Replaced tail lights Tema's U/S - Replace tema Sump weaping POS 2 Wheel seal U/S	Daniel Breen - TMT
16/01/2024		Hydraulics - IMPORTANT R-3939 See attached jobcard Change switch in cab on controls	Daniel Farinha - Misso's
01/01/2024		Lights - IMPORTANT R-2681 See attached jobcard 2681 Require LED lights See attached jobcard R & R Light	Joseph Celetaria
31/12/2023	520,000 kms	Air Conditioner R-3793 See attached jobcard R & R compressor, perform A/C lines flush, R & R filter Vacuum and regas Check ok	Joseph Celetaria
20/12/2023		Fuel R-3709 See attached jobcard 3709 Clena out breather and fit hose	Daniel Farinha - Misso's

Date	Reading / Units	Type / Repairer Notes	Repairer
20/12/2023	520,000 kms	B - 35,000 S-3312 See attached jobcard	DBE Heavy Vehicle Repairs
20/12/2023		Cab, Other R-2737 See attached jobcard 2737 Repair kit for seat base or new seat assembly Note - new seat ordered 30.11.23 New seat fitted	Ryan Rosman - TMT Mechanical
20/12/2023		Fire Suppression - IMPORTANT R-3508 See attached jobcard 3508 Pyro completed work	Pyro Dynamics Pty Ltd
20/12/2023	520,000 kms	Cab, Transmission/Clutch - URGENT R-3710 See attached jobcard 3710 Replaced low coolant sensor	DBE Heavy Vehicle Repairs
18/12/2023		Fuel R-3007 See attached jobcard 3007 Slight damage to tank near neck from bowser nozzle will need new neck welded in to repair Monitor fault - C.Solomon 15.12.23	Internal Workshop
18/12/2023		Turntable - Ringfeeder and Kingpin Inspection I-714 See attached Inspection form	DBE Heavy Vehicle Repairs
01/12/2023	488,640 kms 10,218 hrs	Hydraulics - IMPORTANT R-3063 See attached jobcard 3063 No leak found	Internal Workshop
01/12/2023	508,748 kms	B - 35,000 S-3190 See attached jobcard 3190 Air dry fault - Retro fit turbo 2000 and wire in Missing nut off eng mount - fit new nut and tightened all bolts Cab pan hard rod bolt snapped - replaced Cross member bolts above diff loose - tightened Hot pipe needs replacing - replaced hot pipe	Internal Workshop
01/12/2023		Lights - IMPORTANT R-2450 See attached jobcard 2450 Inspect next service, clean moisture in modulator right hand front, no program to check ABS	Internal Workshop
01/12/2023	497,013 kms	Engine R-3006 See attached jobcard 3006 Minor leak - monitor next service checked 27.11.23 ok	Internal Workshop
01/12/2023		Engine R-3008 See attached jobcard 3008 Air filter reokaced (new)	Internal Workshop
01/12/2023		Leak - IMPORTANT R-3448 See attached jobcard 3448 Replace 4 way valve Remove wabco dryer and fit turbo 2000	Internal Workshop
01/12/2023		Turntable - IMPORTANT R-3485 See attached jobcard 3485 Check and adjust turntable	Internal Workshop
13/11/2023	497,013 kms 10,418 hrs	A - 8 Wks S-3100 See attached service jobcard 3100 Play in turntable - Adjust turntable and check pin on trailer LH high beam headlight - replace both high beam lights Eng light on - need to order low coolant sensor Drive tyres low - replace all drive tyres 1st diff input loose - tighten input shaft	Internal Workshop
09/11/2023		Leak - IMPORTANT R-2720 See attached jobcard 2720 Require 2 x new ride height valves Not leaking at service	Internal Workshop
09/11/2023		Lights - IMPORTANT R-2962 See attached jobcard 2962 Replace LH and RH lights Replaced lights	Internal Workshop
03/11/2023		Wheels/Tyres - URGENT R-3090 See attached jobcard 3090 Replaced both steer tyres with new ones 85psi	Internal Workshop
24/10/2023		Communication System - URGENT R-2908	Tina O'Hare

Date	Reading / Units	Type / Repairer Notes	Repairer
		12.10.2023 - Email received from Aron at MT Data in regards to issues, see attached. Tina forwarded an email through to Kyra requesting further information in regards to the issue so MT Data can investigate. 24.10.2023 - Email forwarded through to Kyra checking if we are still having issues. 24.10.2023 - Received email received from Kyra stating that the driver logged in today with no issues. 24.10.2023 - Email forwarded through to MT Data stating no issues at the moment and requested the ticket to be closed.	
17/10/2023	480,718 kms	B - 35,000 S-2964 See attached jobcard Steer tyres have uneven wear - to be monitored - Refer to defects Replaced Starter motor Front Spring shackles have excessive movement - bushes moving in left eye - recommend repair - Replace leaf springs shackles & bushes PTO casing starting to leak - Reseal next service L/H xover fuelling weeping - Replace next service No Air filters in stock - Replace ASAP (A Service)	Matthew Twitchett
12/10/2023		Lights - IMPORTANT R-2902 See attached jobcard Working when inspected	Duane Hitch - Sourth East Mechanical
30/09/2023		Flashing Light - URGENT R-2678 Parts - Beacon light, Deutsch plug 2 pin	Joseph Celetaria
30/09/2023		Air Conditioner, Leak - IMPORTANT R-2722 See attached Jobcard A/c leaking from crimp Warranty from hose guys	Joseph Celetaria
30/09/2023	471,728 kms 9,827 hrs	A - 8 Wks S-2884 A Service	Internal Workshop
12/09/2023	464,245 kms	Compliance R-2576 Confirmation of speed limited vehicle - VD62 Speed limited to 87kmph	Internal Workshop
12/09/2023	464,245 kms	Compliance R-2592 System audit confirms both are in working order	
31/08/2023	460,955 kms	A - 8 Wks S-2758 A service carried out as per service record - RR Replaced front and rear engine mounts Replace missing front engine mount Repaired rear bonnet frame rubbers - broken Repaired cab mounts - Excessive wear Replaced diff torque rod bushes 1st diff input movement - Adjusted Repalced jawkit and horse shoe on turntable Repaired 5/8 line and joiner on air leak at fuel punmp Retensioned wheel bearings front	Internal Workshop
30/08/2023	460,955 kms	Other R-1959 Re-aligned shrouding	Internal Workshop
30/08/2023	460,955 kms	Other R-1957 Fitted new gearbox boot	Internal Workshop
30/08/2023	460,955 kms	Other R-1960 Removed and repaired bushes	Internal Workshop
30/08/2023	460,955 kms	Other R-1958 Removed and replaced bushes - re-aligned exhaust shroud	Internal Workshop
29/08/2023		Other R-1836 Replaced tank strap rubbers	Internal Workshop
29/08/2023	460,955 kms	Flashing Light - URGENT R-2411 No fault found	Internal Workshop
29/08/2023	460,955 kms	Engine R-1956 Replaced front engine mount	Internal Workshop
29/08/2023	460,955 kms	Engine R-1955 Replaced engine mounts	Internal Workshop
28/08/2023		Engine R-1951	Internal Workshop

Date	Reading / Units	Type / Repairer Notes	Repairer
		07.07.23 - Noise from front of engine - Alternator and horton. Remove and replace Alternator. Lock out horton. Temp repair and order parts HM 28.08.2023 - Wrong Diagnosis, No repair required - CS	
23/08/2023		Suspension - URGENT R-2440 Inspected and no fault founds	Internal Workshop
17/08/2023	451,348 kms	B - 35,000 S-2668 B Service carried out as per service record - DH Next service: Cab mount worn - in stock Engine mount worn (front and rear) in stock	Internal Workshop
02/08/2023	441,305 kms	Turntable - IMPORTANT R-2230 Inspected 2 x bolts Tightened bolts on site - marked with pen Repaired at workshop with new bolts	Internal Workshop
23/07/2023	435,592 kms	A - 8 Wks S-2540 A Service carried out as per service report Turntable needs adjusting - Adjusted but out of adjustment DH Cab mounts front worn - Parts ordered 17/7/23 - ETA 28/7/23 Pos 4 mudguard rear support loose - Tighten bolts C.S Pos 3 mudguard mount loose on front - Tighten bolts C.S Engine oil leak around sump. Needs wash and reinspect - No more leaks at time of service C.S LHS Front shocker loose - Tightened shocker bolt DH Raditator top tank showing signs of leaking - Monitor C.S Engine oil was on add - Put 7Lt of engine oil in C.S	Christopher Solmon
20/07/2023		Windscreen/Mirrors - IMPORTANT R-2200 Bolt on RHS mirror back on truck	Duane Hitch - Sourth East Mechanical
12/07/2023		Other R-2100 Run up truck to operating temp. Recheck coolant and top up. Check oil and all lights. Replaced broken E-stop LHS of truck Remove and replace water pump. Refit belts, fan blade and intercooler hoses. Refill coolant. Run up and test.	Christopher Solmon, Ryan Rosman - TMT Mechanical
05/07/2023	425,400 kms 8,767 hrs	A - 8 Wks S-2450 A Service carried out as per service report Front and Rear engine mounts worn - Parts to be ordered R.R Front engine mounts bolts loose - Parts to be ordered R.R PCV Hose from rocker cover loose - Repaired and secured R.R A/C line from compressor to firewall excessive rub marks - Repaired and secured R.R Pos 4 J beam washers spinning - Monitor for next service R.R PTO mounting leaking oil - Monitor for next service/ nipples up bolts and topped up level R.R Mirror park lights missing - Lights to be ordered R.R Top Raditator tank weeping coolant - Monitor next service R.R Raditator lower mounts - Monitor next service R.R Gearstick lower boot ripped - R.R - Part ordered 07.07.23 RH Exhaust stack mounting rubbers worn - Parts to be ordered R.R Shroud rubbing on cab - Repair next service R.R LH Tank strap rubber shifted - Requires adjustment R.R Front cab mounts - Parts to be ordered R.R RH lower intercooler mount missing - Repaired and secured R.R Hotline rubbing on bracket - Repaired and secured - R.R	Ryan Rosman - TMT Mechanical
27/06/2023		Other R-1839 Secured U clamp on cab tube frame	Hugh Middleton VDPH Maintenance Coordinator
25/06/2023		Electrical - IMPORTANT, Lights - IMPORTANT R-1598 05.06.23 - 402280Km: Inspect and test indicators flashing fast, Found incorrect flasher can fitted. Parts ordered 25.06.23 Install load resistors into LH and RH indicator circuits. Secure and test all ok	Raw Auto Electrical
23/06/2023	415,881 kms 8,560 hrs	Leak - IMPORTANT R-1834 Replaced Tema couplings	Hugh Middleton VDPH Maintenance Coordinator
22/06/2023		Other R-1705 New grease block fitted by Abmlube service fitter Chris Mclean Gearbox and engine mounts S/able HM	Internal Workshop
19/06/2023		Engine R-1892 Carried out laptop diagnostics. No error code found. Carried out boost test no leaks found. further check found to be driver error reading boost gauge. No repair Required	Hugh Middleton VDPH Maintenance Coordinator
18/06/2023		Electrical - IMPORTANT R-1798 Replaced level sensor	Hugh Middleton VDPH Maintenance Coordinator

Date	Reading / Units	Type / Repairer Notes	Repairer
15/06/2023	410,271 kms 8,442 hrs	WINDSCREEN WASHER / WIPER - IMPORTANT R-1710 Repairs carried out from S2362 Washer jets - Repaired Mirror Lights - Removed not required	Internal Workshop
15/06/2023	410,271 kms 8,442 hrs	B - 35000 S-2362 B Service carried out as per service report Screen wash Inop - Repaired LH Stalk out of line - Repositioned RH 1st Drive Booster hose leaking - Replaced pipe Rear 3rd Axle drive tyres - Replaced Mirror Light inop - Removed not required	Hugh Middleton VDPH Maintenance Coordinator
09/06/2023	405,257 kms 8,338 hrs	Other R-1747 Remove 3rd axle diff torque rod assembly. Pressed old bush, Pressed and fitted new bush to rear eyelet - Refitted torque rod assembly Remove and replaced gearstick isolator bush. Carried out clutch adjustment.	Ryan Rosman - TMT Mechanical
08/06/2023	404,000 kms	Leak - IMPORTANT R-1739 LHS front airbag leaking, Remove and Replace airbag and checked	Lincoln Wild - LW Diesel & Contracting Services Pty Ltd
06/06/2023	492,019 kms	Brake Test Annual I-862 See attached report	Nick Fenton
06/06/2023	402,280 kms 8,280 hrs	Leak - IMPORTANT R-1564 Retorque top tank bolts	Hugh Middleton VDPH Maintenance Coordinator
05/06/2023	402,280 kms 8,280 hrs	A - 8 Wks S-2266 A Service carried out as per service report Main Accessory drive belt cracked - Repaired R.R Governor signal line - Repaired R.R P/S Res bolts - Repaired R.R LH Bonnet lower stay carrier - Boilys repaired RH grease block - Part Ordered S/able till next service Exhaust flexi - Boilys repaired Gearbox mounts - Parts Ordered S/able till next service Ride Height and rubbers broken - Repaired D.H Front Engine mounts - Parts ordered S/able till next service Rear Diff Torque rod rear bush - Parts ordered S/able till next service Engine oil low - Topped up 3Litres R.R PTO leaking @ gearbox gasket - R.R Parts ordered S/able till next service Suzio coils split - Repaired R.R Pos 5 Airbag leaking 3rd axle LH Airbag - Repaired D.H RH Lower intercooler mounting is excessively worn - Repaired R.R 2nd and 3rd axle wheel arch guard - Repaired D.H Front gear drain cover weeping oil - Monitor	Ryan Rosman - TMT Mechanical
04/06/2023	402,232 kms	Hydraulics - IMPORTANT R-1682 Blown hose from PTO to diverter. Removed and took back to workshop to make one. Travelled back, fitted hose and refilled hydraulic oil tank, checked functions. all ok	Randall Kruger - ADS
30/05/2023		Lights - IMPORTANT R-1687 Found no power from lead from truck. Found plug dirty, Cleaned contacts - Lights working again	Randall Kruger - ADS
22/05/2023	389,681 kms	WINDSCREEN WASHER / WIPER - IMPORTANT R-1562 Repaired washers	Lincoln Wild - LW Diesel & Contracting Services Pty Ltd
22/05/2023	389,081 kms	Transmission/Clutch - URGENT R-1565 Adjusted Clutch	Lincoln Wild - LW Diesel & Contracting Services Pty Ltd
22/05/2023	389,061 kms	Lights - IMPORTANT R-1563 Repaired wiring	Lincoln Wild - LW Diesel & Contracting Services Pty Ltd
21/05/2023		Wheels/Tyres - URGENT R-1561 New Steer tyre replaced	Hugh Middleton VDPH Maintenance Coordinator
05/05/2023		Electrical - IMPORTANT R-1170 Fit PTO Alarm, Connect and test found pressure switch failed internally. Remove and replace pressure switch and retest - All Ok	Raw Auto Electrical

Date	Reading / Units	Type / Repairer Notes	Repairer
05/05/2023	376,095 kms 7,770 hrs	B - 35000 S-2162 B Service carried out as per service report Both grill front indicators not working - Replaced HM RH bullbar spotlight not working - no power at plug Missing LH rear bonnet support - S/ABLE HM Exhaust Flex split - Fitted clamp Play/movement in turntable - Adjusted	Randall Kruger - ADS
02/05/2023		Leak - IMPORTANT R-1446 Tightened up coolant filter and top up coolant	ATL Diesel Services - Jordan Hasenkam
18/04/2023	361,371 kms	WINDSCREEN WASHER / WIPER - IMPORTANT R-1193 Replaced pump and jets	Nick Fenton
17/04/2023	361,371 kms 7,475 hrs	A - 8 Wks S-2047 A Service carried out as per service report Turntable play - May need jaw kit - Adjusted HM RH Front indicator wiring - Broken flush with light Repaired HM Blown grease line RH front steer - Repaired Washer Jets not working - Replaced Split engine exhaust flex - Check sealed HM	Randall Kruger - ADS
13/04/2023	359,494 kms	Other R-1253	Internal Workshop
08/04/2023	359,397 kms	Leak - IMPORTANT R-1239 Changed governor valve	Duane Hitch - Sourth East Mechanical
05/04/2023		Electrical - IMPORTANT R-1190 Jake Fing - Pyro - Repaired fault	Nick Fenton
04/04/2023		Fire Suppression Inspection I-581 As Per Service Report - 6 monthly & Annual Service Inspections	Pyro Dynamics Pty Ltd
04/04/2023		Fire Extinguisher Inspection I-582 As per service report - 6 monthly & Annual service and inspection	Pyro Dynamics Pty Ltd
04/04/2023		Damage R-1189 Removed and repaired	Duane Hitch - Sourth East Mechanical
29/03/2023	352,305 kms	Leak - IMPORTANT R-1159 Repair air leak on front brake valve - Had blown out hose. Repair and test OK.	Shaun Palmblad / ADS
28/03/2023	351,668 kms 7,241 hrs	A - 8 Wks S-1949 A Service carried out as per service report. Changed out worn steer tyres. Checked turn table - Found out of spec - Adjusted Replaced bulb LH. HM Replaced Washer jet LH arm. HM	ATL Diesel Services - Jordan Hasenkam
23/03/2023	346,629 kms	Wheels/Tyres - URGENT R-1112 Inspected tyre still legal - Slight shoulder wear	Hugh Middleton VDPH Maintenance Coordinator
20/03/2023	344,389 kms	Leak - IMPORTANT R-1081	Hugh Middleton VDPH Maintenance Coordinator
20/03/2023	344,389 kms	Wheels/Tyres - URGENT R-1079 Inspected tyre still legal at 8mm - monitor till next Inspection	Hugh Middleton VDPH Maintenance Coordinator
20/03/2023	344,389 kms	Leak - IMPORTANT R-1078 Removed hose and filter. Got hose welded from mounting leg refitted. Fitted new coolant filter and coolant.	Hugh Middleton VDPH Maintenance Coordinator
14/03/2023	339,625 kms 7,000 hrs	Air Conditioner, Lights - IMPORTANT R-990 Diagnose A/c system fault - New compressor and Drier required - 06.03.23 Remove and replace compressor, drier, vac and re-gas test all ok. Repair open circuit spot light wiring - test ok	Raw Auto Electrical

Date	Reading / Units	Type / Repairer Notes	Repairer
14/03/2023	339,625 kms	B - 35000 S-1859 B service carried out as per service report R-1006/F-1128 - Fault Repair - Repaired. R-990/F-1113 - Fault Repair - Repaired. RH spot light - INOP - Ticked No Plate lights - INOP - Ticked Dash gauge oil pressure - INOP - RAW Auto Repaired RH Grease bank - INOP - By pass to grease nipples 1st Drive tyre past limit - Replaced LH Bonnet Guide Broken - S/ABLE Slight wear rear engine mount - S/ABLE	Hugh Middleton VDPH Maintenance Coordinator
14/03/2023	339,625 kms 7,000 hrs	Electrical - IMPORTANT R-1006 Diagnose gauge fault, found oil pressure gauge failed internally - New gauge required 06-03-23 Remove and replace gauge and test - found all working ok. 14.03.23	
01/03/2023	328,090 kms 6,776 hrs	Electrical - IMPORTANT R-954 Repair leaver in system	Hugh Middleton VDPH Maintenance Coordinator
25/02/2023	324,128 kms 6,704 hrs	A - 8 Wks S-1769 Carried out A Service - As per Service Report Bonnet Indicator - Fixed LH bonnet indicator	ATL Diesel Services - Jordan Hasenkam
14/02/2023		Lights - IMPORTANT R-889 Repair broken wire to LH bonnet indictor	Hugh Middleton VDPH Maintenance Coordinator
13/02/2023	311,889 kms 6,465 hrs	B - 35000 S-1640 As per Service Report	Hugh Middleton VDPH Maintenance Coordinator
29/01/2023		Brakes - URGENT R-855 remove and clean silencer filter	Hugh Middleton VDPH Maintenance Coordinator
29/01/2023	300,975 kms 6,237 hrs	A - 8 Wks S-1272 As per Service Report	Hugh Middleton VDPH Maintenance Coordinator
28/01/2023		King Pin - IMPORTANT R-849 split trl at serv and gauged king pin and jaws no fault found	Hugh Middleton VDPH Maintenance Coordinator
28/01/2023		Suspension - URGENT R-846 replaced both lh and rh 1st drive air bags	Hugh Middleton VDPH Maintenance Coordinator
15/01/2023	291,156 kms 6,046 hrs	A - 8 Wks S-1509 Replaced right spot light fuse	ATL Diesel Services - Jordan Hasenkam
09/01/2023		Damage R-792 replaced strap	Hugh Middleton VDPH Maintenance Coordinator
31/12/2022	281,112 kms 5,853 hrs	C - Annual S-1460 Air leak PTO tip control lines - changes RH screen cracked - Part ordered 31.12.2022 LH lower bonnet guide broken - part ordered G/Stick floor gator split - stable LH lower bonnet guide broken part to be fabricated G/Stick floor gator ordered 31.12.2022	Hugh Middleton VDPH Maintenance Coordinator
18/12/2022	270,838 kms 5,667 hrs	A - 8 Wks S-1688 As per Service Report	Internal Workshop
10/12/2022		Leak - IMPORTANT R-730	Hugh Middleton VDPH Maintenance Coordinator

Date	Reading / Units	Type / Repairer Notes	Repairer
		replaced lines	
09/12/2022		Other R-729	Hugh Middleton VDPH Maintenance Coordinator
		replaced and secured new extinguisher	
03/12/2022	257,882 kms	A - 8 Wks S-1354	Hugh Middleton VDPH Maintenance Coordinator
		movement in RH side of draglink RH top shock mount worn no fire extinguisher - fitted flex below under cab broken - replaced RH tail light out - rewired check engine light - clear error code RH tyre slight wear at 2mm part ordered to be rebooked 7/12/22 + shocker	
30/11/2022		Fire Extinguisher Inspection I-506	Internal Workshop
15/11/2022	244,591 kms 5,159 hrs	B - 35000 S-1300	Hugh Middleton VDPH Maintenance Coordinator
		Screen Cracked RH All drive tyre on wear unit Rear Suspension beam nuts loose	
06/11/2022	231,948 kms 4,924 hrs	Other R-624	Hugh Middleton VDPH Maintenance Coordinator
		Repaired on Service - S1164	
04/11/2022	231,948 kms	A - 8 Wks S-1164	ATL Diesel Services - Jordan Hasenkam
		missing chocks and triangles EXH flex broken back of turbo - replaced HM (R624)	
16/10/2022		Wheels/Tyres - URGENT R-589	Hugh Middleton VDPH Maintenance Coordinator
		replaced front steer tyres	
10/10/2022	210,035 kms	B - 35000 S-1123	Luatasi Anesone Atileo
		TIP UP SHOC BOLT ON L/RK FIRE EXTINGUISHER MISSING BOLT - NEW BOLT.	
05/10/2022		Chassis R-559	Hugh Middleton VDPH Maintenance Coordinator
		reposition landing plates and weld lower carrier	
29/09/2022		Engine R-547	Cummins Mackay
		As per invoice 9521142 - Adjusted wastegate actuator to within spec, carry out test drive, all ok.	
26/08/2022	177,799 kms 3,892 hrs	B - 35000 S-1012	ATL Diesel Services - Jordan Hasenkam
		gear box oil low - topped up fuel leak at tank - sealed HM	
01/08/2022		Hydraulics - IMPORTANT R-409	Hugh Middleton VDPH Maintenance Coordinator
		no fault driver error used wrong lever	
31/07/2022		Fire Extinguisher Inspection I-548	Internal Workshop
04/07/2022	151,501 kms 3,294 hrs	B - 35000 S-875	Hugh Middleton VDPH Maintenance Coordinator
		Diff oil Change Air Filter Change Pre Filter Change Fuel line at RH Tank leaking - Replaced Header tank coolant level sensor damage - Replaced LHF Brake hose - Repositioned Grease line broken LHF - New line fitted	
07/06/2022		Brake Test Annual I-334	Nick Fenton
		PASS - For CapCoal	
04/06/2022		Wheels/Tyres - URGENT R-305	Nick Fenton
31/05/2022		Fire Extinguisher Inspection I-205	Internal Workshop
		As per information collected by Nick - 10.06.22	

Date	Reading / Units	Type / Repairer Notes	Repairer
17/05/2022		Other R-264	Hugh Middleton VDPH Maintenance Coordinator
12/05/2022	113,511 kms 2,400 hrs	A - 8 Wks S-728 Water ingress LH door - cat cable reposition AC inoperable - wiring repair Auto grease to top up - Topped up Austo grease line LH split - repaired	Hugh Middleton VDPH Maintenance Coordinator
20/04/2022	103,011 kms 2,233 hrs	A - 8 Wks S-647 LHF grease line split - replaced wheel alignment due - carried out front shocker worn - replaced AC inoperable - renew plug at pump 2nd axle new drive tyre fitted 20.04.22	Hugh Middleton VDPH Maintenance Coordinator
29/03/2022		Brake Test MNM 3 Monthly I-153	Gregory Fing
01/03/2022	67,722 kms 1,436 hrs	C - 100000 S-391 Top bonnet landing pad to be adj - Part ordered LH Bonnet cable adrift - Part ordered Oil leak at RHF Engine - Secured bolts and seal 1st drive front mud flap missing damage - N/A Bolst missing from RH heat shield exhaust - Replaced Fuel leak LH crossover pipe union - secured LHF head light parker inop - New bulb Front spot lights inop - Rewired	Hugh Middleton VDPH Maintenance Coordinator
23/02/2022	63,217 kms	Lights - IMPORTANT R-124 New lamp	Hugh Middleton VDPH Maintenance Coordinator
31/01/2022	23,024 kms	Damage R-70 Replaced guard	Hugh Middleton VDPH Maintenance Coordinator
23/01/2022	35,302 kms 745 hrs	Fuel R-43 Replaced tema coupling seals	Hugh Middleton VDPH Maintenance Coordinator
23/01/2022	38,001 kms 813 hrs	Hydraulics - IMPORTANT R-53 New tema seals fitted	Hugh Middleton VDPH Maintenance Coordinator
31/12/2021		Fire Extinguisher Inspection I-133 As per service sheet	Internal Workshop
26/12/2021	30,158 kms 596 hrs	B - 25000 S-326 Service + Repairs as per service sheet Acc vent tube split - hose extended	Hugh Middleton VDPH Maintenance Coordinator
26/12/2021	30,158 kms 596 hrs	A - 8 Wks S-325 Service + Repairs as per service sheet - A & B Service completed Fire Extinguisher Date - Dec 21 Acc vent tube split - hose extended	Hugh Middleton VDPH Maintenance Coordinator
14/12/2021		Brake Test MNM 3 Monthly I-71 Brake Test - PASS	Nick Fenton
27/10/2021		Brake Test MNM 3 Monthly I-4 BRAKE TEST- Completed	

Signed: _____

Name: _____

Date: _____