



Vehicle History Summary



Fleet #	VD68
Registration	XQ05UZ
Make	Mercedes Benz
Model	ACTROS
VIN / Chassis #	W1T96442420501843
Build Date	2021

Date	Reading / Units	Type / Repairer Notes	Repairer
04/07/2025	513,958 kms	Fault, New T-368	Genecy Dos Santos
28/03/2025		Gearbox R-8682 Inspected at time of fault Tested gear selection and PTO selection, Inspected Gearbox oil level, all ok	Internal Workshop
24/03/2025		Windscreen/Mirrors - IMPORTANT R-8605 Will be replaced at time of service, Inspected and found not be in Drivers vision Monitor and replace when available	Internal Workshop
17/03/2025		Turntable - Ringfeeder and Kingpin Inspection I-1989 Turntable and mount- no cracking detected	DTIS QLD PTY LTD
16/03/2025	558,651 kms	Battery - IMPORTANT R-8503 Travel to Peak Downs BP and diagnose flat batteries. 1 x 7v 76cca and other 6v 24cca. Replace both batteries with ones out of constock which terminals are opposite. Tested all ok.	Peter Harris
06/03/2025		Brakes - URGENT R-8351 Brakes inspected, all operational on Prime mover, inspected and re-adjusted all brakes on trailer set Carried out operational test, all ok	internal work
06/03/2025	556,121 kms	Leak - IMPORTANT R-8359 Replaced Air hose behind cab, repaired wiring Wiring needs more attention, wiring was laying across gearbox, resecured	Daniel Farinha - Misso's
01/03/2025	552,604 kms	Electrical - IMPORTANT R-8279 Removed and replaced trailer plug Tested, all operational	Peter Harris
24/02/2025	549,474 kms	MT Data R-8169 Driver cleaned connection port in tablet, reconnected and tested, all ok	Internal Workshop
14/02/2025	548,344 kms	Battery - IMPORTANT R-7982 Found e stop, reason for not starting	Internal Workshop
03/02/2025		Air Conditioner, Lights - IMPORTANT R-7908	
23/01/2025		Air Conditioner, coolant tank R-7914	RGM Maintenance Pty Ltd
20/01/2025	547,017 kms	Lights - IMPORTANT R-7258 replaced RH visor marker light	Internal Workshop
20/01/2025	547,017 kms	Lights - IMPORTANT R-7656 led light bars in bulbar removed	Internal Workshop
20/01/2025	547,017 kms	Lights - IMPORTANT R-6575 Please Order Top White LED Marker Lights on Sunvisor RH cab marker light replaced. Replaced Park light bulbs in headlight assembly	Internal Workshop

Date	Reading / Units	Type / Repairer Notes	Repairer
17/01/2025		Fire Suppression Inspection I-1797 Yearly Fire Suppression and Extinguisher Inspection	Pyro Dynamics Pty Ltd
16/01/2025	545,255 kms	Compliance, Turntable - IMPORTANT R-7795 Turntable, jaws and mounts inspected - No issue found	Internal Workshop
02/01/2025	547,017 kms	Engine, Fire Extinguisher, Leak - IMPORTANT, Lights - IMPORTANT R-7848	Internal Workshop
13/12/2024	404,711 kms	Alternator, Engine R-7684	Peter Harris
07/12/2024		Exhaust, Leak - IMPORTANT R-7666 Filter replaced at Vulcan Go-line at time of report Inspected AdBlue leak, inspected filter housing. Found pinched O-Ring Fitted new O-Ring refitted & tested	Internal Workshop
25/11/2024	535,000 kms	C - 56000 S-5379 Completed on 25/11/2024	Internal Workshop
25/11/2024	538,440 kms	Cab, Suspension - URGENT R-6287 Replaced front axle bump stops	Stegrah Industries Pty Ltd
25/11/2024	538,440 kms	Lights - IMPORTANT R-6380 Replaced Fuse	Stegrah Industries Pty Ltd
25/11/2024	538,440 kms	Lights - IMPORTANT R-6440 Replaced Bulbs	Internal Workshop
24/11/2024	538,440 kms	Transmission/Clutch - URGENT R-7154 No Repair Required No Comments Peter H	Internal Workshop
21/11/2024	536,287 kms	Missing R-7536 Wheel chock replaced at time of report	Internal Workshop
20/11/2024	535,349 kms	Wheels/Tyres - URGENT R-7532 Drive tyres replaced, carried out re-torque	Genecy Dos Santos
17/11/2024		Brake Test 6 Months I-1728 Complete Work Order and Brake Test for VD68 CT19 D16 CT18 CT16	Greg Fing
06/11/2024		Engine R-7401 Found blown 6mm air line & inspected system circuit for probable cause Could not find significant cause and put down to maybe compromised / incorrect hose fitting Managed to obtain some extra lenght from factory hose & rejoined To be monitored	Matthew Twitchett
04/11/2024	529,490 kms	Cab, Electrical - IMPORTANT R-7340 Screen is still operational, steering wheel pad controls the screen functions	Internal Workshop
28/10/2024	526,905 kms	A - 14000 S-5204 Parkers in headlight blown - Parts to be sourced RH parked on top of ? - Not working Leak oil around sump	Daniel Farinha - Misso's
27/10/2024	526,905 kms	Leak - IMPORTANT R-7094 Topped up coolant level. Inspected for leaks, no leaks found.	Daniel Farinha - Misso's, Peter Harris
27/10/2024	526,905 kms	Fuel R-6466 No fault found. Repaired previously.	Daniel Farinha - Misso's, Peter Harris
27/10/2024	526,905 kms	Electrical - IMPORTANT R-6826 No fault found. Repaired previously.	Daniel Farinha - Misso's, Peter Harris
27/10/2024	526,905 kms	Leak - IMPORTANT R-6818 No leaking fittings found. Repaired previously.	Daniel Farinha - Misso's, Peter Harris

Date	Reading / Units	Type / Repairer Notes	Repairer
21/10/2024	522,705 kms	Alternator R-7193 Replace alternator and wiring Replace 2x fixed idlers Replace 2x belts	Daniel Farinha - Misso's
19/10/2024		Fire Suppression Inspection I-1683	Pyro Dynamics Pty Ltd
07/10/2024	516,808 kms	Compliance, Guardian R-7041 Checked GPS signal, GPS ariel also checked plug to processor all ok unit has 11 satellites and a GPS fix of 3. Carried out test events and call support to make sure they see the events without any faults. FFC has streaming percentage will need to replace camera when some stock comes in.	Internal Workshop
07/10/2024		Guardian R-7213 See attached jobcard Checked out GPS aerial and connection, all ok, unit had 11 sats and a GPS lock of 3. Created test events, called support to make sure unit was reporting with no faults. Units FFC has low streaming, will require new camera to be ordered.	Damian Ryan
02/10/2024	513,028 kms	Lights - IMPORTANT R-6705 See attached jobcard Check ride height and adjust.	Daniel Farinha - Misso's
25/09/2024	477,086 kms	Communication System - URGENT R-6390 Inspected Previously, no fault found	Internal Workshop
20/09/2024	507,769 kms	B - 28000 S-4935 See attached jobcard Replaced blue boy air fitting covers on suzi coils.	Liam Kitching - Misso
13/09/2024	502,870 kms	Air Conditioner R-6840 See attached jobcard Clip A/C compressor wire together and tested, working well now.	Duane Hitch - Sourth East Mechanical
13/09/2024	502,486 kms	Alternator R-6819 See attached jobcard Inspect alternator, found main wire harness not connected. Fully remove clean plug & connected & tested, no further faults found. May need to put zip tie on plug to stop it coming out.	Jye Storch
08/09/2024		MT Data R-6839 See attached jobcard Travel from Dysart to Peak Down. Tablet not charging, check for power at power pack, all okay. Power to cradle found to be okay. Replace cradle with a good second hand one, will monitor with the driver on how it goes. Travel back to Dysart.	Damian Ryan
31/08/2024	499,152 kms	Radiator - IMPORTANT R-6692 See attached jobcard Replaced fan hub.	Peter Harris
29/08/2024		MT Data R-6649 Checked power supply to cradle that was ok, Used my last new cradle on this unit. tablet Was at 6% charged when I got to the truck after the repair, I waited 30 minutes to see if that SOC was going up at a normal rate which it was at 15% when I got out of the truck.	Internal Workshop
25/08/2024	495,512 kms	A - 14000 S-4531 See attached jobcard	Liam Kitching - Misso
24/08/2024		Breakdown, MT Data R-6715 See attached jobcard H.E not showing logs and fatigue brake at 26,000 hours. Check date and time on tablet, found to be set on 24/08/21. Corrected time and date on tablet, test logs & health check with MT Data support, all ok, return unit back to work.	Damian Ryan
02/08/2024	541,617 kms	Windscreen/Mirrors - IMPORTANT R-6574 See attached jobcard	Peter Harris
16/07/2024		Turntable - Ringfeeder and Kingpin Inspection I-1356 See attached inspection report	Duane Hitch - Sourth East Mechanical
16/07/2024	475,407 kms	Turntable - IMPORTANT R-6322 See attached jobcard Carry out inspection on turntable.	Duane Hitch - Sourth East Mechanical
13/07/2024	474,438 kms	Brake Test 6 Months I-1386	Damian Ryan

Date	Reading / Units	Type / Repairer Notes	Repairer
		Complete CAP CONEQU Pre Inspection - VD68 CT14 D16 CT18 CT19	
12/07/2024	473,943 kms	Hydraulics - IMPORTANT R-6266 See attached jobcard Top up hydraulic took 40ltrs.	Duane Hitch - Sourth East Mechanical
11/07/2024		Fire Suppression Inspection I-1351 See attached inspection	Pyro Dynamics Pty Ltd
02/07/2024	473,814 kms	Exhaust R-4881 See attached jobcard No leak at flex.	Joseph Parker
02/07/2024	473,814 kms	E - 336000 S-4441 See attached jobcard	Jonathan Rafferty - Misso, Joseph Parker
01/07/2024	473,814 kms	New T-216 See attached jobcard Fit new tyres.	Genecy Dos Santos
28/06/2024	473,628 kms	Air Conditioner R-4966	Internal Workshop
28/06/2024	473,628 kms	Brakes - URGENT, Gearbox, Suspension - URGENT R-5009 Repairs carried out at RGM Mackay Gearbox and clutch replaced APU - Air dryer assembly replaced at time of Gearbox repairs	Internal Workshop
15/06/2024	403,471 kms	Brake Test 6 Months I-1322 Complete MBN 24W Brake Test - PASS VD68_CT19_D16_CT18_CT14	Gregory Fing
06/04/2024		Guardian R-5117 See attached jobcard Update guardian firmware. Load test events. Load gearbox to tablet. Called support to get open IP tables sent out. Send out new talon config. Test gearbox worked on talon.	Damian Ryan
01/04/2024	472,702 kms	A - 2 Wks S-3916 See attached jobcard Wiper blades APT heat shield cracked - will source parts & make w/o - CS QCV needs replacing Sump gasket leaking will need rubbers for bolts also - Need to order parts and change at B Service Compressor cover plate at rear leaking - need parts Main support bar behind bumper badly bend - RGM looking into parts Hyd leak at pump (pressure line) - MSAH repair @ B Service	DBE Heavy Vehicle Repairs
01/04/2024	472,702 kms	Engine R-4947 See attached jobcard Tighten hose clamp	DBE Heavy Vehicle Repairs
31/03/2024	471,908 kms 2,016 hrs	Fuel R-4983	Sione Lousi
28/03/2024		Electrical - IMPORTANT R-4858	Internal Workshop
27/03/2024		Cab R-4958 Seat belt was pushed against Bunk Bed	Ryan Rosman - TMT Mechanical
27/03/2024	470,013 kms	Brake Test MNM 3 Monthly I-1045 Complete 12W MBN Brake Test	Gregory Fing
27/03/2024	470,013 kms	Brake Test 3 Months I-1044 Complete 12W Issac Plains Brake Test	Gregory Fing
17/03/2024	463,999 kms	Air Conditioner R-4707 See attached jobcard Replaced A/C compressor due to fault. Replaced T/X valve & dryer filter. Gas A/C replaced cab filter test operation.	Christopher Solmon
14/03/2024	463,999 kms	Driveline R-4785 See attached jobcard Removed POS 4 cab assembly & resealed. Topped up oil.	Daniel Farinha - Misso's
13/03/2024	463,970 kms	A - 2 Wks S-3816 See attached jobcard	Daniel Farinha - Misso's

Date	Reading / Units	Type / Repairer Notes	Repairer
13/03/2024		Cab R-3269	Christopher Solmon
11/03/2024	463,794 kms	Exhaust R-4650 See attached jobcard Replaced NOX sensor and cleared fault	Daniel Farinha - Misso's
07/03/2024		MT Data R-2871 12.10.2023 - Email received from Aron at MT Data, see attached. Tina has emailed Kyra to request further information regarding this issue. 09/11/2023 - Kyra advised issue still happening, video sent to MT Data 29/11/2023 - Email sent to MT Data asking for an update on the investigation. 15/12/2023 - Job allocated to Todd - Ritson Auto Electrical in Emerald 06/02/2024 - Todd Rixon has advised that he is visiting Dysart on Tuesday 13th February. Refer 4618 for further comments	Nick Fenton
06/03/2024	445,421 kms	Radiator - IMPORTANT R-4651 See attached jobcard Replaced Header tank and all hoses to tank Refill with coolant	DBE Heavy Vehicle Repairs
06/03/2024	445,421 kms	Fuel R-3503 See attached jobcard Removed cap and cleaned, refitted	DBE Heavy Vehicle Repairs
04/03/2024		Guardian R-4619 Health check on guardian system test ok	
04/03/2024		MT Data R-4618 Move tablet down from the roof console to the dash. Confirmed position with the boys in the office	Global Installs
01/03/2024		MT Data R-3083 Global Installs completed Screen move and system update	Global Installs
01/03/2024	459,029 kms 1,495 hrs	A - 2 Wks S-3701 See attached jobcard	Matthew Twitchett
01/03/2024	495,029 kms 1,495 hrs	Electrical - IMPORTANT R-4519	Matthew Twitchett
01/03/2024	495,029 kms 1,495 hrs	Electrical - IMPORTANT R-4464	Matthew Twitchett
29/02/2024	384,569 kms 1,609 hrs	Chassis R-2934	Matthew Twitchett
28/02/2024	459,029 kms 1,495 hrs	Cab R-4567	Matthew Twitchett
28/02/2024	414,568 kms	Chassis R-3531 Repairs carried out on R-2934	Internal Workshop
24/02/2024	456,300 kms	New T-56	
22/02/2024	452,391 kms	Lights - IMPORTANT R-4407 See attached jobcard Inspected and found no fault 16.2.24 - 452391ks	Ryan Rosman - TMT Mechanical
21/02/2024	454,910 kms	Damage R-3839 See attached jobcard Require A-parts breakdown - recommend replace cooler line that runs in bumper as well. (Was caused from strap on vehicle recovery)	Matthew Twitchett
16/02/2024		Wipers - IMPORTANT R-4048 See attached jobcard Repairs were carried out on repair card 3506	Christopher Solmon
13/02/2024	451,591 kms	Lights - IMPORTANT R-4345 See attached jobcard Spot lights working with switch turned on (Top L/H spot light half leds out)	Sione Lousi
13/02/2024	452,336 kms	Wipers - IMPORTANT R-4455	Internal Workshop

Date	Reading / Units	Type / Repairer Notes	Repairer
13/02/2024	413,355 kms	Windscreen/Mirrors - IMPORTANT R-3506 See attached jobcard Repaired window washers hosing No cracks on windscreens found	Sione Lousi
13/02/2024	452,336 kms	Chassis R-4225 See attached jobcard Not a safety issue chain not needed	Matthew Twitchett
12/02/2024	11,620 hrs	Turntable - Ringfeeder and Kingpin Inspection I-911 See attached report	Sione Lousi
12/02/2024	452,336 kms 11,870 hrs	B - 30,000 S-3606 See attached jobcard Pos 3,4 diff is black requires synthetic oil, pos 5,6 is okay dark brown both need new oil Gearbox low 20mm low from threads, require new oil	Sione Lousi
12/02/2024	452,336 kms	Engine R-3792 See attached jobcard Removed and replaced sump plug	Duane Hitch - Sourth East Mechanical, Harry Louis
02/02/2024		Windscreen/Mirrors - IMPORTANT R-2872 See attached jobcard Crack on driver side of window	Internal Workshop
30/01/2024	29,247 kms 2,906 hrs	Windscreen/Mirrors - IMPORTANT R-3138 See attached jobcard Blew fuse for cannon, checked wing of battery end - day all ok	Robert Brackowski
28/01/2024	442,064 kms	Cab R-4068 See attached jobcard No fault found	Duane Hitch - Sourth East Mechanical
26/01/2024		Electrical - IMPORTANT R-4125 See attached jobcard All light working at time of inspection	Duane Hitch - Sourth East Mechanical
21/01/2024	440,750 kms 4,702 hrs	Wheels/Tyres - URGENT R-3530 See attached jobcard Strip and fitted new tyres	Joseph Parker
21/01/2024		Tarp - IMPORTANT R-3972 See attached jobcard Couldn't fault at time of inspection	Matthew Twitchett
21/01/2024		Damage R-3532 See attached jobcard has been repaired	Matthew Twitchett
21/01/2024		Wheels/Tyres - URGENT R-3580 See attached jobcard Have been done	Matthew Twitchett
21/01/2024	440,750 kms 4,702 hrs	A - 8 Wks S-3465 See attached jobcard	Daniel Breen - TMT
21/01/2024		Leak - IMPORTANT R-3973 See attached jobcard Could not fault at time of inspection	Matthew Twitchett
18/01/2024		Fire Suppression Inspection I-893 See attached report	Pyro Dynamics Pty Ltd
16/01/2024	437,304 kms	Brake Test Annual I-828 See attached jobcard - Isaac Plains	Gregory Fing
16/01/2024	437,304 kms	Brake Test Annual I-792 See attached report	Gregory Fing
16/01/2024		Brake Test MNM 3 Monthly I-827	Gregory Fing

Date	Reading / Units	Type / Repairer Notes	Repairer
		See attached brake report - Moranbah North	
15/01/2024		Hydraulics - IMPORTANT R-3966 See attached jobcard Inspected engagement of PTO All operational No repair required Operated multiple times - no fault present	Ryan Rosman - TMT Mechanical
11/01/2024	434,582 kms	Turntable - IMPORTANT R-3938 See attached jobcard Turntable inspected jaws & feet No work required All components within spec	Daniel Farinha - Misso's
11/01/2024		Turntable - Ringfeeder and Kingpin Inspection I-786 See attached Inspection form	Daniel Farinha - Misso's
10/01/2024		Brake Test Annual I-770 Complete CapCoal 6 monthly inspection and brake test CONEQU - PASS	Nick Fenton
10/01/2024	434,202 kms	Brake Test MNM 3 Monthly I-771 Complete Issac Plains - 12 Weekly Brake Test PASS	Nick Fenton
10/01/2024	434,202 kms	Brake Test Annual I-856 See attached report	Nick Fenton
28/12/2023		Steering - URGENT R-3339 See attached jobcard Wheel alignment carried out by Big Wheels on 20/12/2023	Big Wheels Truck Alignment
21/12/2023	425,088 kms 3,602 hrs	B - 35,000 S-3343 See attached jobcard R/H Fog light - Replaced bulb	Sione Lousi
18/12/2023		Communication System - URGENT R-3145 See attached jobcard 3145 No fault found	Internal Workshop
18/12/2023		Wheels/Tyres - URGENT R-3578 See attached jobcard 3578 Has new drive tyres fitted	Internal Workshop
04/12/2023		Tarp - IMPORTANT R-3510 See attached jobcard Inspected tipping lines, changed over lines run up & test	Ryan Rosman - TMT Mechanical
01/12/2023	412,368 kms 12,669 hrs	Damage R-3137 See attached jobcard 3137 Step replaced Front guard bolted back on	Internal Workshop
01/12/2023	412,368 kms 12,669 hrs	Damage R-2208 See attached jobcard 2208 Replaced step, bull bar needs to be pulled off and straightened and panels tightened	Internal Workshop
01/12/2023	403,640 kms 8,970 hrs	Missing, Wheels/Tyres - URGENT R-3247 See attached jobcard 3247 2 wheel chocks in dogbox	Internal Workshop
01/12/2023		Flashing Light - URGENT R-3209 See attached jobcard 3209 Replaced with a new side amber light	Internal Workshop
01/12/2023		Damage R-3196 See attached jobcard 3196 Repair already done	Internal Workshop
01/12/2023	399,907 kms	Brakes - URGENT R-3144 See attached jobcard 3144 Inspect brake on truck and trailer all inspect	Internal Workshop
01/12/2023	412,367 kms	A - 8 Wks S-3200 See attached jobcard Windscreen cracked & bulls eyes - parts in stock Left step smacked - fix replace step Bump step both sides front - W/O replace covers around lights Compressor oring or gasket leaking / sump - W/O repair oil leak at compressor Case door seal rubber - done replaced Fire Suppression - Done back in date	Daniel Farinha - Misso's

Date	Reading / Units	Type / Repairer Notes	Repairer
01/12/2023	392,098 kms	Cab R-3051 See attached jobcard 3051 Removed and repaired drivers door seal	Internal Workshop
13/11/2023	401,878 kms	B - 35,000 S-3108 See attached service jobcard 3108 Front bump stops u/s Front cab shocker u/s - Pt No A9613103555 - W/O created 3269 Front RHS window cracked - parts in stock Turntable horse slide u/s - kit turntable #SK2405-12 LHS step broken - W/O parts on order 3138 already in system LHS no plate light cover missing - replace no plate light Drivers door seal u/s - W/O parts on order 3051 already in system Drivers seat belt u/s - no fault working Diff locks not working - W/O parts on order 2934 already in system RHS amber clearance light missing - W/O parts on order 3209 already in system Washer bottle cap missing - cap fitted (Need new sump washer)	Internal Workshop
10/11/2023	403,376 kms	Brake Test Annual I-648 See attached Heavy Vehicle Brake Test Form	Gregory Fing
09/11/2023		Communication System - URGENT R-3082 See attached jobcard 3082 Clipped front back on radio	Internal Workshop
09/11/2023		Communication System - URGENT R-3071 See attached jobcard 3071 Wire not used	Internal Workshop
09/11/2023	388,852 kms	Wheels/Tyres - URGENT R-2993 See attached jobcard 2993 Checked steer tyre pressure, had wheel alignment Found turntable worn on left side of horse show, replaced and inspect adjustment	Internal Workshop
09/11/2023		Cab R-2981 See attached jobcard 2981 Could not fault at time of inspection	Internal Workshop
09/11/2023		Leak - IMPORTANT R-3195 See attached jobcard 3195 Hoses were replaced	Internal Workshop
09/11/2023		Electrical - IMPORTANT R-2929 See attached jobcard 2929 Worked correct at time of service	Internal Workshop
09/11/2023		Lights - IMPORTANT R-2874 See attached jobcard 2874 Working	Internal Workshop
09/11/2023		Cab R-2873 See attached jobcard 2873 Found seat was hard up on bunk mattress so would not retract	Internal Workshop
29/10/2023	396,450 kms	Brake Test Annual I-852 See attached report	Nick Fenton
27/10/2023	390,487 kms 3,568 hrs	Lights - IMPORTANT R-2875 See attached jobcard 2875 Blown high beam bulb H1, R\$R and check ok	Internal Workshop
27/10/2023	392,098 kms	Steering - URGENT R-3052 See attached jobcard 3052 Spoke to a second driver and no fault to report	Internal Workshop
23/10/2023	390,487 kms 3,568 hrs	A - 8 Wks S-2983 See attached jobcard Air leak at gearbox - referred to next service Fire suppression rubbing - rectified High eam blown r/h/s - repaired	Andrew Mollard
23/10/2023		Lights - IMPORTANT R-2073 See attached jobcard 2073 all jobx have been done. CS Service Repair: RH light bar u/s - repaired RH Amber clearance lamp missing - created new w/o for this item - parts were ordered 09.11.23 by CS Washer bottle cap missing - done	Joseph Celetaria
02/10/2023	377,188 kms 7,120 hrs	A - 8 Wks S-2894 A Service carried out as per service record Screw together and brace LH lower step back - fibre glass damage Lightbar faulty - Replace and repair - CHECK OK LH indicator flashing fast - Replace suzi cable CHECK OK	Internal Workshop

Date	Reading / Units	Type / Repairer Notes	Repairer
21/09/2023		Wheels/Tyres - URGENT R-2638 See attached repair job card 2638	Internal Workshop
12/09/2023	379,109 kms	Compliance R-2594 System audit confirms both are in working order	
12/09/2023	379,109 kms	Compliance R-2578 Confirmation of speed limited vehicle - VD Speed limited to 87kmph	Internal Workshop
04/09/2023	373,746 kms	A - 8 Wks S-2775 A service carried out as per service record - DH Fit new temas o0n hydraulic line Replace 2 x steer tyres	Internal Workshop
01/09/2023		Hydraulics - IMPORTANT, Leak - IMPORTANT R-2355 No repair required	Internal Workshop
01/09/2023	357,363 kms	Steering - URGENT, Wheels/Tyres - URGENT R-2227 Replaced tyres Monitor	Internal Workshop
01/09/2023		Tarp - IMPORTANT R-2173 Operational when tested	Internal Workshop
30/08/2023		Alternator R-2487 Locate truck and remoce A/C compressor Remove engine fan to get access Once mount removed replaced mount Fit A/C Compressor and new belts Fit fan back to engine Fit new alternator and air box back to truck Run up and clear all faults codes, Top up coolant	Christopher Solmon
16/08/2023		Brakes - URGENT R-2377 Fault fixed Replaced valve and repaired airleaks	Internal Workshop
11/08/2023	365,814 kms 16,222 hrs	Wheels/Tyres - URGENT R-2342 Replace drive tyres and wheel nut indicators Re torque after 50kms	Internal Workshop
10/08/2023	363,198 kms 16,222 hrs	B - 35,000 S-2631 B Service carried out as per service record - RR Chip in windscreen LH indicator fault on dash - next service diagnose and repair Fitted dot sticker Repaired aircon filter Replaced drive tyres MONITOR Hydraulic pressure fitting at PTO pump	Internal Workshop
21/07/2023	349,943 kms	A - 8 Wks S-2530 A Service carried out as per service report Chips and cracks in windscreen - Monitor condition - Inspect next service RR High beam globes blown - replaced with new globe RR RH wheel arch guard park light blown - Replaced globe RR Wiper blades worn - Replaced with new	Ryan Rosman - TMT Mechanical
15/07/2023		Other R-2116 Hooked up trailer set, checked over. Replaced plastic liner 90mm - Had to cut down to size. Replaced bulk head fitting on 1 tipping line.	Randall Kruger - ADS
08/07/2023		Flashing Light - URGENT, Tarp - IMPORTANT R-1962 Truck was brought in due to beacon light only. Some of light working. Unbolted from roof and spun so could see light from ground. New light needs to be ordered.	Internal Workshop, Ryan Rosman - TMT Mechanical
07/07/2023	345,335 kms	Hub Bearing - Urgent R-2082 Replace Pos 6 hub seal Replace front and rear diff oils Replace hub oils Replace turntable wear ring	DBE Heavy Vehicle Repairs
30/06/2023		Lights - IMPORTANT R-1896 Electrical suzi not plugged in correctly	Hugh Middleton VDPH Maintenance Coordinator
26/06/2023	337,791 kms	A - 8 Wks S-2412	Andrew Rooke - Helical Diesel, Hugh Middleton VDPH Maintenance Coordinator

Date	Reading / Units	Type / Repairer Notes	Repairer
		A Service carried out as per service report No turntable liner - Replaced A.R Leaking RH rear hub seal - Nil stock - Rebook LH headlight bulb out - New bulb fitted HM No.3 and No.4 Injector tube seals leaking - Repaired A.R Squeaking / noisy engine pulley - New idler HM	
21/06/2023	333,678 kms	Other R-1847 Topped up hydraulic oil as per drivers request	Ryan Rosman - TMT Mechanical
19/06/2023		Leak - IMPORTANT R-1893 Air loss at lead trailer when tipping control engaged. Trace and Repair burst air line and test	Hugh Middleton VDPH Maintenance Coordinator
15/06/2023		Lights - IMPORTANT R-1735 Adjusted headlight	Randall Kruger - ADS
13/06/2023		Other R-1773 Tighten RHS fuel tank strap	Duane Hitch - Sourth East Mechanical
12/06/2023		Lights - IMPORTANT R-1734 Replaced suzi plug	Hugh Middleton VDPH Maintenance Coordinator
08/06/2023	321,581 kms	Communication System - URGENT R-1482 Mine radio replaced - Signed off in Service S2339	Hugh Middleton VDPH Maintenance Coordinator
08/06/2023	321,581 kms	Communication System - URGENT R-1483 Gas cam has been replaced - Signed off in Service: S2339	Internal Workshop
08/06/2023	321,581 kms	B - 35000 S-2339 B Service carried out as per service report RH Park light - R.R RH side light fault on dash/light missing Chip/Crack forming in windscreen. - S/able less then 10mm Rear mudflaps replaced R.R HL No.4 injector oil seal nozzle weeping HM Washer bottle cap broken Drive belts squealing - Inspected belts and pulleys R.R Rear cab mount link bushes broken - Repaired R.R	Ryan Rosman - TMT Mechanical
27/05/2023	311,501 kms	A - 8 Wks S-2256 A Service carried out as per service report LH number plate light cover missing - Replaced LH and RH booster hoses leaking - New O rings fitted - HM Fuel swear at No3 injector line - S/ABLE	Internal Workshop
15/05/2023		Hydraulics - IMPORTANT, Leak - IMPORTANT R-1534 Replaced hydraulic couplings	Duane Hitch - Sourth East Mechanical
04/05/2023	293,928 kms	A - 8 Wks S-2161 A Service carried out as per service report. No# 4 Injector leaking - Part Ordered HM All drive tyres - Replaced all driven - JH Right side light missing - Replaced - JH	ATL Diesel Services - Jordan Hasenkam
20/04/2023		Brakes - URGENT, Other R-1307 Reseal injector tube Replace LH + RH VIP's couple on front boosters	Hugh Middleton VDPH Maintenance Coordinator
19/04/2023		Leak - IMPORTANT R-1308 New Seals fitted	Hugh Middleton VDPH Maintenance Coordinator
17/04/2023	285,562 kms	B - 35000 S-2033 B Service carried out as per service report Battery condition - Loose terminal and low charge - TKR Lane departure fault - RH Speaker - fault gone TKR Cylinder No.4 injector tube leak - P/P/O HM Turntable play - No play in turntable TKR Steer axle LH and RH service brake lines leaking - P/O/O HM Hydraulic fittings at rear leaking - Swapped out O-rings TKR Active indicator fault all lights working TKR Belt tensioner drivers side fault - Replaced switch HM	Internal Workshop
17/04/2023		King Pin - IMPORTANT R-1270 Tug tested and checked - No shunting in tow couplings	Internal Workshop
15/04/2023		Flashing Light - URGENT R-1296	Rob Brackowski - Callcorr

Date	Reading / Units	Type / Repairer Notes	Repairer
		Went to Volcun mine - Waited 45mins for driver, When arrived, The beacon that wasn't working is now working. Traveled back to Dysart Depo	
27/03/2023		Air Conditioner R-1140	RGM Maintenance Pty Ltd
		Cause - Partially seized TX valve - Internal mechanical failure Rmoved and replaced TX valve & O Rings, regas stysem and pressure test, Tested system - cooling ok	
27/03/2023	267,123 kms	A - 8 Wks S-1934	Randall Kruger - ADS
		A Service carried out as per service report. R/H Indicator on cab steps not working - Repaired L/H Hugh/Main beam bulb blown - Replaced	
20/03/2023	260,563 kms	Electrical - IMPORTANT R-1101	ATL Diesel Services - Jordan Hasenkam
		Clear fault code	
17/03/2023	257,077 kms	Engine R-1059	Hugh Middleton VDPH Maintenance Coordinator
		Carry out purge of system	
15/03/2023	254,905 kms	Wheels/Tyres - URGENT R-1030	Hugh Middleton VDPH Maintenance Coordinator
		Replace and balance front steer tyre	
12/03/2023	253,373 kms	B - 35000 S-1849	Randall Kruger - ADS
		B Service carried out as per Service Report Steer tyres need rotating - repaired Air leak at air dryer - Repaired Rear fanbelt tensioner bearing a little dry, still ok - Monitor	
07/03/2023	249,751 kms	Lights - IMPORTANT R-1012	Hugh Middleton VDPH Maintenance Coordinator
		Replace LH+RH Headlight bulbs	
01/03/2023	243,985 kms	Other R-988	ATL Diesel Services - Jordan Hasenkam
		inspected and cleared fault	
28/02/2023	242,287 kms	A - 6 Wks S-1801	Hugh Middleton VDPH Maintenance Coordinator
		A Service carried out as per service report	
28/01/2023		Fuel R-843	Hugh Middleton VDPH Maintenance Coordinator
		carry out ali weld repair	
28/01/2023		Hydraulics - IMPORTANT R-844	Hugh Middleton VDPH Maintenance Coordinator
		serviceable booked for new g/box	
27/01/2023	237,573 kms	A - 6 Wks S-1124	Randall Kruger - ADS
		As per Service Report	
31/12/2022		Fire Extinguisher Inspection I-497	Internal Workshop
30/12/2022	219,178 kms	A - 6 Wks S-1444	ATL Diesel Services - Jordan Hasenkam
		Tighten up PTO bolt	
28/12/2022		Communication System - URGENT R-774	Nick Fenton
		Driver had trouble logging in - was able to log in after system flush and reset	
16/12/2022	216,938 kms	A - 6 Wks S-1419	Hugh Middleton VDPH Maintenance Coordinator
		Panel loose R/H side behind drivers door Air leak from L/H steer brake line at actuator Air leak around air dryer	
29/11/2022		Air Conditioner R-697	Hugh Middleton VDPH Maintenance Coordinator
		reset parameters	

Date	Reading / Units	Type / Repairer Notes	Repairer
21/11/2022	202,548 kms	C - 12 Mnths S-1305 exhaust leak from turbo flex - New flex rer left tail light broken - new lamp fill hydo oil - top up	ATL Diesel Services - Jordan Hasenkam
12/10/2022	171,550 kms	Brake Test Annual I-383 As per brake test report - PASS	Gregory Fing
28/09/2022	159,123 kms	A - 6 Wks S-1135 REPLACE STEER TYRES - S/ABLE REPLACE DRIVE TYRES - INSPECTED STILL S/ABLE EXT FLEX FROM TURBO - REPAIRED FILL HYDRAULIC OIL *ADVISE TRACKING REQUIRE RESET AT NEXT INSPECTION*	ATL Diesel Services - Jordan Hasenkam
22/09/2022		Steering - URGENT R-525 fitted new mercury wheel balance fit	Hugh Middleton VDPH Maintenance Coordinator
23/08/2022		Other R-475 repaired lock	Hugh Middleton VDPH Maintenance Coordinator
22/08/2022	134,045 kms	A - 6 Wks S-1003 SEAT BELT TENSIONER FAULT ABS FAULT - CLEAN ABS RING DIFF SEAL LEAKING - **PART ON ORDER** DIFF OIL LOW - TOPPED UP	ATL Diesel Services - Jordan Hasenkam
22/08/2022		Fire Extinguisher Inspection I-285 DATE OF LAST SERVICE JULY 2022 AS PER SERVICE SHEET S-1003	Internal Workshop
06/08/2022	118,944 kms	A - 6 Wks S-931 NEEDS FIRE SUPPRESSION RE-CHARGED REAR DIFF PINION LEAKING- SWEAT S/ABLE DRIVER DOOR SEAL DAMAGED - S/ABLE LEFT SPOILER MIRROR COVER MISSING - S/ABLE *** SLIGHT OIL SWEAT AT REAR DIFF S/ABLE MIRROR COVER ORDERED 08/08/22 ***	Hugh Middleton VDPH Maintenance Coordinator
31/07/2022		Fire Extinguisher Inspection I-477	Internal Workshop
26/07/2022		Brake Test Annual I-349 PASS - For CapCoal	Klint Miller
20/07/2022		Other R-388 Installed FSS - 35L	Hydrafire Supplies & Services
20/07/2022		Fire Suppression Inspection I-252	Hydrafire Supplies & Services
18/07/2022		Transmission/Clutch - URGENT R-372 No fault found - Program default take off gear to 2nd gear	RGM Maintenance Pty Ltd
05/07/2022	98,716 kms	B - 60000 km S-904 AS PER SERVICE SHEET FROM RGM	RGM Maintenance Pty Ltd
29/06/2022	96,586 kms	Leak - IMPORTANT R-351	Hugh Middleton VDPH Maintenance Coordinator
14/06/2022	87,703 kms	A - 6 Wks S-813 Replaced steers	Nick Fenton
10/06/2022		Wheels/Tyres - URGENT R-274	Hugh Middleton VDPH Maintenance Coordinator
31/05/2022		Fire Extinguisher Inspection I-225 as per service sheet 14/06/2022 - S813	Internal Workshop
13/05/2022	64,165 kms	A - 6 Wks S-747 NIL defects	Hugh Middleton VDPH Maintenance Coordinator

Date	Reading / Units	Type / Repairer Notes	Repairer
28/04/2022	54,321 kms	B - 45000 km S-689 Trailer control valve main air line chaffed - replaced	Hugh Middleton VDPH Maintenance Coordinator
20/04/2022		Damage R-212	Hugh Middleton VDPH Maintenance Coordinator
15/04/2022	47,995 kms 426 hrs	A - 6 Wks S-652 5th wheel mounting foot bolts loose RH Fuel Tank loose straps LH Fuel tank loos straps Rear mud guard carrier LH & RH snapped	Hugh Middleton VDPH Maintenance Coordinator
12/04/2022		Brake Test MNM 3 Monthly I-155	Gregory Fing
30/03/2022	39,122 kms	A - 6 Wks S-623 Fire Extinguisher End Date - Service and Restamp	Hugh Middleton VDPH Maintenance Coordinator
02/03/2022	16,158 kms	A - 6 Wks S-505 RH Reflector Lamp - Replace Bulb - HM Will require new service on extinguisher - HM	Hugh Middleton VDPH Maintenance Coordinator
28/01/2022	5,362 kms	Brake Test MNM 3 Monthly I-117 PASS	Nick Fenton
26/01/2022	8,651 kms	A - 6 Wks S-340 Nil defects at inspection	Internal Workshop
31/12/2021		Fire Extinguisher Inspection I-159 As per inspection sheet 15.04.22	Internal Workshop
31/12/2021	8,651 kms	Fire Extinguisher Inspection I-132 As per Service Sheet	Internal Workshop

Signed: _____

Name: _____

Date: _____