



Vehicle History Summary



Fleet #	VD83
Registration	XB10EC
Make	Western Star
Model	4964 FXC
VIN / Chassis #	5KKJAEBGPJPJ6166
Build Date	2018

Date	Reading / Units	Type / Repairer Notes	Repairer
		E S-7911	
		E S-8102	Wayne Oakley, Zac O'Connell
		Power Steering - URGENT R-11439	
13/02/2026	401,000 kms	Guardian, MT Data R-12158 Deinstall MT data and Guardian at Emerald auctions yard	Damian Ryan
12/02/2026	401,000 kms	Air Conditioner R-11851 15/01/26 Test AC system. Could not connect gauges due to corroded service fittings. Test electrical circuit, no power to pressure switch. Test fuses and relays and found relay not engaging. Found thermostat to be faulty, bypassed and tested and found AC system works. Replace parts as supplied including thermostat, high and low pressure couplers with hose assemblies, Tx valve, receiver drier and evaporator. Pressure test, evac, regas 2100gms and performance test.	VDPH Sarina
15/12/2025	401,000 kms	Air Conditioner R-11539 Tim from Sarina diagnosed as thermostat from a/c INOP Unit going off site	Ian Taylor, Sam Bell, Timothy McFadzen Contracting
03/12/2025	401,000 kms 18,746 hrs	Brakes - URGENT R-11432 Brake adjustment	Jye Storch, Zac O'Connell
24/11/2025	401,000 kms 18,642 hrs	B - 500 S-7416 Carry out E Service as no parts to complete engine service	Lachlan Cameron, Ricky Browne
24/11/2025	401,000 kms 18,642 hrs	Turntable - Ringfeeder and Kingpin Inspection I-2579	Ricky Browne
09/11/2025	401,000 kms 18,447 hrs	A - 250 S-7924 Carry out A Service as per service sheet Oil and Oil & fuel filter change Top up P/S Fluid Remove air filters and clean, had to remove air intake assembly Top up Steer hubs Need to order new air filters non in stock Need new cabin filter Monitor king pin wear	Zac O'Connell
08/11/2025	401,000 kms 18,443 hrs	E S-7912 Check brakes Check prop Grease	Ayden Hartup, Michael Deadman
02/11/2025	401,000 kms 18,371 hrs	E S-7793 Carry out E Service Electrical horn U/S - refer repair #10244 Drivers windscreen cracked LHF shackle pins U/S - refer repair #10925	Doug Laing-Smith

Date	Reading / Units	Type / Repairer Notes	Repairer
30/10/2025	401,000 kms 18,340 hrs	Hydraulics - IMPORTANT R-11002 Repaired Hydraulic & fill hydraulic oil Tested all good The driver then drove over the remote Tune new remote to the receiver	Damien Phillips
24/10/2025	401,000 kms 18,270 hrs	New T-1118 Help Peabody with the wheels	Michael Deadman, Peabody Tyre Fitter, Zac O'Connell
24/10/2025	401,000 kms 18,270 hrs	E S-7710 Check the brakes Check the springs / air bags Check the prop Grease	Michael Deadman, Zac O'Connell
19/10/2025	401,000 kms 18,176 hrs	B - 500 S-7652 Leaf spring shackle pins & bushes, linkage rods require replacement	Wayne Oakley
17/10/2025	401,000 kms 18,166 hrs	Wheel Retorque Check T-1074 Checked all wheel nuts and torqued to OEM spec	Ian Taylor, Matthew Fransen, Wayne Oakley
14/10/2025	401,000 kms 18,157 hrs	E S-7587 Auto greaser refilled Checked for damages Check lights Check brakes & suspension	Brenton O'Sullivan, Michael Deadman
07/10/2025	401,000 kms 18,072 hrs	Breakdown, Door R-10628 Travel to Breakdown Wedge door & unlock utilising grip tape Unlock door on passenger side	Dave Pascoe
06/10/2025	401,000 kms 18,053 hrs	E S-7501 Check chassis, drivelines, steering, suspension & braking components Top up power steering res Top up POS 1 hub oil Power steering box has leak out of top seal POS 2 hub glass needs cleaned or replaced Reverse alarm weak	Sam Bell
27/09/2025	401,000 kms 17,882 hrs	E S-7377 Inspected vehicle for damage Checked suspension, brakes and drivetrain Conducted light check Inspected tyres Check wheel nut indicators	Brenton O'Sullivan, Michael Deadman, Zac O'Connell
26/09/2025	401,000 kms 17,870 hrs	Hydraulics - IMPORTANT R-10504 Top up oil	Michael Deadman, Zac O'Connell
25/09/2025	401,000 kms 17,845 hrs	Wheel Retorque Check T-970 Retorque completed	Michael Deadman, Zac O'Connell
24/09/2025	401,000 kms 17,836 hrs	Air Conditioner R-10502 Replaced missing bolt / tension	Brenton O'Sullivan
23/09/2025	401,000 kms 17,814 hrs	E S-7321 Check & grease chassis, suspension & braking component Check engine bay oil & fluids Check & grease steering & driveline components Check lights & tyres NOTES: A/C Belt seals chowed	Damien Phillips, Sam Bell
17/09/2025	401,000 kms 17,739 hrs	Breakdown R-10405 Replaced Booster @ POS 4	Damien Phillips, Ian Taylor
16/09/2025	401,000 kms 17,733 hrs	E S-7215 Conduct visual inspection Check lights Grease all points Check suspension & brakes Check for damage & leaks	Brenton O'Sullivan

Date	Reading / Units	Type / Repairer Notes	Repairer
14/09/2025	401,000 kms 17,709 hrs	E S-7189 Grease Check brakes Check spring	Brenton O'Sullivan, Michael Deadman, Zac O'Connell
13/09/2025	401,000 kms 17,696 hrs	E S-7245 Grease all points Lights check Brake check Vehicle inspections	Brenton O'Sullivan, Michael Deadman, Zac O'Connell
07/09/2025	401,000 kms	Fire Extinguisher Inspection I-2396	Pyro Dynamics Pty Ltd
07/09/2025	401,000 kms	Fire Suppression Inspection I-2430	Pyro Dynamics Pty Ltd
03/09/2025	401,000 kms 17,639 hrs	Battery - IMPORTANT R-10222 Disassemble battery box & stop Remove swollen & damaged batteries Get new batteries from front storage Fit new batteries & reassemble battery box	Ian Taylor, Sam Bell
03/09/2025	401,000 kms 17,639 hrs	C - 1000 S-7068 Grease & check chassis, suspension, drivelines, steering & braking components Adjust brakes Change oil, fuel filters, diff, gearbox & front hub oils Check 5th wheel Notes: RHS indicators not working Electric horn, not working Steering box top seal leak	Damien Phillips, Ian Taylor, Sam Bell
01/09/2025	401,000 kms 17,627 hrs	E S-7045	Josh Lewis
25/08/2025	401,000 kms 17,525 hrs	E S-6939 Perform E Service No faults	Damien Phillips
18/08/2025	401,000 kms 17,506 hrs	E S-6895	Michael Deadman
15/08/2025	401,000 kms 17,461 hrs	E S-6840	Jonathon Sakkas, Michael Deadman, Sam Bell
13/08/2025	401,000 kms	Peabody Inspection - Part A / B - Medium Vehicle I-2308	Peabody Personnel
12/08/2025	401,000 kms 17,430 hrs	E S-6792	Ian Taylor, Oliver Sutton
04/08/2025	401,000 kms 17,395 hrs	Power Steering - URGENT R-9927 Repaired oil leak	Michael Deadman
04/08/2025	401,000 kms 17,395 hrs	E S-6713 Small leak from the power steering box - the seal on top of it - Repaired oil leak	Michael Deadman, Sam Bell
30/07/2025	401,000 kms 17,366 hrs	E S-6640	Sam Bell
26/07/2025	401,000 kms 16,800 hrs	E S-6337 Remove & replace seized e-stop Checked for defects Greased	Rylee Jakupovic
25/07/2025	401,000 kms 17,335 hrs	A - 250 S-6590 LH outer bonnet indicator NW R/H outer & front bonnet indicators NW - fixed bonnet light indicators need replacing L/H outer rear marker light NW - fixed Steering box oil leak out input seal Replaced engine oil & filter Checked over for defects	Ian Taylor
25/07/2025	401,000 kms	Bonnet R-9805	Ian Taylor

Date	Reading / Units	Type / Repairer Notes	Repairer
		L/H outer bonnet indicator - NW R/H outer & front bonnet indicators - NW (fixed bonnet light) - Indicators need replacing L/H outer rear marker light - NW - fixed Steeing box oi leak out input seal	
24/07/2025	401,000 kms 1,739 hrs	Grease R-9810 Auto greaser not greasing enough regular - fixed Fixed broken wire on auto greaser plug - tested	Ian Taylor
24/07/2025	401,000 kms 1,739 hrs	E S-6595 Auto greaser not greasing enough regular - fixed Checked over for defects Fixed broken wire on auto greaser plug - tested	Ian Taylor
22/07/2025	401,000 kms 17,323 hrs	E S-6548 Steering box leaking - Repair #9758	Sam Bell
20/07/2025	401,000 kms 17,297 hrs	E S-6504 Grease all grease points All tyres ok at time of inspection	Michael Deadman
18/07/2025	401,000 kms 17,258 hrs	E S-6479 Steering box top seal leaking - monitor	Sam Bell
13/07/2025	401,000 kms 17,210 hrs	E S-6434 Observe auto greaser slow to dispense??	Ian Taylor
01/07/2025	401,000 kms	Cab, MT Data R-9071	Internal Workshop
01/07/2025	401,000 kms	Steering - URGENT R-9758 Minor weep monitor levels. next major SVC replace steering box ok for now	
01/07/2025	401,000 kms	MT Data R-8126 Charging and operational - awaiting replacement sim card	Huntter Cannell, Internal Workshop
01/07/2025	401,000 kms	MT Data R-9225	Internal Workshop
26/06/2025	401,000 kms	MT Data R-9197 Duplicate - refer R8126	
21/06/2025	401,000 kms 1,730 hrs	E S-6405 E Service completed Tema fittings leaking hose side	Tom phillips
18/06/2025	401,000 kms 17,100 hrs	E S-6177	Tom phillips
16/06/2025	401,000 kms 17,098 hrs	E S-6152 Adjusted all brakes	Aaron McCully
14/06/2025	401,000 kms 17,089 hrs	B - 500 S-6125 Couldn't inspect turntable as trailers loaded	Aaron McCully, Clay Walker
10/06/2025	401,000 kms 17,045 hrs	E S-6286 Inner low beam on both LH & RH headlights not working TEMA fittings weeping Powersteering box weeping from steering input	Jordan Eagleson, Tom phillips
07/06/2025	401,000 kms 16,990 hrs	Lights - IMPORTANT R-9265	Jye Storch

Date	Reading / Units	Type / Repairer Notes	Repairer
		No faults found at time of inspection.	
07/06/2025	401,000 kms 17,020 hrs	Breakdown R-9558	Jordan Eagleson
		Replaced water hose that joins from 1st and 2nd tank	
07/06/2025	401,000 kms 16,990 hrs	Breakdown, Lights - IMPORTANT R-9557	Tom phillips
		Removed outter RH headlight Fitted new headlight & wired in Took out & modified Headlight bracket housing - refitted & tested - ok	
07/06/2025	401,000 kms 16,990 hrs	Breakdown, Windscreen/Mirrors - IMPORTANT R-9556	Jordan Eagleson
		Pulled drivers door apart to access window regulator Removed and replaced with new Tested function and put back together	
07/06/2025	401,000 kms 16,990 hrs	E S-6303	Jordan Eagleson, Tom phillips
		Tema fitting leaking - repaired Low beam on RH headlights not working	
06/06/2025	401,000 kms 1,697 hrs	Breakdown, Lights - IMPORTANT R-9555	Tom phillips
		RH headlight has no low beam - tested wiring - has no power. Lights need replacing Removed LH drive mudguard bracket to be repaired Refitted LH drive mudguard bracket to truck.	
05/06/2025	401,000 kms 16,968 hrs	E S-6307	Jordan Eagleson, Tom phillips
01/06/2025	401,000 kms	Breakdown, Electrical - IMPORTANT R-9490	Rylee Jakupovic
		Remove and replace as per required	
25/05/2025	401,000 kms 16,897 hrs	E S-6322	Jordan Eagleson, Tom phillips
20/05/2025	401,000 kms 16,817 hrs	E S-6024	Clay Walker
		Replace Air Tank drain	
18/05/2025	401,000 kms 16,781 hrs	PTO R-9067	Internal Workshop
		no repair required	
18/05/2025	401,000 kms 16,781 hrs	A - 250 S-5992	Clay Walker
13/05/2025	401,000 kms 16,737 hrs	E S-5976	Jordan Eagleson
		E Service	
13/05/2025	401,000 kms 16,737 hrs	Turntable - Ringfeeder and Kingpin Inspection I-2092	Jordan Eagleson
06/05/2025	401,000 kms 16,631 hrs	E S-5982	Clay Walker
		visual inspection and grease	
01/05/2025	401,000 kms 16,561 hrs	E S-5887	
30/04/2025	401,000 kms 16,561 hrs	bushes R-8530	Internal Workshop
		inspected at 16561hrs all ok, replaced at Dysart	

Date	Reading / Units	Type / Repairer Notes	Repairer
24/04/2025	489,151 kms 16,532 hrs	Turntable - IMPORTANT R-8713 JOB COMPLETED	Internal Workshop
24/04/2025	489,151 kms 16,532 hrs	Brakes - URGENT R-8796 REPLACE POS 5 AND 6 BRAKES, S-CAMS, SHOES, WHEEL BEARINGS AS REQUIRED ADJUST BRAKES ROAD TEST ALL OK	Internal Workshop
24/04/2025	489,151 kms 16,532 hrs	MT Data, Windscreen/Mirrors - IMPORTANT R-8284 WINDSCREEN IS OK CHIP NOT IN DRIVERS LINE OF SIGHT	
24/04/2025	1,282,551 kms 16,532 hrs	Lights - IMPORTANT R-8411 WORKING WHEN TESTED	Internal Workshop
24/04/2025	489,151 kms 16,532 hrs	Fire Extinguisher R-8124 NOT A FAULT ON THE PRIME MOVER	Internal Workshop
24/04/2025	489,151 kms 16,532 hrs	Isolation Switch R-8101 REPLACE ISOLATOR BOX, REPLACE ISOLATORS AND REPAIR CABLES AS REQUIRED	Internal Workshop
24/04/2025	489,151 kms 16,532 hrs	Wheels/Tyres - URGENT R-8422 WHEEL CHOCKS FITTED TO HOLDERS	Internal Workshop
24/04/2025	489,151 kms 16,532 hrs	Drawbar, Windscreen/Mirrors - IMPORTANT R-8052 WINDSCREEN CHIP IS NOT IN THE VEIW OF THE DRIVER AND IS OK TO RUN	Internal Workshop
24/04/2025	489,151 kms 16,532 hrs	MT Data, Warning Lights R-8613 REPAIR ABS SENSOR WIRING, CLEAR FAULTS ROAD TEST ALL OK	Internal Workshop
24/04/2025	489,151 kms 16,532 hrs	Windscreen/Mirrors - IMPORTANT R-8618 REPLACE WIPER ARMS AS REQUIRED TEST OPERATION ALL OK	Internal Workshop
24/04/2025	489,151 kms 16,532 hrs	Fire Extinguisher, Leak - IMPORTANT R-7951 REPAIR LEAKS UNDER DASH AS REQUIRED RUN AND TEST FOR AIR LEAKS REPLACE AIR DRYER ASSEM	Internal
24/04/2025	489,151 kms 16,532 hrs	Wheels/Tyres - URGENT R-7901 INSPECT TYRES OK TO RUN	Internal Workshop
24/04/2025	489,151 kms 16,532 hrs	Flashing Light - URGENT R-7825 BEACONS WORKING WHEN TESTED	Internal Workshop
24/04/2025	489,151 kms 16,532 hrs	Turntable - IMPORTANT R-8630 REPLACE TURN TABLE FOOT BUSHS GREASE TURN TABLE AND CHECK OPERATION ALL OK	Internal Workshop
23/04/2025	489,151 kms 16,532 hrs	Fire Extinguisher, MT Data R-8159 MT Data charging and operational - yet cannot comment due to faulty sim cardd - to be changed on site Mine radio speaker wiring - repaired.	Huntter Cannell
23/04/2025	401,000 kms	First Aid Kit I-2075	Aloma Ferreri

Date	Reading / Units	Type / Repairer Notes	Repairer
11/04/2025	401,000 kms 87,989 hrs	MT Data R-8233	Internal Workshop
07/03/2025	401,000 kms	E S-5699	Jordan Eagleson, Tom phillips
05/03/2025	401,000 kms 16,153 hrs	E - 336000 S-5688 Missing First Aid Kit Inspected Fault.	
28/02/2025	401,000 kms 16,167 hrs	Hydraulics - IMPORTANT R-8320 top up oil 80 Litres	Internal Workshop
23/02/2025	401,000 kms	Oil Sample Results R-8523	Hastings Deering CAT
21/02/2025	401,000 kms 16,100 hrs	B - 28000 S-5705	
20/02/2025	401,000 kms 30,158 hrs	Radiator - IMPORTANT R-8204 blown boost hose . inspect found blown, replaced as required	Internal Workshop
20/02/2025	417,060 kms	Fault R-8180 Inspect starting. Found started isolator switch was bypassed last night. Cable melted on back of isolation switch.	Internal Workshop
19/02/2025	401,000 kms 16,047 hrs	Grease R-8183 Inspect grease system, found not getting power to grease pump behind cab grease controller in cab has now power. Faulty grease controller. Replaced timer relay (TIM05) instead of buying new controller	Internal Workshop
19/02/2025	401,000 kms 16,046 hrs	Grease Lines R-8591 Removed pos 3 drive wheels. Removed booster and inspect speed s - adjuster on scan. Removed and crimped auto greaser lines. Caged booster as per supervisor instructions Removed brake shoes, refit drum and wheels. Torque wheel nuts	Internal Workshop
19/02/2025	401,000 kms 16,047 hrs	E - 336000 S-5670 no pto alarm isolator box damaged rear engine mounts slightly worn trailer fittings trusted No service sticker fitted	Robert Brackowski
17/02/2025	401,000 kms	Hydraulics - IMPORTANT R-8210 Refit hydraulic line fill with oil	Internal Workshop
17/02/2025	401,000 kms 16,025 hrs	Hydraulics - IMPORTANT R-8198 Remove blown hose awaiting and hose to be made	Internal Workshop
12/02/2025	401,000 kms 15,976 hrs	Peabody Inspection - Part A / B - Light Vehicle I-1881 Complete Brake test for combination VD83 UNIT31 D38 UNIT32	Robert Brackowski
04/02/2025	401,000 kms	Lights - IMPORTANT R-8099 repaired	Internal Workshop
03/02/2025	401,000 kms	RADIO R-8702 refit old radio check over beacons and found RH beacon faulty	Internal Workshop
31/01/2025	401,000 kms	Lights - IMPORTANT R-8098 Found broken wire- Repaired	Internal Workshop
31/01/2025	401,000 kms 15,940 hrs	Breakdown R-8036	

Date	Reading / Units	Type / Repairer Notes	Repairer
21/01/2025	401,000 kms 15,760 hrs	A - 14000 S-5518	
21/01/2025	401,000 kms	Breakdown R-8035 located faulty beacons, replaced and tested all ok	VDPH
18/01/2025	401,000 kms	Fire Suppression - IMPORTANT R-7808 Fixed issue and tested all other wiring & tested pressure switches, both switches tested good with full resistance & all other wiring good as well with no other faults. Checked panel as well & all working correctly.	Pyro Dynamics Pty Ltd
16/01/2025	401,000 kms	Oil Sample Results R-8357	Hastings Deering CAT
12/01/2025	401,000 kms	Lights - IMPORTANT R-8059	Internal Workshop
05/01/2025	401,000 kms	Hydraulics - IMPORTANT R-7962 test all OK	Internal Workshop
04/01/2025	401,000 kms	E - 336000 S-5616	VDPH
12/12/2024	489,151 kms 16,532 hrs	B - 500 S-5576 COMPLETE SERVICE AND CHECK OVER COMPLETE ALL OPEN DEFECTS AS REQUIRED	Internal Workshop
28/11/2024	401,000 kms 17,433 hrs	Chassis R-7596 Remove bull bar & fit bumper	Lachlan McFadzen
27/11/2024	467,489 kms 15,384 hrs	Cab R-7241 New steering wheel fitted Need to order new steering wheel Will not compromise safety in the meantime	Huntter Cannell
27/11/2024	467,489 kms 15,384 hrs	B - 28000 S-5422 changed diff oils due to front diff reseal	Huntter Cannell
27/11/2024	401,000 kms 15,384 hrs	Chassis R-7330 Bracket rewelded	Huntter Cannell
27/11/2024	401,000 kms	Lights - IMPORTANT R-7404 Repaired lights	Chris Baker
27/11/2024	401,000 kms 15,384 hrs	Other R-7619 Full check over Swap out rear tyres axle 2, 3 RHS LHS Remove replace bull bar Replace all rear B Boosters axle 2,3 RHS LHS Replace trailer air fittings Replace coolant pipe o rings, gasket Full diff with 460 Replace turbo gasket, return pipe gasket Fit rear rim, torque of at 500 foot pounds Replace walk way clamp Replace B Booster hoses Remove, replace transverse rod bushes Remove Replace grease system pack, test Repair ad blue tank bkt	Frank Hale - All Crane & Heavy Vehicle Repairs, Huntter Cannell
25/11/2024	467,489 kms 15,384 hrs	Cab, Suspension - URGENT R-7421 Replaced cab airbag	Huntter Cannell
25/11/2024	467,489 kms 15,384 hrs	Driveline R-7543 Removed diff centre, reseal refill oil replace axle seals	Huntter Cannell
21/11/2024	467,489 kms 15,384 hrs	Other R-7286 job closed by Mark Matchett	Internal Workshop
10/11/2024	401,000 kms	Chassis R-7403	Matthew Twitchett

Date	Reading / Units	Type / Repairer Notes	Repairer
		Removed torsion bar & replaced both bushes	
10/11/2024	401,000 kms	Suspension - URGENT R-7420 Replaced POS 1 air bag	Duane Hitch - Sourth East Mechanical
09/11/2024	464,485 kms	Cab R-7329 Re inserted seal properly May have been disturbed whilst cleaning	Matthew Twitchett
09/11/2024	464,985 kms 15,309 hrs	Electrical - IMPORTANT R-6868 Trailer brake release button is working & will take a brief moment to build up Thats what it does through a 3/8" air line 35m long Try using hand piece for loading	Matthew Twitchett
09/11/2024	464,485 kms	Other R-7240 Could not fault at time of inspection Tank is nearly full & gage reading nearly full	Matthew Twitchett
20/10/2024	460,219 kms	Communication System - URGENT R-7184 Fit tait radio and Cas cam	Daniel Farinha - Misso's
19/10/2024	401,000 kms	Brake Test 6 Months I-1633 Complete CapCoal Compliance - VD83 ST22 D14 ST23 ST24	Damian Ryan
17/10/2024	459,534 kms	C - 56000 S-5163 Front diff oil not changed at service diff leaking	Daniel Sperling
16/10/2024	459,904 kms	WINDSCREEN WASHER / WIPER - IMPORTANT R-6869 Cleared out washer jet.	Harry Louis
16/10/2024	459,904 kms	Cab R-6870 No problem with lock button at time of testing	Daniel Sperling
13/10/2024	401,000 kms	Fire Extinguisher Inspection I-1603 See attached inspection	Pyro Dynamics Pty Ltd
13/10/2024	401,000 kms	Fire Suppression Inspection I-1604 See attached inspection	Pyro Dynamics Pty Ltd
08/10/2024	458,577 kms 15,152 hrs	Electrical - IMPORTANT R-7072 See attached jobcard Replace ignition key barrel with CAT one. New barrel doesn't have "acc" position, adjust wiring to suit. Look into "wheel slip" light on dash for driver, switched switch back to off position, light goes out.	Timothy McFadzen Contracting
30/09/2024	401,000 kms	Communication System - URGENT R-7027 Replace UHF Handpiece Replace glass fuse holder with blade fuse (VHF) Re-join dodgy joined wires that power VHF.	Timothy McFadzen Contracting
16/09/2024	401,000 kms	Communication System - URGENT R-7253 Get UHF working, replace mic	Timothy McFadzen Contracting
16/09/2024	449,977 kms	New T-338 See attached jobcard Replace all with new.	Duane Hitch - Sourth East Mechanical
15/09/2024	445,977 kms	A - 14000 S-4913 See attached jobcard	Duane Hitch - Sourth East Mechanical
15/09/2024	449,770 kms	Transmission/Clutch - URGENT R-6747 See attached jobcard Adjust clutch.	Duane Hitch - Sourth East Mechanical
15/09/2024	449,770 kms	Communication System - URGENT R-6748 See attached jobcard Working fine when checked, has 12V power all the time and good carty.	Duane Hitch - Sourth East Mechanical
26/08/2024	439,857 kms	Cab R-6635 See attached jobcard Replace driver side seat belt.	Duane Hitch - Sourth East Mechanical

Date	Reading / Units	Type / Repairer Notes	Repairer
16/08/2024	437,092 kms 14,579 hrs	Engine R-6564 See attached jobcard Inspect d-rate faults & test components after diagnosis. Order correct sensor & install & test, all ok.	Matthew Twitchett
11/08/2024	401,000 kms	Breakdown R-6634 See attached jobcard Filt exhaust, lagging for SWC compliance.	Damian Ryan
09/08/2024	401,000 kms	Brake Test 6 Months I-1493 See attached jobcard	Damian Ryan
09/08/2024	436,966 kms	Brake Test 6 Months I-1492 See attached jobcard	Damian Ryan
29/07/2024	401,000 kms	Wheels/Tyres - URGENT R-6401 Fitted new wheel chocks in cradle	Ryan Rosman - TMT Mechanical
29/07/2024	435,302 kms	Breakdown, Guardian R-6502 See attached jobcard Travel from Dysart to Vulcan. Plug in guardian fault to have no GPS signal, replace GPS aerial and carry out test events all ok. Travel back to Dysart.	Damian Ryan
21/07/2024	434,152 kms	B - 28000 S-4541 See attached jobcard	Daniel Farinha - Misso's
29/06/2024	424,764 kms	Turntable - IMPORTANT R-5001 Turntable not required Inspected and found to be in working order, no action required	Ryan Rosman - TMT Mechanical
26/06/2024	426,662 kms	Cab R-6159 See attached jobcard Slight movement in telescopic bracket will require new seat to repair correctly.	DBE Heavy Vehicle Repairs
26/06/2024	401,000 kms 25,662 hrs	Electrical - IMPORTANT, Fuel R-5874 See attached jobcard No fault found.	DBE Heavy Vehicle Repairs
26/06/2024	25,662 hrs	Leak - IMPORTANT R-4996 See attached jobcard Replaced input seal and dust cover and top up power steer fluid ATF.	DBE Heavy Vehicle Repairs
26/06/2024	426,662 kms	Electrical - IMPORTANT R-6162 See attached jobcard Replace e-stop.	DBE Heavy Vehicle Repairs
20/06/2024	424,294 kms	A - 14000 S-4299 See attached jobcard	Daniel Farinha - Misso's
20/06/2024	23,294 kms	Leak - IMPORTANT R-4998 See attached jobcard Diverter valve replaced on previous service.	Daniel Farinha - Misso's
11/06/2024	419,047 kms	Gearbox, PTO R-6024 See attached jobcard Inspected filter for metal in Gearbox	Daniel Farinha - Misso's, Duane Hitch - Sourth East Mechanical
06/06/2024	415,243 kms	Radiator - IMPORTANT R-5979 See attached jobcard Cut end off heater hose on heater box and fit with new hose clamp.	Duane Hitch - Sourth East Mechanical
04/06/2024	413,834 kms	Exhaust R-5923 Replace 5 inch exhaust flex and 5 inch clamp	DBE Heavy Vehicle Repairs
30/05/2024	811,318 kms	Air Conditioner R-5873 See attached jobcard Clean up water on floor, check A/C cab filters, repair drain hose.	Duane Hitch - Sourth East Mechanical
24/05/2024	808,023 kms	Brake Test 3 Months I-1225 Complete IP 12W brake test - PASS	Damian Ryan

Date	Reading / Units	Type / Repairer Notes	Repairer
23/05/2024	401,000 kms 6,030 hrs	Body R-5747 See attached jobcard Retro fit mudguards to prime mover.	Jonathan Rafferty - Misso, Troy Francken
21/05/2024	401,000 kms 6,080 hrs	Suspension - URGENT R-5746 See attached jobcard Replaced 4 hanger, 4 spring eyes bushes, bolts & tightened all up.	Jonathan Rafferty - Misso
30/04/2024		Air Conditioner R-5322 See attached jobcard Filters were replaced.	Christopher Solmon
28/04/2024	407,021 kms	C - 300,000 S-4045 See attached jobcard	Duane Hitch - Sourth East Mechanical
28/04/2024	6,021 kms	Diff R-4997 See attached jobcard Not leaking.	Duane Hitch - Sourth East Mechanical
24/04/2024	401,000 kms	Breakdown R-5452 See attached jobcard Fit new sat iridium/gps ariel. Test to make sure unit had stable gps sat.	Damian Ryan
20/04/2024		Compliance, Electrical - IMPORTANT R-4904 See attached jobcard Replaced puk. Spoke with support. Couldn't fault any sats float or any low sat counts. Monitor to see if it gets better if not we might have to send tracking unit away to get it checked.	Damian Ryan
20/04/2024	3,093 kms 13,804 hrs	HORN R-5275 See attached jobcard As per Jobcard Door switch signal wire to Interior light disconnected due to potential rubbed wiring Tested operation, All ok to operate	Daniel Breen - TMT
17/04/2024	2,675 kms 13,790 hrs	Cab R-5213 See attached jobcard Pull apart door card. Test power from switch to fuse holder (no power). Pul apart dash & found window PS unplugged. Re assemble.	Daniel Breen - TMT
17/04/2024	2,675 kms 13,790 hrs	Compliance R-5224 See attached jobcard Vehicle was missing turbo blanket and drain pipe sheath - repaired. Anderson plug for jump starting was hardwired to battery. Removed Anderson plug was corroded as well.	Daniel Breen - TMT
17/04/2024	13,791 hrs	Conneq Pre Inspection I-1082 Complete CapCoal CONEQU Inspection and Brake Test	Nick Fenton
16/04/2024	404,504 kms	Chassis R-5214 See attached jobcard Tested & greased tarp, could not fault. Complaint of bearings not spinning but all are working. A/C repaired on repair card. 4151	Christopher Solmon
16/04/2024	401,000 kms	Fire Extinguisher Inspection I-1199 See attached report Replaced 1 x missing nozzle cap with new Replaced lop tubing and o rings on system as mandatory replacement	Pyro Dynamics Pty Ltd
16/04/2024	404,504 kms	Air Conditioner R-4151 See attached jobcard Removed & replaced A/C compressor Removed evaporator from cab & replaced T/X valve after full flush. Replaced all supplied A/C lines. Flush all system & replaced drier. Vac down & gas system, test operation, A/C got down to 7 at vent.	Christopher Solmon
12/04/2024	401,830 kms 13,353 hrs	Cab R-4999 See attached jobcard Replace rear leaking cab shocks. Trim down spacers to suit.	Todd Gunning - Optimal Diesel Support
12/04/2024	401,830 kms 13,353 hrs	Suspension - URGENT R-3831 See attached jobcard Replaced front & rear pins & bushes - welded in bushes.	Matthew Twitchett

Date	Reading / Units	Type / Repairer Notes	Repairer
11/04/2024	401,830 kms 13,353 hrs	Cab R-5000 See attached jobcard Replaced speedo and added correct sticker.	Matthew Twitchett
11/04/2024	401,830 kms 13,353 hrs	A - 15,000 S-3964 See attached jobcard	Matthew Twitchett
06/04/2024		Guardian R-5122 See attached jobcard Update firmware on guardian. Load gearbox to tablet. Spoke with support to get open IP tables send out. Sent out a new talon config. Test gearbox worked on talon. Spoke with support about drivers complaints about our speeds, we had a look at fair bit of history, couldn't find out our speeds but speeds were all over the place, recommend fitting a new GPS puk when I get my ute up here with stock.	Damian Ryan
05/04/2024	395,763 kms	Brakes - URGENT, Engine, Suspension - URGENT R-5056 See attached jobcard Unloader Valve was replaced and the fitting from the governor Water was all throughout the signal line preventing proper blow off Air dryer filter requires replacement next service	Jonathan Rafferty - Misso
05/04/2024	395,763 kms	Suspension - URGENT R-5068 See attached jobcard Replaced Airbag with new component Replaced Pos 4 Airbag due to being split	Jonathan Rafferty - Misso
31/03/2024	13,237 kms	Turntable - Ringfeeder and Kingpin Inspection I-1061 See attached report	Matthew Twitchett
31/03/2024	396,241 kms 13,237 hrs	Turntable - IMPORTANT R-4988 See attached jobcard Removed turntable, inspected jaws & slide mechanism. Replaced pedestal bushes, install turntable. Hook up & check for movement on tug test, all ok.	Matthew Twitchett
30/03/2024	396,241 kms 13,237 hrs	A - 2 Wks S-3904 See attached jobcard	Matthew Twitchett
30/03/2024	396,241 kms 13,237 hrs	B - 30,000 S-3905 See attached jobcard Steering box input seal leaking - R4996 Front Diff housing needs re-seal - R4997 Hydraulic flow divider has leaking seals - recommend replace L/H front air bag torque arm eye bolt loose & R/H rear - checked & tightened Trans filter hose weeping from Jic fitting - repair on C Service Numerous grease line leaks - installed joiners Clutch fluid level very low - topped up Cab shocks U/S - too soft - R4999 Speedo keeps losing kms - R5000 Recommend replacing turntable assembly to jost - R5001	Matthew Twitchett
26/03/2024	400,002 kms	Lights - IMPORTANT R-4906 See attached jobcard Repair wiring on RHS bonnet blinker (Will need new DEM light harness for light)	Duane Hitch - Sourth East Mechanical
21/03/2024	396,645 kms	New T-77 See attached jobcard Replaced Axle with 4 new tyres	Jonathan Rafferty - Misso
15/03/2024	394,150 kms 13,435 hrs	Lights - IMPORTANT R-4594 See attached jobcard Replaced globe.	Daniel Farinha - Misso's
14/03/2024	394,150 kms 13,435 hrs	Body, Chassis R-4184 See attached jobcard Replaced with new mud guard, replaced 1x bar bracket, new bolts.	Joseph Parker
14/03/2024	394,157 kms 13,436 hrs	Engine R-4183 See attached jobcard Tightened engine mount bolts	Daniel Farinha - Misso's
14/03/2024	394,150 kms 13,435 hrs	Fire Suppression - IMPORTANT R-4537 See attached jobcard Reset on dash.	Daniel Farinha - Misso's

Date	Reading / Units	Type / Repairer Notes	Repairer
14/03/2024	394,151 kms 13,436 hrs	Engine R-4221 See attached jobcard Replaced air dryer kit and filter	Daniel Farinha - Misso's
14/03/2024	394,150 kms 13,435 hrs	Lights - IMPORTANT R-4521 See attached jobcard	Daniel Farinha - Misso's
14/03/2024	394,150 kms 13,435 hrs	New T-69 See attached jobcard Fitted super single steer tyres	Daniel Farinha - Misso's
14/03/2024	394,150 kms	Leak - IMPORTANT R-2479 See attached jobcard Inspected leak and can not fault at time of inspection. Coolant levels good & no wet patch.	Christopher Solmon
14/03/2024	394,150 kms	Leak - IMPORTANT, Steering - URGENT R-3159 See attached jobcard Can not fault at time of inspection, box has weeping signs but oil levels good & no wet marks.	Christopher Solmon
14/03/2024	394,150 kms 13,435 hrs	A - 2 Wks S-3711 See attached jobcard	Daniel Farinha - Misso's
14/03/2024	394,157 kms	Cab R-4185 See attached jobcard Not worn just replaced mounting bolts	Daniel Farinha - Misso's
07/03/2024	388,890 kms	Retighten Wheels, Run Out T-62 See attached jobcard Steer tyres removed from JVS06 have been fitted to this unit	Daniel Farinha - Misso's
07/03/2024		MT Data R-3590 Refer 4614 for further comments	Nick Fenton
04/03/2024		MT Data R-4614 Carried out system check on Mtdata all ok.	Global Installs
04/03/2024		Guardian R-4615 Fitted new ffc as the original one had been cut off and was no where to be found in the truck. Went back into the wizard and turned ffc back on. Carried out a manual recording to make sure unit was reporting and both camera feeds were working	Global Installs
28/02/2024	382,647 kms	Brake Test 3 Months I-969 See attached Brake Test - 3 Monthly	Gregory Fing
28/02/2024	382,647 kms	Brake Test MNM 3 Monthly I-974 Carried out Issac Plains 12W Brake Test - PASS	Nick Fenton
23/02/2024	380,367 kms 13,112 hrs	Hydraulics - IMPORTANT R-4506 See attached jobcard Topped up oil	Jonathan Rafferty - Misso
23/02/2024	380,441 kms 13,114 hrs	Electrical - IMPORTANT R-4514 See attached jobcard All e-stops working. Found 4 volts @ starter. Played with wiring and found 12 volts finally @ starter. Everything tight at the time. Possible lugs damaged	Jonathan Rafferty - Misso
21/02/2024	378,591 kms 13,074 hrs	Electrical - IMPORTANT R-4492 See attached jobcard Replace Estop button on cab	Daniel Farinha - Misso's
17/02/2024	376,167 kms 13,022 hrs	Missing R-3160 See attached jobcard Fit missing tow pin	Duane Hitch - Sourth East Mechanical

Date	Reading / Units	Type / Repairer Notes	Repairer
11/02/2024	374,135 kms 12,964 hrs	B - 30,000 S-3596 See attached jobcard	DBE Heavy Vehicle Repairs, Sione Lousi
11/02/2024	374,135 kms 12,964 hrs	Cab R-4238 Inspected at time of service, no fault found	Internal Workshop
11/02/2024		Suspension - URGENT R-4222 Repair job card is a duplicate Please refer to R-3831 as the original for this repair	Ryan Rosman - TMT Mechanical
11/02/2024	374,135 kms 12,964 hrs	Cab R-4182 Brake Pedal rubber replaced at time of B Service	Internal Workshop
11/02/2024		Turntable - Ringfeeder and Kingpin Inspection I-901 See attached jobcard	Duane Hitch - Sourth East Mechanical
09/02/2024	372,704 kms	New, Retighten Wheels T-39 See attached jobcard Replaced Pos 5 & 6 Drive tyres with new Carried out Re-torque	Daniel Breen - TMT
09/02/2024	372,704 kms	Wheels/Tyres - URGENT R-4333 See attached jobcard Replaced Pos 5 & 6 Tyres Pos 6 inner was punctured and flat Other tyres were worn unevenly	Daniel Breen - TMT
07/02/2024		Wheels/Tyres - URGENT R-4044	Internal Workshop
05/02/2024		Leak - IMPORTANT R-2174	Internal Workshop
01/02/2024		Windscreen/Mirrors - IMPORTANT R-2221 See attached jobcard Ardik has replaced gass 1.2.24	Internal Workshop
01/02/2024		Leak - IMPORTANT, Windscreen/Mirrors - IMPORTANT R-3703 Windscreen replaced by Ardik glass Dysart on 1.2.24	Ardik Glass
31/01/2024		Communication System - URGENT R-3054 29/11/2023 - MT Data sent "Restart Talon" & "Flush & Reset" command to the tablet. Email sent to supervisors to check if the issue persists. 25/01/2024 - Email received from Dan Thatcher to advise that the unit is working fine. 31/01/2024 - Email sent to MT Data Support to close ticket.	Tina O'Hare
26/01/2024		WINDSCREEN WASHER / WIPER - IMPORTANT R-3968 See attached jobcard Clean and works and replaced wiper blade	Daniel Farinha - Misso's
26/01/2024		Cab R-3461 See attached jobcard Attend to indicator left on dash not working. plug loose at the back, replug and check ok Attend to fuel gauge not working properly, fuel gauge faulty, advise supervisor of finding	Internal Workshop
26/01/2024	362,980 kms	A - 8 Wks S-3491 See attached jobcard Change fuel gauge Change Carbon filters Both windscreens chips - R3703 Brake pedal rubber in cab worn - R4182 Pollen filters RDPPF387770 x 2 - Replaced at time of service Front engine mount worn - R4183 Coolant cross over pipe oring - R2479 POS 4 mudguard worn - R4184 Drivers & passenger door visors - R4185	Daniel Farinha - Misso's
22/01/2024	359,494 kms	Brake Test Annual I-804 Complete Vulcan Compliance inspection and break test - PASS	
03/01/2024	343,787 kms	Alternator, Battery - IMPORTANT R-3797 See attached jobcard Batteries needs to be replaced shells acid in battery Clean terminals and inspect charge rate 14.1v Suspected Volt drop from cables	Joseph Celetaria
03/01/2024	343,554 kms	Windscreen/Mirrors - IMPORTANT R-2953 See attached jobcard Fixed windscreen washers - both sides	Tim Brogden - JSF
03/01/2024	343,554 kms 12,270 hrs	B - 35,000 S-3363	Tim Brogden - JSF

Date	Reading / Units	Type / Repairer Notes	Repairer
		See attached jobcard No turbo cover Top left HS Clearance faulty - R & R light and check ok Pogo stick U/S - Replaced POS 4 guard U/S Need replaced - replace next service Diverter valve leaking Hyd hose on diverter valve cracked - replace when truck return for suspension No turbo cover Shackle pins & bushes have excessive wear - parts ordered 02.01.2024 R3831 Fuel gauge U/S - parts ordered 02.01.2024 R3461	
02/01/2024		Turntable - Ringfeeder and Kingpin Inspection I-725 See attached inspection form	Randall Kruger - ADS
01/01/2024		Suspension - URGENT R-3032 See attached jobcard Repairs carried out @ Big Wheels Mackay 04/12/2023	Big Wheels Truck Alignment
01/12/2023	327,194 kms 11,896 hrs	Hydraulics - IMPORTANT R-3165 See attached jobcard 3165 Tested PTO and no fault can be found Chris S inspected with me	Internal Workshop
01/12/2023	327,746 kms 11,909 hrs	Electrical - IMPORTANT R-3479 See attached jobcard 3479 Breakdown - travel and inspect fault. Inspect isolators and e-stops. Inspect and modify e-stop wiring from fire suppression. Run up and test, no further faults.	Internal Workshop
01/12/2023	327,194 kms 11,896 hrs	Cab, Other R-3080 See attached jobcard 3080 Can not fault	Internal Workshop
01/12/2023	327,194 kms 11,896 hrs	Cab, Lights - IMPORTANT R-2736 See attached jobcard 2736 Inside lights faulty, advise supervisor of findings No further work Replaced interior cab light	Internal Workshop
01/12/2023	327,194 kms 11,896 hrs	Windscreen/Mirrors - IMPORTANT R-3319 See attached jobcard 3319 Replaced washer jet/cleaned out	Internal Workshop
01/12/2023	327,194 kms 11,896 hrs	WINDSCREEN WASHER / WIPER - IMPORTANT R-3034 See attached jobcard 3034 Replaced wiper arm	Internal Workshop
01/12/2023	327,194 kms 11,896 hrs	Windscreen/Mirrors - IMPORTANT R-2954 See attached jobcard 2954 Replaced wiper arm	Internal Workshop
01/12/2023	327,194 kms 11,896 hrs	Lights - IMPORTANT R-2735 See attached jobcard 2735 Inside lights faulty, advise supervisor of findings. No further work done. Replaced with new light	Internal Workshop
27/11/2023	326,071 kms 11,865 hrs	Lights - IMPORTANT R-3338 See attached jobcard 3338 New LED light fitted	Internal Workshop
27/11/2023		Lights - IMPORTANT R-2665 See attached jobcard 2665 Parts in store 20.10.23 Driver side work light not working, light faulty, advise supervisor of findings, no further work	Internal Workshop
27/11/2023	326,070 kms	A - 8 Wks S-3131 See attached service jobcard 3131 Rear spring eye bush still need replacing and spring hangers 23.11.23 Chip in rhs front window - monitor Wheel chocks missing - fitted new wheel chocks Fire suppression fault Coolant weap from pipe on back of water pump - coolant cross over pipe and o rings required Front diff head weaping oil Deverter valve weaping oil Drive spring eye u/s - big wheels to rectify POS 2 mudguard, tyres worn through King pins u/s - replaced king pins Front spring shackle pin and bushes u/s - Big wheels to rectify Steer tyres worn - replaced steer tyres	Internal Workshop
27/11/2023	326,070 kms	Steering - URGENT R-3033 See attached jobcard 3033 Replaced king pins	Internal Workshop

Date	Reading / Units	Type / Repairer Notes	Repairer
27/11/2023	326,071 kms 11,865 hrs	Lights - IMPORTANT R-3028 See attached jobcard 3028 Parts used -Part number: 72449 - LED Work lamp flood beam x 1 Replaced drivers side work light, no light supplied for passenger side	Internal Workshop
27/11/2023	326,070 kms	Battery - IMPORTANT R-2955 See attached jobcard 2955 Test fine no replacement needed	Internal Workshop
27/11/2023	326,070 kms	Brakes - URGENT, Leak - IMPORTANT R-3163 See attached jobcard 3163 Replaced drains in tank	Internal Workshop
23/11/2023		Damage R-3280 See attached jobcard 3280 Removed seized bearings, Freed up and regrease test operation	Internal Workshop
23/11/2023		Transmission/Clutch - URGENT R-3031 See attached jobcard 3031 Loose filter/ tightened filter	Internal Workshop
09/11/2023	307,381 kms 11,422 hrs	Lights - IMPORTANT R-3076 See attached jobcard 3076 Repaired wiring on RHS indicator	Internal Workshop
09/11/2023		Missing, Other R-3147 See attached jobcard 3147 Gave first aid kit to operation supervisor to put in truck	Internal Workshop
09/11/2023		Fuel R-3130 See attached jobcard 3130 Cable tied fuel line up	Internal Workshop
09/11/2023		Missing R-3126 See attached jobcard 3126 Put new road train sign on trailer	Internal Workshop
06/11/2023		Hydraulics - IMPORTANT, Leak - IMPORTANT R-3146 See attached jobcard 3146 Ryan went down in the morning and sorted	Internal Workshop
27/10/2023		Cab R-3027 see attached jobcard 3027 Kit is in cab New first aid kit in cab	Internal Workshop
23/10/2023		Fire Suppression Inspection I-733 See attached report	Pyro Dynamics Pty Ltd
19/10/2023		Missing R-2936 See attached jobcard Fitted new set to unit	Ryan Rosman - TMT Mechanical
19/10/2023		Turntable - IMPORTANT R-2984 See attached jobcard Inspected Turntable & found in safe working order.	Christopher Solmon
19/10/2023	301,929 kms 11,843 hrs	B - 35,000 S-2958 B Service carried out as per service record	Ryan Rosman - TMT Mechanical
18/10/2023	308,525 kms	Brake Test Annual I-855 See attached report	Nick Fenton
07/10/2023		Windscreen/Mirrors - IMPORTANT R-2415 See attached jobcard Can not fault	Christopher Solmon
07/10/2023		Radiator - IMPORTANT R-2477 See attached jobcard Ok at time of inspection	Christopher Solmon
06/10/2023	294,111 kms 11,102 hrs	A - 8 Wks S-2922	Christopher Solmon

Date	Reading / Units	Type / Repairer Notes	Repairer
		See attached Service Jobcard Both door seal leaking High / Low beam fault - repaired Joseph TNT LH Window wash not working - next service LH Whipper blade needs replaced - Next service Battery needs load testing, hard to start - next service No turbo blanket Gearbox oil leak & filter housing - cleaned & reinspected Fuel Cooler leaking - replaced Bonnet grill bolts missing - repaired Ride lugut control valve leaking - repaired	
04/10/2023		Fuel R-2501 See attached jobcard Working when check is performed Working a the time of testing Cleaned both RHS tank breathers Checked hoses are hooked up & working.	Joseph Celetaria
04/10/2023		Fuel R-2485 See attached jobcard Unable to fault gauge Working at the time of check.	Joseph Celetaria
12/09/2023	281,217 kms	Compliance R-2582 Confirmation of speed limited vehicle - VD83 Speed limited to 87kmph	Internal Workshop
12/09/2023	281,217 kms	Compliance R-2598 System audit confirms both are in working order	
04/09/2023	293,122 kms	Leak - IMPORTANT R-2856 Upon inspection could not fault large air leak Found small pin hole in both rear bags - replace both bags	Christopher Solmon
30/08/2023		Steering - URGENT, Suspension - URGENT R-2469 Inspected - Could not fault at the time	Internal Workshop
29/08/2023	277,035 kms 10,692 hrs	Engine R-2434 Topped up at Service	Internal Workshop
27/08/2023		Other R-2048 New spring fitted - checked at service	Internal Workshop
27/08/2023		Electrical - IMPORTANT, Lights - IMPORTANT, Reverse Alarm - IMPORTANT R-2468 Spotlights - broken earth repair open circuit Cable corrosion - Solder on new piece Tidy up wire in front head lights Loose plug on cluster of left indicator - secure plug Reverse light and beeper - carry out test and locate short, run new cable from switch to output Locate faulty reverse switch	Jospeh Celetaria
26/08/2023	278,718 kms 10,730 hrs	B - 35,000 S-2748 B Service carried out as per service record - DJ/TC Secure connection for indicator flash on dash Tightened bolts and need to be monitored - PTO gasket leaking Tightened yoak nut on diff leaking Removed and refitted centre bearing Wheel seal leak - Remove and replace seal - Fit new brakes Remove turntable and tighten bolts - crossmember under gearbox was loose Remove and replace remote gearbox fitler fittings leaking - tighten fittings Remove and replace Alt bearing noise Fitted bolt - missing in grill	Internal Workshop
26/08/2023	257,472 kms	Damage R-2175 Inspected, lubricated and rested recliner latch - Tested operational	Internal Workshop
26/08/2023	257,472 kms	Damage R-2176 No fault Found	Internal Workshop
26/08/2023		Fuel R-2222	Internal Workshop
06/08/2023	264,655 kms	A - 8 Wks S-2621 A service carried out as per service sheet - DH Reapiored window washes Tightened coolant hose clamp Parts on order 08.08.2023 Fuel cooler Window waswher lid driver side sun visor 90mm Holland FW700 Jaw kit Turntable pivot pinbs and bushed - Holland FW700	Internal Workshop
26/07/2023		Wheels/Tyres - URGENT R-2277 Retorque after 50kms travelled	Ryan Rosman - TMT Mechanical
17/07/2023	252,234 kms 10,099 hrs	Electrical - IMPORTANT R-2025	Randall Kruger - ADS

Date	Reading / Units	Type / Repairer Notes	Repairer
		Repaired - Cable tied	
17/07/2023	252,233 kms 10,099 hrs	A - 8 Wks S-2525 A Service carried out as per service report Water leaking on passenger floor - A/c drain - Repaired Fuel cooler leaking in LH chassis - Removed, welded and refitted Gearbox oil leaking into PTO air line into cab - Cleaned / Repaired Bonnet springs not fitted - Repaired Dash panel loose on park brake valve - Repaired RH exhaust broken under stack - Replace flex and clamps Wheel chock missing - Replaced	Randall Kruger - ADS
14/07/2023		Damage R-2109 Seat not locking back. Pulled apart, cleaned and adjusted latch. lubricated and put back together. All repaired	Randall Kruger - ADS
09/07/2023	247,449 kms 9,969 hrs	Leak - IMPORTANT R-1966 5th overhaul jaws and pivots and air leaks. Replace tank 5/8 unions	Hugh Middleton VDPH Maintenance Coordinator
28/06/2023	243,874 kms	B - 35,000 S-2352 B Service carried out as per service report Bull bar carrier split cracked insecure - HM Screen wash inop - Clear jet and replace T-piece DH Brake pedal rubber missing - Temporary fixed need new rubber DH 2way speaker insecure - Repaired DH RHF steer tyre poor condition worn past limit - Replaced HM Front pivots worn on bonnet - s/able next service HM Auto Lube inop - Repair and fill reservoir clean out wrong grease HM 1st Diff slight weep Pot face - S/able HM Hydraulic oil leak at DVT over spill from hose change HM	Duane Hitch - Sourth East Mechanical, Hugh Middleton VDPH Maintenance Coordinator
26/06/2023	242,541 kms	A - 8 Wks S-2464 A Service carried out as per service report Dash light inop various guages - Remove and replace all dash light bulbs Air leak PTO control line - Remove and replace no.1 tip control line Wiper blades split - Remove and replace wiper blades	Hugh Middleton VDPH Maintenance Coordinator
25/06/2023	241,530 kms 9,817 hrs	Other R-1888 Fix exhaust clamp on RHS exhaust	Duane Hitch - Sourth East Mechanical
27/05/2023	223,077 kms 9,453 hrs	Damage R-1620 Replace exhaust with new band clamp	Internal Workshop
26/05/2023		Leak - IMPORTANT R-1659 Tightened loose L/H Air stack. Checked all mounting bolts for tension. Adjusted tarp locks on all trailers	Randall Kruger - ADS
25/05/2023	221,256 kms	A - 8 Wks S-2247 A Service carried out as per service report LH 3rd Booster Leaking - Replaced	Randall Kruger - ADS
24/05/2023	221,256 kms 9,419 hrs	Transmission/Clutch - URGENT R-1586 Remove and Replace gearbox by Daniel Eggins	Internal Workshop
17/05/2023		Other R-1137 Sim cards were not activated - Activated Sims	Hugh Middleton VDPH Maintenance Coordinator
17/05/2023		Communication System - URGENT R-1440 Sim cards were not activated - Activated Sims	
07/05/2023	217,021 kms 9,263 hrs	Hydraulics - IMPORTANT R-1490 Blown hose under chassis. Removed, made new one and refitted. Topped up hydraulic oil tank 180L	Randall Kruger - ADS
05/05/2023		Air Conditioner R-1472 Inspect and test A/C system. Found gas level slightly low, Fill with correct amount of gas and retest. Found cabin filters blocked, Remove and clean filters and retest All Ok	Raw Auto Electrical
03/05/2023		Electrical - IMPORTANT R-1476 Fit PTO Alarm to truck. Connect alarm to pressure switch and test. Found pressure switch failed internally. Connect alarm and light to PTO switch and re-test, ALL OK	Raw Auto Electrical

Date	Reading / Units	Type / Repairer Notes	Repairer
30/04/2023	214,871 kms	A - 8 Wks S-2141 A Service carried out as per service report	ATL Diesel Services - Jordan Hasenkam
24/04/2023	208,820 kms 9,059 hrs	C - Annual S-1960 Carried out Initial Inspection 26.03.23 LH+RH Mirror load lamps Inop - HM LH+RH Mirror load lamps insecure - HM Cab Filthy - Require full detail - HM Wheel chocks - Replaced HM RH 1st axle auto lube pipe burst - Repaired HM Batteries require insulted covers - Repaired HM Drive spring eye bushes split - HM 1st Diff Idler shaft cover leaking - JH 1st Drive shocker - Excessive leak - Replaced JH 2nd Drive shockers - Excessive leak - Replaced JH Rear crosser between diff loose bolt - JH fuel cooler blocked matrix need blown out - JH 1st Diff center leaking - Resealed JH Starter isolator - New Isolator - JH E-stop - new estop - RAW Electrical	Internal Workshop
22/04/2023	213,358 kms	Leak - IMPORTANT, Suspension - URGENT R-1268 Changed all bushes and shocks Resealed diff	ATL Diesel Services - Jordan Hasenkam, Randall Kruger - ADS
17/04/2023		Electrical - IMPORTANT R-1181 Inspect reverse alarm fault, Found reverse alarm and switch failed - Supply and fit new reverse alarm, All OK. Fit customer supplied reverse switch, all OK	Raw Auto Electrical
14/04/2023		Electrical - IMPORTANT R-1224 Found Ign Sw Wiring loose, Tighten an Test All OK	Raw Auto Electrical
11/04/2023	401,000 kms	Fire Suppression Inspection I-2058 Complete 12-month fire suppression service System is compliant with AS5062 and in a good serviceable condition.	Pyro Dynamics Pty Ltd
08/04/2023	210,578 kms 9,100 hrs	A - 8 Wks S-2012 A Service carried out as per service report All 4 drive spring eye bush's need replacing All 4 drive shockers need replacement PTO Slight oil leak 1st diff center oil leak R-1268 all jobs turned into a repair to be booked in.	Duane Hitch - Sourth East Mechanical
08/04/2023		Electrical - IMPORTANT R-1240 Replace broken E-Stop (Wire in Fire Suppression)	Duane Hitch - Sourth East Mechanical
27/03/2023	208,560 kms	Engine R-1255 Replace air comp & govener valve Check over, wash & clean parts ordered for extra repairs	Frank Hale - All Crane & Heavy Vehicle Repairs
27/03/2023	208,820 kms	Brake Test Annual I-576 PASS	Nick Fenton
24/03/2023		Lights - IMPORTANT R-1124 As per Repair Report	ABC Automotive A/C & Electrical

Signed: _____

Name: _____

Date: _____